

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start		Rating **	A	Issue No.	<b>4</b>
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
DWR ID	DWR_LD0001S_01_s_2013_4				
Comment Code					
Inspector Comment					
O&M manuals are stored at the district office at 243 2nd st, Yuba City, CA.					

No Photos

LM Start		Rating **	A	Issue No.	<b>5</b>
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
DWR ID	DWR_LD0001S_01_s_2013_5				
Comment Code					
Inspector Comment					
Supplies and flood fight equipment are stored at the district office. They also went in with RD784 in their large stockpile of flood fight supplies located in their district.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start		Rating **	A	Issue No.	6	
LM End		Issue Type +	Ma	Location *		
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Flood Preparedness & Training				o	
					o	
DWR ID	DWR_LD0001S_01_s_2013_6					
Comment Code						
Inspector Comment						
Drew and the district employees attended the Flood Fight class put on by DWR and RD784 annually.						

No Photos

LM Start	0.02	Rating **	A	Issue No.	16
LM End	16.10	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.951182 °	39.168748 °
				-121.585689 °	-121.622711 °
DWR ID	DWR_LD0001S_01_s_2018_16				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual Vegetation is well maintained the entire length of the levee, Spring 2018.					

Photo 1 of 3 : SP\_2018\_LD0001S\_433\_16\_20180319\_00055.jpg



View looking upstream landside of the well maintained annual vegetation at Levee Mile 0.02, Spring 2018.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	0.02	Rating **	A	Issue No.	16 (cont)	
LM End	16.10	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			38.951182 °		39.168748 °
				-121.585689 °		-121.622711 °
DWR ID	DWR_LD0001S_01_s_2018_16					
Comment Code						
V1 : Control annual grass and weeds on the levee slopes and easements.						
Inspector Comment						
Annual Vegetation is well maintained the entire length of the levee, Spring 2018.						

Photo 2 of 3 : SP\_2018\_LD0001S\_433\_16\_20180319\_00056.jpg



View looking upstream landside of the well maintained annual vegetation at Levee Mile 6.16, Spring 2018.

LM Start	<b>0.02</b>	Rating **	A	Issue No.	<b>16 (cont)</b>
LM End	<b>16.10</b>	Issue Type +	Ma	Location *	LS

Photo 3 of 3 : SP\_2018\_LD0001S\_433\_16\_20180319\_00057.jpg



View looking upstream landside of the well maintained annual vegetation at Levee Mile 10.48, Spring 2018.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	0.02	Rating **	A	Issue No.	17
LM End	16.10	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.951182 °	39.168748 °
				-121.585689 °	-121.622711 °
DWR ID	DWR_LD0001S_01_s_2018_17				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual Vegetation is well maintained the entire length of the levee, Spring 2018.					

Photo 1 of 3 : SP\_2018\_LD0001S\_433\_17\_20180319\_00059.jpg



View looking upstream waterside of the well maintained annual vegetation at Levee Mile 0.02, Spring 2018.

LM Start	<b>0.02</b>	Rating **	A	Issue No.	<b>17 (cont)</b>
LM End	<b>16.10</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : SP\_2018\_LD0001S\_433\_17\_20180319\_00058.jpg



View looking upstream waterside of the well maintained annual vegetation at Levee Mile 6.24, Spring 2018.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	0.02	Rating **	A	Issue No.	17 (cont)	
LM End	16.10	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			38.951182 °		39.168748 °
				-121.585689 °		-121.622711 °
DWR ID	DWR_LD0001S_01_s_2018_17					
Comment Code						
V1 : Control annual grass and weeds on the levee slopes and easements.						
Inspector Comment						
Annual Vegetation is well maintained the entire length of the levee, Spring 2018.						

Photo 3 of 3 : SP\_2018\_LD0001S\_433\_17\_20180319\_00060.jpg



View looking upstream waterside of the well maintained annual vegetation at Levee Mile 10.92, Spring 2018.

LM Start	2.21	Rating **	M	Issue No.	39
LM End	2.21	Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			38.982135 °	38.982135 °
				-121.591974 °	-121.591974 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:11383					
DS_ID:17915					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Siphon breaker cap missing. Sump pump and gate valve at landward toe not found may be due to dense vegetation.					
FIELD_STRUCT_DESC: 8-inch coated steel pipe of an unknown purpose through the levee, 4.6 feet below the crown. Siphon breaker in a corrugated metal pipe (CMP) riser on the landside (LS) slope.					
[Additional Reference(s): DWR Levee Log, 2005. USACE Sacramento O&M Manual 144, August 1955, (Station 638+07)].					
FS Date: 4/12/2013					

Photo 1 of 3 : UCIP\_SP\_2018\_11383\_18782.jpg



WS- 8-inch steel pipe and disconnected pvc pipe on levee slope

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	2.21	Rating **	M	Issue No.	39 (cont)	
LM End	2.21	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			38.982135 °		38.982135 °
				-121.591974 °		-121.591974 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:11383						
DS_ID:17915						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Siphon breaker cap missing. Sump pump and gate valve at landward toe not found may be due to dense vegetation.						
FIELD_STRUCT_DESC: 8-inch coated steel pipe of an unknown purpose through the levee, 4.6 feet below the crown. Siphon breaker in a corrugated metal pipe (CMP) riser on the landside (LS) slope.						
[Additional Reference(s): DWR Levee Log, 2005. USACE Sacramento O&M Manual 144, August 1955, (Station 638+07)].						
FS Date: 4/12/2013						

LM Start	<b>2.21</b>	Rating **	M	Issue No.	<b>39 (cont)</b>
LM End	<b>2.21</b>	Issue Type +	Ma	Location *	

Photo 2 of 3 : UCIP\_SP\_2018\_11383\_18781.jpg



WS-a disconnected pvc pipe on levee slope

Photo 3 of 3 : UCIP\_SP\_2018\_11383\_18780.jpg



LS- CMP riser on levee slope with dense vegetation.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	4.41	Rating **	A/W	Issue No.	36
LM End	4.41	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.011493 °	39.011493 °
				-121.603624 °	-121.603624 °
DWR ID	DWR_LD0001S_01_f_2016_36				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
No erosion or separation on slope, continue to monitor, Fall 2017.					

Photo 1 of 2 : SP\_2018\_LD0001S\_433\_36\_20180302\_00015.jpg



View of waterside slope where vehicles have been driving up and down to go around gate. Fall 2017.

LM Start	<b>4.41</b>	Rating **	A/W	Issue No.	<b>36 (cont)</b>
LM End	<b>4.41</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP\_2018\_LD0001S\_433\_36\_20180302\_00016.jpg



View of waterside slope where vehicles have been driving up and down to go around gate. Fall 2016.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	5.02	Rating **	A/W	Issue No.	25	
LM End	5.02	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	2017 Storm Damage			39.018322 °	39.018322 °	
				-121.610275 °	-121.610275 °	
DWR ID	DWR_LD0001S_01_f_2017_25					
Comment Code						
Inspector Comment						
Levee Evaluation Comments						
Description:						
Site ID No:145						
Site Designation:LD1-S-02						
Repair Type: Erosion						
Rating:Critical						
Field Date:7/17/2017						
Notes:						

Photo 1 of 3 : LEVAL\_SP\_2018\_145\_1767.jpg



LM Start	<b>5.02</b>	Rating **	A/W	Issue No.	<b>25 (cont)</b>
LM End	<b>5.02</b>	Issue Type +	Ma	Location *	

Photo 2 of 3 : LEVAL\_SP\_2018\_145\_1768.jpg



<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018


**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	5.02	Rating **	A/W	Issue No.	25 (cont)	
LM End	5.02	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	2017 Storm Damage			39.018322 °	39.018322 °	
				-121.610275 °	-121.610275 °	
DWR ID	DWR_LD0001S_01_f_2017_25					
Comment Code						
Inspector Comment						
Levee Evaluation Comments						
Description:						
Site ID No:145						
Site Designation:LD1-S-02						
Repair Type: Erosion						
Rating:Critical						
Field Date:7/17/2017						
Notes:						

Photo 3 of 3 : LEVAL\_SP\_2018\_145\_1769.jpg

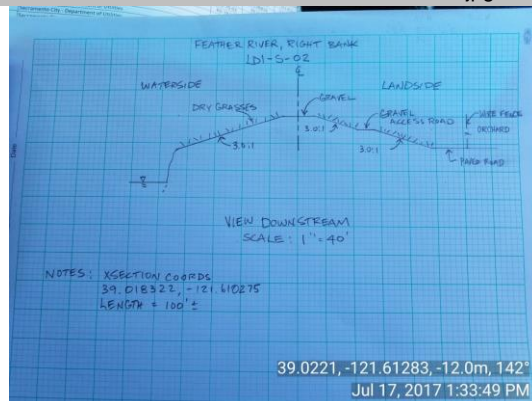

LM Start	6.81	Rating **	C	Issue No.	20
LM End	6.81	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.043262 °	39.043262 °
				-121.611527 °	-121.611527 °
DWR ID	DWR_LD0001S_01_s_2017_20				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Large animal burrows on slope approximately 50 feet from waterside hinge point has been repaired April 17, 2018. No signs of animal activity, Spring 2018.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	7.69	Rating **	A/W	Issue No.	19	
LM End	7.74	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	2017 Storm Damage			39.055986 °	39.056710 °	
				-121.611301 °	-121.611331 °	
DWR ID	DWR_LD0001S_01_f_2017_19					
Comment Code						
Inspector Comment						
Levee Evaluation Comments						
Description:						
Site ID No:146						
Site Designation:LD1-S-03						
Repair Type: Erosion						
Rating:Area of Concern						
Field Date:8/3/2017						
Notes:						

Photo 1 of 3 : LEVAL\_SP\_2018\_146\_4051.jpg



LM Start	<b>7.69</b>	Rating **	A/W	Issue No.	<b>19 (cont)</b>
LM End	<b>7.74</b>	Issue Type +	Ma	Location *	

Photo 2 of 3 : LEVAL\_SP\_2018\_146\_4053.jpg



* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	7.69	Rating **	A/W	Issue No.	19 (cont)	
LM End	7.74	Issue Type +	Ma	Location *		
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	2017 Storm Damage			39.055986 °	39.056710 °	
				-121.611301 °	-121.611331 °	
DWR ID	DWR_LD0001S_01_f_2017_19					
Comment Code						
Inspector Comment						
Levee Evaluation Comments						
Description:						
Site ID No:146						
Site Designation:LD1-S-03						
Repair Type: Erosion						
Rating:Area of Concern						
Field Date:8/3/2017						
Notes:						

Photo 3 of 3 : LEVAL\_SP\_2018\_146\_4054.jpg



LM Start	12.15	Rating **	A/W	Issue No.	31
LM End	15.09	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.116846 °	39.155672 °
				-121.604524 °	-121.616478 °
DWR ID	DWR_LD0001S_01_f_2017_31				
Comment Code					
Inspector Comment					
This section of levee is still under construction, It has been brought up to grade and the bike path needs to be paved a few more punch list item finished up before it is turned over to the LMA, Spring 2018.					

Photo 1 of 4 : SP\_2018\_LD0001S\_433\_31\_20180319\_00066.jpg



View of erosion from run off at a ramp. This will be repaired with the punch list for the completion of the project, Spring 2018.

* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	--	--	--	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	12.15	Rating **	A/W	Issue No.	31 (cont)	
LM End	15.09	Issue Type +	Ma	Location *	CR	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Crown Surface / Depressions / Rutting			39.116846 °		39.155672 °
				-121.604524 °		-121.616478 °
DWR ID	DWR_LD0001S_01_f _2017_31					
Comment Code						
Inspector Comment						
This section of levee is still under construction, It has been brought up to grade and the bike path needs to be paved a few more punch list item finished up before it is turned over to the LMA, Spring 2018.						

Photo 2 of 4 : SP\_2018\_LD0001S\_433\_31\_20180319\_00067.jpg



View looking downstream. This section of levee is still under construction, It has been brought up to grade and the bike path needs to be paved, also a few more punch list item finished up before it is turned over to the LMA, Spring 2018.

LM Start	<b>12.15</b>	Rating **	A/W	Issue No.	<b>31 (cont)</b>
LM End	<b>15.09</b>	Issue Type +	Ma	Location *	CR

Photo 3 of 4 : SP\_2018\_LD0001S\_433\_31\_20180319\_00068.jpg



View looking upstream. This section of levee is still under construction, It has been brought up to grade and the bike path needs to be paved, also a few more punch list item finished up before it is turned over to the LMA, Spring 2018.

* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2018

**\*\* SBFCA currently has operation and maintenance obligations during project construction and closeout.**

### Levee District No. 0001 (Sutter County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Feather River	Right	16.11	03/13/2018 03/13/2018	Sterling York

LM Start	12.15	Rating **	A/W	Issue No.	31 (cont)	
LM End	15.09	Issue Type +	Ma	Location *	CR	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Crown Surface / Depressions / Rutting			39.116846 °	39.155672 °	
				-121.604524 °	-121.616478 °	
DWR ID	DWR_LD0001S_01_f_2017_31					
Comment Code						
Inspector Comment						
This section of levee is still under construction, It has been brought up to grade and the bike path needs to be paved a few more punch list item finished up before it is turned over to the LMA, Spring 2018.						

Photo 4 of 4 : SP\_2018\_LD0001S\_433\_31\_20180302\_00011.jpg



View looking upstream at the start point of the new construction of the levee, Fall 2017.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---