

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	11/18/2015 11/18/2015	Bob Duffey

LM Start		Rating **	A	Issue No.	6
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Emergency Supplies & Equipment			°	°
DWR ID	DWR_NA0006_01_s_2013_6				
Action/Comments					
Inspector Comments: The LMA has stated in the past that they do have access to flood fight supplies.					

No Photos

LM Start		Rating **	M	Issue No.	9
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Flood Preparedness & Training			°	°
DWR ID	DWR_NA0006_01_s_2012_9				
Action/Comments					
Inspector Comments: The LMA does not regularly attend Flood Fight classes put on by DWR.					

No Photos

LM Start		Rating **	M	Issue No.	10
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Operations & Maintenance Manuals			°	°
DWR ID	DWR_NA0006_01_s_2012_10				
Action/Comments					
Inspector Comments: No manual was available during the inspection.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	11/18/2015 11/18/2015	Bob Duffey

LM Start	0.02	Rating **	U	Issue No.	13
LM End	0.57	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.298502 °	39.297998 °	
			-121.569482 °	-121.559940 °	
DWR ID	DWR_NA0006_01_f_2015_13				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Remove the vegetation from the landside slope.					

Photo 1 of 1 : FA_2015_NA0006_252_13_20151120_00015.jpg



View of the vegetation on the landside slope.

LM Start	0.02	Rating **	U	Issue No.	14
LM End	0.57	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.298502 °	39.297998 °	
			-121.569482 °	-121.559940 °	
DWR ID	DWR_NA0006_01_f_2015_14				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: remove the vegetation from the waterside slope.					

Photo 1 of 1 : FA_2015_NA0006_252_14_20151120_00016.jpg



View of the vegetation on the waterside slope.

LM Start	0.07	Rating **	M	Issue No.	21
LM End	0.66	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.299158 °	39.297595 °	
			-121.569024 °	-121.558310 °	
DWR ID	DWR_NA0006_01_s_2015_21				
Action/Comments					
Repair depressions or ruts in the crown or slope. Inspector Comments: Place appropriate gravel on the crown roadway to make it a all weather road.					

Photo 1 of 1 : FA_2015_NA0006_252_21_20151120_00017.jpg



View of the ruts on the crown roadway.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	11/18/2015 11/18/2015	Bob Duffey

LM Start	0.22	Rating **	U	Issue No.	16
LM End	0.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		39.298827 °	39.298827 °	
			-121.566401 °	-121.566401 °	
DWR ID	DWR_NA0006_01_f_2014_16				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: Trees should be trimmed up or removed to maintain visibility of landward levee slope.					

Photo 1 of 1 : FA_2015_NA0006_252_16_20151109_00006.jpg



This photo was taken from the crown facing west looking down the landward levee slope at trees that either need to be trimmed up or removed to provide slope visibility. Fall 2014.

LM Start	0.57	Rating **	M	Issue No.	3
LM End	1.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.298019 °	39.295255 °	
			-121.559940 °	-121.546436 °	
DWR ID	DWR_NA0006_01_s_2012_3				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 1 : FA_2015_NA0006_252_3_20151109_00002.jpg



View of the vegetaion on the waterside of the levee facing downstream.

LM Start	0.57	Rating **	M	Issue No.	1
LM End	1.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.298018 °	39.295254 °	
			-121.559940 °	-121.546437 °	
DWR ID	DWR_NA0006_01_s_2012_1				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 1 : FA_2015_NA0006_252_1_20151109_00001.jpg



View of the vegetation on the landside of the levee facing downstream.

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---