

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/07/2016 04/07/2016	Sterling York

LM Start		Rating **	M	Issue No.	6
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_NA0006_01_s _ 2013_6				
Comment Code					
Inspector Comment					
This levee is maintained by the private land owner, Jimmy Vantress, and should be contacted before entering the property. Phone number is (530) 682-5874. The code to the gate is 0911. The LMA has stated in the past that they do have access to flood fight supplies.					

No Photos

LM Start		Rating **	M	Issue No.	9
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_NA0006_01_s _ 2012_9				
Comment Code					
Inspector Comment					
The LMA does not regularly attend Flood Fight classes put on by DWR.					

No Photos

LM Start		Rating **	M	Issue No.	10
LM End		Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_NA0006_01_s _ 2012_10				
Comment Code					
Inspector Comment					
No manual was available during the inspection.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/07/2016 04/07/2016	Sterling York

LM Start	0.02	Rating **	U	Issue No.	13
LM End	0.57	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298502 °	39.297998 °
				-121.569482 °	-121.559940 °
DWR ID	DWR_NA0006_01_f_2015_13				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the vegetation from the landside slope.					

Photo 1 of 1 : SP_2016_NA0006_252_13_20160307_00005.jpg



View of the vegetation on the landside slope.

LM Start	0.02	Rating **	U	Issue No.	14
LM End	0.57	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298502 °	39.297998 °
				-121.569482 °	-121.559940 °
DWR ID	DWR_NA0006_01_f_2015_14				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
remove the vegetation from the waterside slope.					

Photo 1 of 1 : SP_2016_NA0006_252_14_20160307_00006.jpg



View of the vegetation on the waterside slope.

LM Start	0.07	Rating **	M	Issue No.	21
LM End	0.66	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.299158 °	39.297595 °
				-121.569024 °	-121.558310 °
DWR ID	DWR_NA0006_01_s_2015_21				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					
Place appropriate gravel on the crown roadway to make it a all weather road.					

Photo 1 of 1 : SP_2016_NA0006_252_21_20160307_00009.jpg



View of the ruts on the crown roadway.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/07/2016 04/07/2016	Sterling York

LM Start	0.22	Rating **	U	Issue No.	16
LM End	0.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298827 °	39.298827 °
				-121.566401 °	-121.566401 °
DWR ID	DWR_NA0006_01_f_2014_16				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Trees should be trimmed up or removed to maintain visibility of landward levee slope.					

Photo 1 of 1 : SP_2016_NA0006_252_16_20160307_00007.jpg



This photo was taken from the crown facing west looking down the landward levee slope. Small trees 4" in diameter at chest height should be removed before they get to big.. Fall 2014.

LM Start	0.42	Rating **	M	Issue No.	15
LM End	0.42	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298377 °	39.298377 °
				-121.562700 °	-121.562700 °
DWR ID	DWR_NA0006_01_s_2016_15				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Blackberries taking over waterside slope.					

Photo 1 of 1 : SP_2016_NA0006_252_15_20160418_00027.jpg



Vegetation waterside looking upstream.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/07/2016 04/07/2016	Sterling York

LM Start	0.57	Rating **	M	Issue No.	3
LM End	1.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298019 °	39.295255 °
				-121.559940 °	-121.546436 °
DWR ID	DWR_NA0006_01_s _ 2012_3				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0006_252_3_20160418_00028.jpg



Vegetation on waterside looking upstream.

LM Start	0.57	Rating **	M	Issue No.	1
LM End	1.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298018 °	39.295254 °
				-121.559940 °	-121.546437 °
DWR ID	DWR_NA0006_01_s _2012_1				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

LM Start	0.86	Rating **	M	Issue No.	18
LM End	1.45	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.294995 °	39.295288 °
				-121.557643 °	-121.546672 °
DWR ID	DWR_NA0006_01_s _ 2016_18				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0006_252_18_20160418_00029.jpg



Vegetation on the landside looking upstream.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	---	--	---	--	--	--