

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start		Rating **	M	Issue No.	6
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_NA0006_01_s _ 2013_6				
Comment Code					
Inspector Comment					
This levee is maintained by the private land owner, Jimmy Vantress, and should be contacted before entering the property. Phone number is (530) 682-5874. The code to the gate is 0911. The LMA has stated in the past that they do have access to flood fight supplies.					

No Photos

LM Start		Rating **	M	Issue No.	9
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_NA0006_01_s _ 2012_9				
Comment Code					
Inspector Comment					
The LMA does not regularly attend Flood Fight classes put on by DWR.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start		Rating **	M	Issue No.	10
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals				
DWR ID	DWR_NA0006_01_s_2012_10				
Comment Code					
Inspector Comment					
No manual was available during the inspection.					

No Photos

LM Start	0.01	Rating **	M	Issue No.	27
LM End	0.01	Issue Type +	Ma	Location *	N/A
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP LMA Responsibility		39.298484 °	39.298484 °	
			-121.569610 °	-121.569610 °	
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:14731 DS_ID:19167 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: Dense vegetation on landward side obstructs inspection. Vegetation needs to be cleared to perform utility crossing inspection. FIELD_STRUCT_DESC: 24-inch corrugated metal drain pipe through the levee 12.0 feet below the crown. Flap gate on waterward end. Originally included the O&M manual, 1953. FS Date: 5/1/2013					

Photo 1 of 3 : UCIP_SP_2017_14731_24228.jpg



View of crown looking east.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.01	Rating **	M	Issue No.	27 (cont)	
LM End	0.01	Issue Type +	Ma	Location *	N/A	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			39.298484 °		39.298484 °
				-121.569610 °		-121.569610 °
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:14731						
DS_ID:19167						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: Dense vegetation on landward side obstructs inspection. Vegetation needs to be cleared to perform utility crossing inspection.						
FIELD_STRUCT_DESC: 24-inch corrugated metal drain pipe through the levee 12.0 feet below the crown. Flap gate on waterward end. Originally included the O&M manual, 1953.						
FS Date: 5/1/2013						

Photo 2 of 3 : UCIP_SP_2017_14731_24225.jpg



View of railroad looking west of crossing.

LM Start	0.01	Rating **	M	Issue No.	27 (cont)
LM End	0.01	Issue Type +	Ma	Location *	N/A

Photo 3 of 3 : UCIP_SP_2017_14731_24229.jpg



Dense vegetation on waterward side obstructing inspection.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.02	Rating **	U	Issue No.	19
LM End	0.02	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298500 °	39.298500 °
				-121.569508 °	-121.569508 °
DWR ID	DWR_NA0006_01_f_2016_19				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove Blackberry bushes covering waterside levee slope.					

Photo 1 of 1 : SP_2017_NA0006_252_19_20170316_00008.jpg



View of Blackberry bushes covering waterside levee slope.

LM Start	0.02	Rating **	U	Issue No.	21
LM End	0.66	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.298504 °	39.297595 °
				-121.569502 °	-121.558310 °
DWR ID	DWR_NA0006_01_s_2015_21				
Comment Code					
C3 : Add appropriate gravel or road base. Grade and compact.					
Inspector Comment					
Place appropriate gravel on the crown roadway to make it an all weather road.					

Photo 1 of 1 : SP_2017_NA0006_252_21_20170316_00010.jpg



View of the crown looking upstream of a section of road that needs all weather surface. Fall 2016

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.02	Rating **	U	Issue No.	20
LM End	0.02	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298563 °	39.298563 °
				-121.569432 °	-121.569432 °
DWR ID	DWR_NA0006_01_f_2016_20				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
A tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.					

Photo 1 of 1 : SP_2017_NA0006_252_20_20170316_00009.jpg



View of a tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.

LM Start	0.02	Rating **	U	Issue No.	8
LM End	0.67	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298570 °	39.297562 °
				-121.569427 °	-121.558337 °
DWR ID	DWR_NA0006_01_s_2017_8				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Broad leaf thistle covering landside slope, Spring 2017.					

Photo 1 of 1 : SP_2017_NA0006_252_8_20170410_00034.jpg



View looking downstream of broad leaf thistle covering landside slope, Spring 2017.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.02	Rating **	M	Issue No.	18
LM End	1.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298570 °	39.295263 °
				-121.569427 °	-121.546580 °
DWR ID	DWR_NA0006_01_f_2016_18				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual vegetation needs to be maintained. Spring 2017.					

Photo 1 of 1 : SP_2017_NA0006_252_18_20170410_00033.jpg



View looking downstream waterside of annual vegetation that needs to be maintained. Spring 2017.

LM Start	0.02	Rating **	M	Issue No.	12
LM End	1.45	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298570 °	39.295263 °
				-121.569426 °	-121.546580 °
DWR ID	DWR_NA0006_01_f_2016_12				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Annual vegetation needs to be maintained. Spring 2017.					

Photo 1 of 1 : SP_2017_NA0006_252_12_20170410_00032.jpg



View looking downstream landside of annual vegetation that needs to be maintained. Spring 2017.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.09	Rating **	M	Issue No.	28
LM End	0.09	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.299106 °	39.299106 °
				-121.568749 °	-121.568749 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:14732					
DS_ID:19168					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Dense vegetation on waterward side and landward side obstructs inspection. Need to clear vegetation on slopes to conduct proper crossing evaluation.					
FIELD_STRUCT_DESC: 24-inch corrugated metal pipe through the levee 10 feet below the crown. Flap gate on the waterward end.					
Originally included in the O&M manual, 1953.					
FS Date: 5/1/2013					

Photo 1 of 3 : UCIP_SP_2017_14732_24241.jpg



Overview of levee crown at crossing looking upstream.

LM Start	0.09	Rating **	M	Issue No.	28 (cont)
LM End	0.09	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : UCIP_SP_2017_14732_24236.jpg



Dense vegetation obstructing waterward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.09	Rating **	M	Issue No.	28 (cont)
LM End	0.09	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			39.299106 °	39.299106 °
				-121.568749 °	-121.568749 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:14732					
DS_ID:19168					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Dense vegetation on waterward side and landward side obstructs inspection. Need to clear vegetation on slopes to conduct proper crossing evaluation.					
FIELD_STRUCT_DESC: 24-inch corrugated metal pipe through the levee 10 feet below the crown. Flap gate on the waterward end.					
Originally included in the O&M manual, 1953.					
FS Date: 5/1/2013					

Photo 3 of 3 : UCIP_SP_2017_14732_24238.jpg



Overview of waterward side (outlet).

LM Start	0.10	Rating **	M	Issue No.	22
LM End	0.10	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.299078 °	39.299078 °
				-121.568633 °	-121.568633 °
DWR ID	DWR_NA0006_01_f_2016_22				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
A tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.					

Photo 1 of 1 : SP_2017_NA0006_252_22_20170316_00011.jpg



View of a tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.21	Rating **	U	Issue No.	24
LM End	0.24	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298836 °	39.298768 °
				-121.566572 °	-121.565921 °
DWR ID	DWR_NA0006_01_f_2016_24				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove Blackberry bushes covering the waterside slope.					

Photo 1 of 1 : SP_2017_NA0006_252_24_20170316_00013.jpg



View of Blackberry bushes that cover the waterside slope. Fall 2016.

LM Start	0.21	Rating **	U	Issue No.	23
LM End	0.21	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298816 °	39.298816 °
				-121.566529 °	-121.566529 °
DWR ID	DWR_NA0006_01_f_2016_23				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Trees that needs the limbs trimmed up 5' for visibility and access on the landside. Fall 2016.					

Photo 1 of 1 : SP_2017_NA0006_252_23_20170316_00012.jpg



View of trees that needs the limbs trimmed up 5' for visibility and access on the landside. Fall 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.23	Rating **	M	Issue No.	25
LM End	0.23	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.298776 °	39.298776 °
				-121.566158 °	-121.566158 °
DWR ID	DWR_NA0006_01_f_2016_25				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.					

Photo 1 of 1 : SP_2017_NA0006_252_25_20170316_00014.jpg



View of a tree that needs the limbs trimmed up 5' for visibility and access on the waterside. Fall 2016.

LM Start	0.41	Rating **	U	Issue No.	26
LM End	0.41	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298367 °	39.298367 °
				-121.562820 °	-121.562820 °
DWR ID	DWR_NA0006_01_f_2016_26				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove Blackberry bushes covering landside slope.					

Photo 1 of 1 : SP_2017_NA0006_252_26_20170316_00015.jpg



View of Blackberry bushes that cover the landside slope. Looking upstream. Fall 2016.

* Location
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

** Rating
A : Acceptable N : Not Inspected/Rated
M : Minimally Acceptable C : Corrected
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2017

Eastern Honcut Creek

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Van Tress	Left	1.46	04/06/2017 04/06/2017	Sterling York

LM Start	0.42	Rating **	U	Issue No.	16
LM End	0.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.298355 °	39.298280 °
				-121.562702 °	-121.562032 °
DWR ID	DWR_NA0006_01_f_2016_16				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove Blackberry bushes covering waterside slope.					

Photo 1 of 1 : SP_2017_NA0006_252_16_20170316_00004.jpg



View of Blackberry bushes that cover the waterside slope. Looking upstream. Fall 2016.

LM Start	0.85	Rating **	M	Issue No.	1
LM End	0.96	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.294995 °	39.295021 °
				-121.557823 °	-121.555813 °
DWR ID	DWR_NA0006_01_f_2016_1				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove Blackberry bushes starting to take over waterside slope. Spring 2017.					

Photo 1 of 1 : SP_2017_NA0006_252_1_20170316_00001.jpg



View of Blackberry bushes that are starting to cover the waterside slope. Looking upstream. Fall 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--