

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Spring 2016 Levee Inspection Results

Yolo County Planning Resources and Public Works

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

* **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2016 Levee Inspection Results

Yolo County Planning Resources and Public Works

Waterway		Bank	Unit Miles
Unit No. 01 Right Bank Cache Creek		Right	0.59

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	3/22/2016 - 3/22/2016			
DWR Inspector	Jai Lor			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start		Rating **	U	Issue No.	5
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			o	o
DWR ID	DWR_NA0021_01_s_2012_5				
Comment Code					
Inspector Comment					
Yolo County Planning Resources and Public Works does not have levee manuals for their levees.					

No Photos

LM Start		Rating **	A	Issue No.	11
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			o	o
DWR ID	DWR_NA0021_01_s_2012_11				
Comment Code					
Inspector Comment					
Yolo County OES maintains a stockpile of flood response material.					

No Photos

LM Start		Rating **	A	Issue No.	12
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			o	o
DWR ID	DWR_NA0021_01_s_2012_12				
Comment Code					
Inspector Comment					
Yolo County OES has a written response plan and response training.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.03	Rating **	M	Issue No.	3
LM End	0.30	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.720879 °	38.722983 °	
			-121.810499 °	-121.806860 °	
DWR ID	DWR_NA0021_01_f_2015_3				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_3_20160223_00004.jpg



View of the vegetation on the waterward side of the levee looking downstream. Fall 2015.

LM Start	0.03	Rating **	M	Issue No.	15
LM End	0.03	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.720895 °	38.720895 °	
			-121.810408 °	-121.810408 °	
DWR ID	DWR_NA0021_01_f_2015_15				
Comment Code					
DE : Debris					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_15_20160223_00015.jpg



View of the debris on the waterward side of the levee. Fall 2015.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.19	Rating **	U	Issue No.	16
LM End	0.19	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		38.721536 °	38.721536 °	
			-121.807711 °	-121.807711 °	
DWR ID	DWR_NA0021_01_s_2015_16				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

LM Start	0.19	Rating **	U	Issue No.	16 (cont)
LM End	0.19	Issue Type +	Ma	Location *	LS

Photo 1 of 2 : SP_2016_NA0021_351_16_20160223_00016.jpg



View of the rodent hole on the landward side of the levee looking downstream. Spring 2015.

Photo 2 of 2 : SP_2016_NA0021_351_16_20160407_00027.jpg



View of the rodent holes on the landward side of the levee looking downstream. Spring 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.20	Rating **	M	Issue No.	7
LM End	0.20	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			38.721683 °	38.721683 °
				-121.807532 °	-121.807532 °
DWR ID	DWR_NA0021_01_s_2016_7				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 2 : SP_2016_NA0021_351_7_20160407_00028.jpg



Perspective view of the rodent hole on the landward side of the levee looking downstream. Spring 2016.

LM Start	0.20	Rating **	M	Issue No.	7 (cont)
LM End	0.20	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : SP_2016_NA0021_351_7_20160407_00029.jpg



Animal hole is close to the shoulder of the levee. Spring 2016.

LM Start	0.22	Rating **	U	Issue No.	8
LM End	0.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			38.721876 °	38.721876 °
				-121.807393 °	-121.807393 °
DWR ID	DWR_NA0021_01_s_2016_8				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_8_20160407_00030.jpg



View of the rodent holes on the landward side of the levee looking downstream. Spring 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.24	Rating **	M	Issue No.	23
LM End	0.24	Issue Type +	En	Location *	LS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		38.722162 °	38.722162 °	
			-121.807223 °	-121.807223 °	
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:39855 DS_ID:19554 EP_NO: 6790 Repair Type: Non-Urgent Crossing Status: Indicator Found UCIP Comments: Need to contact owner to determine if crossing is still active and to determine last inspection date. Will need copy of letter showing crossings passed inspection. FIELD_STRUCT_DESC: 6-inch gas line through levee, 4-feet below the crown. Pipe extends from borrow area and under the channel. Bleeder valve on waterward bank. Service vault located on landward side next to access gate. Paved access ramp on landward slope. (Permit No. 6790-1970) FS Date: 4/16/2013					

Photo 1 of 2 : UCIP_SP_2016_39855_69553.jpg



View of landward side near access gate. Gas line marker located on between trees. Line runs parallel to access roadway and through levee.

LM Start	0.24	Rating **	M	Issue No.	23 (cont)
LM End	0.24	Issue Type +	En	Location *	LS

Photo 2 of 2 : UCIP_SP_2016_39855_69554.jpg



Service vault located on landward toe near gate access gate.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.26	Rating **	M	Issue No.	4
LM End	0.26	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.722418 °	38.722418 °	
			-121.806999 °	-121.806999 °	
DWR ID	DWR_NA0021_01_s_2012_4				
Comment Code					
PR : Prunings					
Inspector Comment					

Photo 1 of 3 : SP_2016_NA0021_351_4_20160223_00005.jpg



A continuous brush pile on levee. Spring 2013

LM Start	0.26	Rating **	M	Issue No.	4 (cont)
LM End	0.26	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : SP_2016_NA0021_351_4_20160223_00006.jpg



The brush pile did not get burned this last winter. Spring 2014

LM Start	0.26	Rating **	M	Issue No.	4 (cont)
LM End	0.26	Issue Type +	Ma	Location *	WS

Photo 3 of 3 : SP_2016_NA0021_351_4_20160223_00007.jpg



The latest look of the ongoing brush pile. Fall 2013

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.26	Rating **	M	Issue No.	18
LM End	0.26	Issue Type +	En	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.722424 °	38.722424 °	
			-121.806977 °	-121.806977 °	
DWR ID	DWR_NA0021_01_s_2015_18				
Comment Code					
EQ : Equipment					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_18_20160223_00018.jpg



View of equipments on the landward side of the levee looking downstream. Spring 2015.

LM Start	0.26	Rating **	M	Issue No.	19
LM End	0.49	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.722473 °	38.725799 °	
			-121.806987 °	-121.806515 °	
DWR ID	DWR_NA0021_01_s_2016_19				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_19_20160407_00031.jpg



View of the vegetation on the landward side of the levee looking downstream. Spring 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.27	Rating **	M	Issue No.	22
LM End	0.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.722620 °	38.722620 °
				-121.806958 °	-121.806958 °
DWR ID	DWR_NA0021_01_f_2015_22				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
A vehicle ramp seems to have been made.					

LM Start	0.27	Rating **	M	Issue No.	22 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS

LM Start	0.27	Rating **	M	Issue No.	22 (cont)
LM End	0.27	Issue Type +	Ma	Location *	WS

Photo 1 of 3 : SP_2016_NA0021_351_22_20160223_00021.jpg



Perspective view of the trail on the waterward side of the levee looking downstream. Fall 2015.

Photo 2 of 3 : SP_2016_NA0021_351_22_20160223_00022.jpg



View of the trail on the waterward side of the levee. Fall 2015.

Photo 3 of 3 : SP_2016_NA0021_351_22_20160223_00023.jpg



The trail seems to be an access point that leads down to Cache Creek. Fall 2015.

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.27	Rating **	A/W	Issue No.	14
LM End	0.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.722633 °	38.722633 °	
			-121.806938 °	-121.806938 °	
DWR ID	DWR_NA0021_01_s_2012_14				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	0.30	Rating **	M	Issue No.	13
LM End	0.50	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.723017 °	38.725844 °	
			-121.806879 °	-121.806516 °	
DWR ID	DWR_NA0021_01_s_2014_13				
Comment Code					
V9 : Keep the crown roadway free of vegetation.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_13_20160223_00013.jpg



Vegetation on the crown needs to be controlled. Spring 2014

LM Start	0.30	Rating **	U	Issue No.	17
LM End	0.50	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.723041 °	38.725887 °	
			-121.806877 °	-121.806550 °	
DWR ID	DWR_NA0021_01_s_2012_17				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_17_20160223_00017.jpg



View of the vegetation on the waterward side of the levee looking downstream. Fall 2015.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.35	Rating **	M	Issue No.	20
LM End	0.35	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.723789 °	38.723789 °	
			-121.806666 °	-121.806666 °	
DWR ID	DWR_NA0021_01_s_2015_20				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	0.36	Rating **	M	Issue No.	6
LM End	0.36	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.723903 °	38.723903 °	
			-121.806613 °	-121.806613 °	
DWR ID	DWR_NA0021_01_s_2012_6				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2016_NA0021_351_6_20160223_00008.jpg



View of the tree on the landward side of the levee looking downstream. Fall 2015.

LM Start	0.44	Rating **	M	Issue No.	9
LM End	0.44	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.725022 °	38.725022 °	
			-121.806478 °	-121.806478 °	
DWR ID	DWR_NA0021_01_s_2012_9				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 2 : SP_2016_NA0021_351_9_20160223_00009.jpg



Trees need to be trimmed to 5'. Spring 2013

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.44	Rating **	M	Issue No.	9 (cont)
LM End	0.44	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.725022 °	38.725022 °
				-121.806478 °	-121.806478 °
DWR ID	DWR_NA0021_01_s_2012_9				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 2 of 2 : SP_2016_NA0021_351_9_20160223_00010.jpg



View of the tree that needs to be trimmed on the landward side of the levee looking downstream. Fall 2015.

LM Start	0.47	Rating **	M	Issue No.	10
LM End	0.47	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.725427 °	38.725427 °
				-121.806470 °	-121.806470 °
DWR ID	DWR_NA0021_01_s_2012_10				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 2 : SP_2016_NA0021_351_10_20160223_00011.jpg



The tree needs to be trimmed up. Photo taken fall of 2011.

LM Start	0.47	Rating **	M	Issue No.	10 (cont)
LM End	0.47	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : SP_2016_NA0021_351_10_20160223_00012.jpg



View of the tree on the landwardside of the levee looking downstream. Fall 2015.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2016

Yolo County Planning Resources and Public Works

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank Cache Creek	Right	0.59	03/22/2016 03/22/2016	Jai Lor

LM Start	0.49	Rating **	C	Issue No.	21
LM End	0.49	Issue Type +	En	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.725692 °	38.725692 °
				-121.806590 °	-121.806590 °
DWR ID	DWR_NA0021_01_s_2015_21				
Comment Code					
DE : Debris					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---