

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/23/2014 10/23/2014	Matthew Hoffman

LM Start		Rating **	A	Issue No.	7
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Operations & Maintenance Manuals			o	
DWR ID	DWR_RD0010_01_s_2013_7				
Action/Comments					
Inspector Comments: The O&M manual is located at Tom Schultz's house.					

No Photos

LM Start		Rating **	A	Issue No.	8
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Emergency Supplies & Equipment			o	
DWR ID	DWR_RD0010_01_s_2013_8				
Action/Comments					
Inspector Comments: Finlay Williams stated that they are part of the CO-OP with RD 784 which shares flood fight supplies at multiple locations. Also he has a small amount of supplies located at his house within the district.					

No Photos

LM Start		Rating **	A	Issue No.	9
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Flood Preparedness & Training			o	
DWR ID	DWR_RD0010_01_s_2013_9				
Action/Comments					
Inspector Comments: The district has attendended and plans to attend the Flood Fight class put on by RD 784 and DWR.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	0.00	Rating **	C	Issue No.	5
LM End	0.72	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.163692 °	39.161210 °	
			-121.609811 °	-121.597154 °	
DWR ID	DWR_RD0010_01_s_2013_5				
Action/Comments					
Keep the crown roadway free of vegetation.					

No Photos

LM Start	0.05	Rating **	C	Issue No.	49
LM End	0.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.163671 °	39.163671 °	
			-121.609068 °	-121.609068 °	
DWR ID	DWR_RD0010_01_f_2013_49				
Action/Comments					
No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					

No Photos

LM Start	2.34	Rating **	A	Issue No.	341
LM End	2.34	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.179694 °	39.179694 °	
			-121.584516 °	-121.584516 °	
DWR ID	DWR_RD0010_01_f_2014_341				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA_2014_RD0010_163_341_20141103_00298.jpg



This photo was taken from the crown facing south looking down the waterward levee slope at acceptable vegetation maintenance. Fall 2014.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	5.72	Rating **	C	Issue No.	46
LM End	5.72	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		39.228031 °	39.228031 °	
			-121.578505 °	-121.578505 °	
DWR ID	DWR_RD0010_01_f_2013_46				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	6.31	Rating **	C	Issue No.	45
LM End	6.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.236531 °	39.236531 °	
			-121.577323 °	-121.577323 °	
DWR ID	DWR_RD0010_01_f_2013_45				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild roses at landward levee toe should be removed.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	3.67	Rating **	M	Issue No.	68
LM End	3.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.216229 °	39.216229 °	
			-121.610819 °	-121.610819 °	
DWR ID	DWR_RD0010_02_f_2013_68				
Action/Comments					
No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					

No Photos

LM Start	4.33	Rating **	A	Issue No.	524
LM End	4.33	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.225274 °	39.225274 °	
			-121.613502 °	-121.613502 °	
DWR ID	DWR_RD0010_02_f_2014_524				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA_2014_RD0010_164_524_20141103_00503.jpg



This photo was taken from the crown facing north looking down the landward levee slope at acceptable vegetation maintenance. Fall 2014.

LM Start	8.38	Rating **	C	Issue No.	69
LM End	8.38	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		39.278194 °	39.278194 °	
			-121.608922 °	-121.608922 °	
DWR ID	DWR_RD0010_02_f_2013_69				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	9.50	Rating **	M	Issue No.	5
LM End	9.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.288766 °	39.288766 °	
			-121.600875 °	-121.600875 °	
DWR ID	DWR_RD0010_02_f_2012_5				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

LM Start	9.51	Rating **	M	Issue No.	6
LM End	9.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.288834 °	39.288834 °	
			-121.600898 °	-121.600898 °	
DWR ID	DWR_RD0010_02_f_2012_6				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

LM Start	9.92	Rating **	M	Issue No.	7
LM End	9.92	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.293159 °	39.293159 °	
			-121.606011 °	-121.606011 °	
DWR ID	DWR_RD0010_02_f_2012_7				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	10.35	Rating **	M	Issue No.	71
LM End	10.35	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.297062 °	39.297062 °	
			-121.612336 °	-121.612336 °	
DWR ID	DWR_RD0010_02_f_2013_71				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Blackberries on landward slope should be removed.					

No Photos

LM Start	10.42	Rating **	C	Issue No.	10
LM End	10.82	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.297746 °	39.302093 °	
			-121.613203 °	-121.617756 °	
DWR ID	DWR_RD0010_02_f_2012_10				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

No Photos

LM Start	11.11	Rating **	M	Issue No.	72
LM End	11.11	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.306077 °	39.306077 °	
			-121.617645 °	-121.617645 °	
DWR ID	DWR_RD0010_02_f_2013_72				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	0.06	Rating **	C	Issue No.	4
LM End	2.66	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.308600 °	39.301481 °	
			-121.616876 °	-121.574540 °	
DWR ID	DWR_RD0010_03_f_2012_4				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

No Photos

LM Start	0.06	Rating **	C	Issue No.	6
LM End	2.66	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.308600 °	39.301481 °	
			-121.616876 °	-121.574540 °	
DWR ID	DWR_RD0010_03_f_2012_6				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

No Photos

LM Start	1.85	Rating **	M	Issue No.	18
LM End	1.85	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		39.302904 °	39.302904 °	
			-121.588578 °	-121.588578 °	
DWR ID	DWR_RD0010_03_f_2013_18				
Action/Comments					
Repair the levee slope damaged by vehicle traffic and prevent access where possible. Inspector Comments: Toe cut at edge of waterward side of levee.					

Photo 1 of 1 : FA_2014_RD0010_165_18_20141020_00004.jpg



This photo was taken from the levee crown facing north looking down the waterward slope at agricultural tilling causing a cut at the levee toe. Fall 2013.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2014

Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	10/23/2014 10/23/2014	Matthew Hoffman

LM Start	1.92	Rating **	M	Issue No.	12
LM End	1.92	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.303317 °	39.303317 °	
			-121.587539 °	-121.587539 °	
DWR ID	DWR_RD0010_03_s_2013_12				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

LM Start	1.93	Rating **	A	Issue No.	135
LM End	1.93	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.303418 °	39.303418 °	
			-121.587260 °	-121.587260 °	
DWR ID	DWR_RD0010_03_f_2014_135				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA_2014_RD0010_165_135_20141103_00108.jpg



This photo was taken from the levee crown facing east looking down the landward slope at acceptable vegetation maintenance. Fall 2014.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---