

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	05/11/2015 05/11/2015	Michael Pitta

LM Start		Rating **	A	Issue No.	7
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			o	o
DWR ID	DWR_RD0010_01_s_2013_7				
Action/Comments					
Inspector Comments: The O&M manual is located at Tom Schultz's house.					

No Photos

LM Start		Rating **	A	Issue No.	8
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			o	o
DWR ID	DWR_RD0010_01_s_2013_8				
Action/Comments					
Inspector Comments: Finlay Williams stated that they are part of the CO-OP with RD 784 which shares flood fight supplies at multiple locations. Also he has a small amount of supplies located at his house within the district.					

No Photos

LM Start		Rating **	A	Issue No.	9
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			o	o
DWR ID	DWR_RD0010_01_s_2013_9				
Action/Comments					
Inspector Comments: The district has attendended and plans to attend the Flood Fight class put on by RD 784 and DWR.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Simmerly Slough	Right	7.65	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>1.75</b>	Rating **	A/W	Issue No.	<b>27</b>
LM End	<b>1.75</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.171218 °	39.171218 °	
			-121.585602 °	-121.585602 °	
DWR ID	DWR_RD0010_01_s_2015_27				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP\_2015\_RD0010\_163\_27\_20150513\_00020.jpg



View of the waterside vegetation facing upstream.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>0.02</b>	Rating **	M	Issue No.	<b>26</b>
LM End	<b>11.34</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.163957 °	39.163957 °
				-121.610055 °	-121.610055 °
DWR ID	DWR_RD0010_02_s_2015_26				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	<b>0.02</b>	Rating **	M	Issue No.	<b>25</b>
LM End	<b>11.34</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.309737 °	39.309737 °
				-121.616523 °	-121.616523 °
DWR ID	DWR_RD0010_02_s_2015_25				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP\_2015\_RD0010\_164\_25\_20150513\_00021.jpg



View of the landside vegetation facing downstream.

LM Start	<b>3.66</b>	Rating **	M	Issue No.	<b>68</b>
LM End	<b>3.66</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.216229 °	39.216229 °
				-121.610819 °	-121.610819 °
DWR ID	DWR_RD0010_02_f_2013_68				
Action/Comments					
No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015

### Reclamation District No. 0010 Honcut

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>9.34</b>	Rating **	M	Issue No.	<b>27</b>
LM End	<b>9.34</b>	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.286983 °	39.286983 °
				-121.600423 °	-121.600423 °
DWR ID	DWR_RD0010_02_s_2015_27				
Action/Comments					
Add appropriate material and re-grade the levee to bring the crown above the design elevation.					

No Photos

LM Start	<b>9.46</b>	Rating **	M	Issue No.	<b>5</b>
LM End	<b>9.46</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.288766 °	39.288766 °
				-121.600875 °	-121.600875 °
DWR ID	DWR_RD0010_02_f_2012_5				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

LM Start	<b>9.47</b>	Rating **	M	Issue No.	<b>6</b>
LM End	<b>9.47</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.288834 °	39.288834 °
				-121.600898 °	-121.600898 °
DWR ID	DWR_RD0010_02_f_2012_6				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Feather River	Left	11.36	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>9.88</b>	Rating **	M	Issue No.	<b>7</b>
LM End	<b>9.88</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.293159 °	39.293159 °	
			-121.606011 °	-121.606011 °	
DWR ID	DWR_RD0010_02_f_2012_7				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

LM Start	<b>10.32</b>	Rating **	M	Issue No.	<b>71</b>
LM End	<b>10.32</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.297062 °	39.297062 °	
			-121.612336 °	-121.612336 °	
DWR ID	DWR_RD0010_02_f_2013_71				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Blackberries on landward slope should be removed.					

No Photos

LM Start	<b>11.08</b>	Rating **	M	Issue No.	<b>72</b>
LM End	<b>11.08</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.306077 °	39.306077 °	
			-121.617645 °	-121.617645 °	
DWR ID	DWR_RD0010_02_f_2013_72				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>0.01</b>	Rating **	M	Issue No.	<b>4</b>
LM End	<b>2.79</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.310060 °	39.298583 °	
			-121.616223 °	-121.570043 °	
DWR ID	DWR_RD0010_03_s_2015_4				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

No Photos

LM Start	<b>0.01</b>	Rating **	M	Issue No.	<b>6</b>
LM End	<b>2.79</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.310060 °	39.298583 °	
			-121.616223 °	-121.570043 °	
DWR ID	DWR_RD0010_03_s_2015_6				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : SP\_2015\_RD0010\_165\_6\_20150513\_00008.jpg



View of the vegetation on the waterside of the levee facing upstream.

LM Start	<b>1.67</b>	Rating **	M	Issue No.	<b>18</b>
LM End	<b>1.67</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		39.302904 °	39.302904 °	
			-121.588578 °	-121.588578 °	
DWR ID	DWR_RD0010_03_f_2013_18				
Action/Comments					
Repair the levee slope damaged by vehicle traffic and prevent access where possible. Inspector Comments: Toe cut at edge of waterward side of levee.					

Photo 1 of 1 : SP\_2015\_RD0010\_165\_18\_20150401\_00002.jpg



This photo was taken from the levee crown facing north looking down the waterward slope at agricultural tilling causing a cut at the levee toe. Fall 2013.

<b>* Location</b> LS : Land Side WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>N</b> : Not Inspected/Rated <b>C</b> : Corrected <b>A/W</b> : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2015**

**Reclamation District No. 0010 Honcut**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03 Honcut Creek	Left	2.81	05/11/2015 05/11/2015	Michael Pitta

LM Start	<b>1.73</b>	Rating **	M	Issue No.	<b>12</b>
LM End	<b>1.73</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.303317 °	39.303317 °	
			-121.587539 °	-121.587539 °	
DWR ID	DWR_RD0010_03_s_2013_12				
Action/Comments					
Exterminate rodents and backfill and compact or grout burrows.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---