

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start		Rating **	M	Issue No.	<b>18</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2013_18				
Action/Comments					
Inspector Comments: The LMA does have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	<b>44</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2012_44				
Action/Comments					
Inspector Comments: LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	<b>46</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s _ 2012_46				
Action/Comments					
Inspector Comments: LMA does not have a written flood preparedness plan. Also LMA staff has not been involved in flood training for several years.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.00	Rating **	U	Issue No.	59
LM End	1.17	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.502916 °	38.487256 °
				-121.559947 °	-121.553949 °
DWR ID	DWR_RD0765_01_f_2015_59				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense vegetation blocking view of waterward slope.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_59\_20150925\_00065.jpg



Looking south at typical view of vegetation on waterward slope.

Photo 2 of 2 : FA\_2015\_RD0765\_211\_59\_20150925\_00066.jpg



Looking north at typical view of vegetation on waterward slope.

LM Start	0.05	Rating **	M	Issue No.	3
LM End	0.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.502253 °	38.502253 °
				-121.560192 °	-121.560192 °
DWR ID	DWR_RD0765_01_s_2012_3				
Action/Comments					
Trim trees to at least five feet above ground level.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_3\_20150914\_00001.jpg



Looking north (upstream) at trees on landside slope.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.08	Rating **	U	Issue No.	61
LM End	1.15	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.501832 °	38.487471 °
				-121.560301 °	-121.554125 °
DWR ID	DWR_RD0765_01_f_2015_61				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_61\_20150925\_00067.jpg



Looking south at typical view of vegetation on landward slope.

LM Start	<b>0.08</b>	Rating **	U	Issue No.	<b>61 (cont)</b>
LM End	<b>1.15</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA\_2015\_RD0765\_211\_61\_20150925\_00068.jpg



Looking north at typical view of vegetation on landward slope.

LM Start	0.09	Rating **	A/W	Issue No.	27
LM End	0.09	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501650 °	38.501650 °
				-121.560290 °	-121.560290 °
DWR ID	DWR_RD0765_01_s_2012_27				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.12	Rating **	M	Issue No.	28
LM End	0.19	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501215 °	38.500271 °
				-121.560432 °	-121.560434 °
DWR ID	DWR_RD0765_01_s _ 2012_28				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_28\_20150914\_00025.jpg



Looking downstream (south) at trees on landside slope &amp; toe.

LM Start	<b>0.12</b>	Rating **	M	Issue No.	<b>28 (cont)</b>
LM End	<b>0.19</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA\_2015\_RD0765\_211\_28\_20150914\_00026.jpg



Looking west at trees on landside toe.

LM Start	0.13	Rating **	A/W	Issue No.	45
LM End	0.13	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.501181 °	38.501181 °
				-121.560410 °	-121.560410 °
DWR ID	DWR_RD0765_01_f _ 2013_45				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.14	Rating **	M	Issue No.	22
LM End	0.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.500928 °	38.500928 °
				-121.560431 °	-121.560431 °
DWR ID	DWR_RD0765_01_s _ 2012_22				
Action/Comments					
Elderberries are blocking visibility and flood fight capability.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_22\_20150914\_00022.jpg



Looking northwest at dense vegetation on landside slope.

LM Start	0.18	Rating **	A/W	Issue No.	14
LM End	0.34	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.500343 °	38.498032 °
				-121.560507 °	-121.560337 °
DWR ID	DWR_RD0765_01_s _ 2012_14				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.21	Rating **	A/W	Issue No.	25
LM End	0.21	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.500018 °	38.500018 °
				-121.560457 °	-121.560457 °
DWR ID	DWR_RD0765_01_s _ 2012_25				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.24	Rating **	M	Issue No.	49
LM End	0.24	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.499530 °	38.499530
				-121.560490 °	-121.560490
DWR ID	DWR_RD0765_01_s _ 2013_49				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside slope.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_49\_20150914\_00047.jpg



Looking at wild berryvines or wild roses on landside slope and toe.

LM Start	0.25	Rating **	A/W	Issue No.	11
LM End	0.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.499405 °	38.499042 °
				-121.560445 °	-121.560430 °
DWR ID	DWR_RD0765_01_s _ 2012_11				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: Trees trimmed, but should be monitored.					

No Photos

LM Start	0.27	Rating **	M	Issue No.	62
LM End	0.27	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.499015 °	38.499015 °
				-121.560463 °	-121.560463 °
DWR ID	DWR_RD0765_01_f _ 2015_62				
Action/Comments					
Garbage					
Inspector Comments: Garbage on landward shoulder.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_62\_20150925\_00069.jpg



Looking westly at garbage on landward shoulder.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.31	Rating **	A/W	Issue No.	31
LM End	0.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.498516 °	38.498516 °
				-121.560463 °	-121.560463 °
DWR ID	DWR_RD0765_01_f_2012_31				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside toe.					

No Photos

LM Start	0.31	Rating **	A/W	Issue No.	23
LM End	0.31	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.498453 °	38.498453 °
				-121.560360 °	-121.560360 °
DWR ID	DWR_RD0765_01_s_2012_23				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comments: Tree has been trimmed, but should be monitored.					

No Photos

LM Start	0.40	Rating **	A/W	Issue No.	21
LM End	0.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.497196 °	38.497196 °
				-121.560147 °	-121.560147 °
DWR ID	DWR_RD0765_01_s_2012_21				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.41	Rating **	A/W	Issue No.	24
LM End	0.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.497125 °	38.495648 °
				-121.560087 °	-121.559391 °
DWR ID	DWR_RD0765_01_s _ 2012_24				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

No Photos

LM Start	0.41	Rating **	U	Issue No.	47
LM End	0.41	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.497069 °	38.497069 °
				-121.560106 °	-121.560106 °
DWR ID	DWR_RD0765_01_f _ 2012_47				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Wild berryvines on landside toe.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_47\_20150914\_00045.jpg



Looking west at dense berryvines on landside toe.

LM Start	0.43	Rating **	M	Issue No.	32
LM End	0.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.496792 °	38.496321 °
				-121.560026 °	-121.559842 °
DWR ID	DWR_RD0765_01_s _ 2012_32				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_32\_20150914\_00033.jpg



Looking southwest at dense vegetation on landside slope and toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.47	Rating **	A/W	Issue No.	55
LM End	0.47	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.496235 °	38.496235 °
				-121.559796 °	-121.559796 °
DWR ID	DWR_RD0765_01_f_2013_55				
Action/Comments					
Garbage					
Inspector Comments: Trash dumped on landside slope.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_55\_20150914\_00056.jpg



Looking northwest at garbage on landside slope.

LM Start	<b>0.47</b>	Rating **	A/W	Issue No.	<b>55 (cont)</b>
LM End	<b>0.47</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA\_2015\_RD0765\_211\_55\_20150914\_00057.jpg



Looking west at garbage on landside slope.

LM Start	0.54	Rating **	A/W	Issue No.	34
LM End	0.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.495347 °	38.494204 °
				-121.559291 °	-121.558313 °
DWR ID	DWR_RD0765_01_s_2012_34				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.56	Rating **	A/W	Issue No.	10
LM End	0.59	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.495035 °	38.494642 °
				-121.559027 °	-121.558697 °
DWR ID	DWR_RD0765_01_s _ 2012_10				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.63	Rating **	A/W	Issue No.	15
LM End	0.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.494171 °	38.493392 °
				-121.558253 °	-121.557640 °
DWR ID	DWR_RD0765_01_s _ 2012_15				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.68	Rating **	A/W	Issue No.	35
LM End	0.72	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.493596 °	38.493077 °
				-121.557832 °	-121.557451 °
DWR ID	DWR_RD0765_01_s _ 2012_35				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	0.77	Rating **	A/W	Issue No.	36
LM End	0.80	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.492392 °	38.492034 °
				-121.557026 °	-121.556820 °
DWR ID	DWR_RD0765_01_s _ 2012_36				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

No Photos

LM Start	0.86	Rating **	A/W	Issue No.	17
LM End	0.98	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.491283 °	38.489771 °
				-121.556360 °	-121.555451 °
DWR ID	DWR_RD0765_01_s _ 2012_17				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	0.98	Rating **	A/W	Issue No.	6
LM End	1.14	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.489664 °	38.487617 °
				-121.555370 °	-121.554200 °
DWR ID	DWR_RD0765_01_f _ 2012_6				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.01	Rating **	A/W	Issue No.	40
LM End	1.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489283 °	38.489283 °
				-121.555223 °	-121.555223 °
DWR ID	DWR_RD0765_01_s _ 2012_40				
Action/Comments					
Trees / Woody Vegetation					
Inspector Comments: Fig trees on landside slope					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_40\_20150914\_00043.jpg



Looking southwest at fig trees and other trees on landside slope and toe.

LM Start	1.04	Rating **	M	Issue No.	58
LM End	1.04	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.488903 °	38.488903 °
				-121.554921 °	-121.554921 °
DWR ID	DWR_RD0765_01_f _ 2014_58				
Action/Comments					
Prunings					
Inspector Comments: Prunings on waterward shoulder.					

No Photos

LM Start	1.07	Rating **	A/W	Issue No.	37
LM End	1.07	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488503 °	38.488503 °
				-121.554757 °	-121.554757 °
DWR ID	DWR_RD0765_01_s _ 2012_37				
Action/Comments					
Trim and thin trees to allow visibility of the ground and room to flood fight.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.09	Rating **	A/W	Issue No.	38
LM End	1.15	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488279 °	38.487465 °
				-121.554615 °	-121.554117 °
DWR ID	DWR_RD0765_01_s _ 2012_38				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.15	Rating **	A/W	Issue No.	9
LM End	1.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.487473 °	38.487473 °
				-121.554080 °	-121.554080 °
DWR ID	DWR_RD0765_01_s _ 2012_9				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.28	Rating **	U	Issue No.	33
LM End	1.71	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485699 °	38.480235 °
				-121.553107 °	-121.549569 °
DWR ID	DWR_RD0765_01_f _ 2015_33				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

Photo 1 of 3 : FA\_2015\_RD0765\_211\_33\_20150925\_00070.jpg



Looking south from LM 1.28 at typical view of vegetation on landward slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.28	Rating **	U	Issue No.	33 (cont)
LM End	1.71	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485699 °	38.480235 °
				-121.553107 °	-121.549569 °
DWR ID	DWR_RD0765_01_f_2015_33				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					

LM Start	<b>1.28</b>	Rating **	U	Issue No.	<b>33 (cont)</b>
LM End	<b>1.71</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 3 : FA\_2015\_RD0765\_211\_33\_20150925\_00071.jpg



Looking north from LM. 1.65 at dense vegetation on landward slope.

Photo 3 of 3 : FA\_2015\_RD0765\_211\_33\_20150925\_00072.jpg



Looking northeast from LM 1.71 at typical view of vegetation on landward slope.

LM Start	1.29	Rating **	U	Issue No.	39
LM End	1.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485630 °	38.480394 °
				-121.553006 °	-121.549474 °
DWR ID	DWR_RD0765_01_f_2015_39				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Vegetation blocking view of waterward slope.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_39\_20150925\_00073.jpg



Looking north from LM 1.70 at typical view of vegetation on waterward slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.29	Rating **	U	Issue No.	39 (cont)
LM End	1.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485630 °	38.480394 °
				-121.553006 °	-121.549474 °
DWR ID	DWR_RD0765_01_f_2015_39				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Vegetation blocking view of waterward slope.					

Photo 2 of 2 : FA\_2015\_RD0765\_211\_39\_20150925\_00074.jpg



Looking northeast from LM 1.29 at typical view of vegetation on waterward slope.

LM Start	1.29	Rating **	M	Issue No.	26
LM End	1.29	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.485561 °	38.485561 °
				-121.553031 °	-121.553031 °
DWR ID	DWR_RD0765_01_s_2012_26				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.32	Rating **	M	Issue No.	7
LM End	1.34	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485287 °	38.485014 °
				-121.552818 °	-121.552618 °
DWR ID	DWR_RD0765_01_s_2015_7				
Action/Comments					
Tree or limb					
Inspector Comments: Downed tree branches across waterward slope.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_7\_20150925\_00075.jpg



Looking at several tree branches on waterward slope and berm.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.32	Rating **	M	Issue No.	7 (cont)	
LM End	1.34	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Encroachments			38.485287 °		38.485014 °
				-121.552818 °		-121.552618 °
DWR ID	DWR_RD0765_01_s _ 2015_7					
Action/Comments						
Tree or limb						
Inspector Comments: Downed tree branches across waterward slope.						

Photo 2 of 2 : FA\_2015\_RD0765\_211\_7\_20150914\_00007.jpg



Looking north at down tree across waterward slope.

LM Start	1.39	Rating **	M	Issue No.	4
LM End	1.39	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.484316 °	38.484316 °
				-121.552115 °	-121.552115 °
DWR ID	DWR_RD0765_01_s _ 2012_4				
Action/Comments					
Trim trees to at least five feet above ground level.					


Photo 1 of 1 : FA\_2015\_RD0765\_211\_4\_20150914\_00002.jpg



Looking north at untrimmed trees on waterward slope.

LM Start	1.42	Rating **	M	Issue No.	5
LM End	1.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483925 °	38.483530 °
				-121.551845 °	-121.551587 °
DWR ID	DWR_RD0765_01_s _ 2012_5				
Action/Comments					
Thin trees to allow visibility of the ground and room to flood fight.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_5\_20150914\_00003.jpg

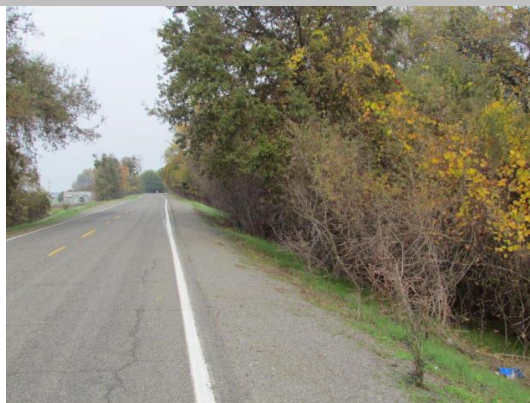

Looking north at dense vegetation on waterside slope. (Fall Inspection 2012)

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.42	Rating **	M	Issue No.	5 (cont)	
LM End	1.45	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Trim / Thin Trees			38.483925 °		38.483530 °
				-121.551845 °		-121.551587 °
DWR ID	DWR_RD0765_01_s _ 2012_5					
Action/Comments						
Thin trees to allow visibility of the ground and room to flood fight.						

Photo 2 of 2 : FA\_2015\_RD0765\_211\_5\_20150914\_00004.jpg



Looking upstream (north) at dense trees on waterside slope.

LM Start	1.44	Rating **	M	Issue No.	41
LM End	1.44	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483640 °	38.483640 °
				-121.551727 °	-121.551727 °
DWR ID	DWR_RD0765_01_s _ 2012_41				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

LM Start	1.48	Rating **	M	Issue No.	42
LM End	1.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483170 °	38.482965 °
				-121.551367 °	-121.551265 °
DWR ID	DWR_RD0765_01_s _ 2012_42				
Action/Comments					
Trim trees to at least five feet above ground level.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.52	Rating **	M	Issue No.	29
LM End	1.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482665 °	38.481421 °
				-121.551036 °	-121.550207 °
DWR ID	DWR_RD0765_01_s _ 2012_29				
Action/Comments					
Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comments: Dense berryvines and dense trees on landward slope. The LMA removed a sizeable amount of vines, but some still remain.					

Photo 1 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00027.jpg



Looking south at dense vegetation on landside shoulder and slope. (November 2011)

LM Start	<b>1.52</b>	Rating **	M	Issue No.	<b>29 (cont)</b>
LM End	<b>1.62</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00028.jpg



Looking south at dense vegetation on landside slope and toe spring 2012.

LM Start	<b>1.52</b>	Rating **	M	Issue No.	<b>29 (cont)</b>
LM End	<b>1.62</b>	Issue Type +	Ma	Location *	LS

Photo 3 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00029.jpg



Looking south at moderate vegetation on landward slope and toe. (Fall 2014)

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.52	Rating **	M	Issue No.	29 (cont)	
LM End	1.62	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Vegetation			38.482665 °	38.481421 °	
				-121.551036 °	-121.550207 °	
DWR ID	DWR_RD0765_01_s _ 2012_29					
Action/Comments						
Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berryvines and dense trees on landward slope. The LMA removed a sizeable amount of vines, but some still remain.						

Photo 4 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00030.jpg



Looking southwest at vegetation on landside slope and toe. (Fall Inspection 2012)

LM Start	<b>1.52</b>	Rating **	M	Issue No.	<b>29 (cont)</b>
LM End	<b>1.62</b>	Issue Type +	Ma	Location *	LS

Photo 5 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00031.jpg



Looking southwest at berryvines on landside slope.

LM Start	<b>1.52</b>	Rating **	M	Issue No.	<b>29 (cont)</b>
LM End	<b>1.62</b>	Issue Type +	Ma	Location *	LS

Photo 6 of 6 : FA\_2015\_RD0765\_211\_29\_20150914\_00032.jpg



Looking southwest at vegetation on landside slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.52	Rating **	A/W	Issue No.	30
LM End	1.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.482647 °	38.482647 °
				-121.550957 °	-121.550957 °
DWR ID	DWR_RD0765_01_s _ 2015_30				
Action/Comments					
Prunings					
Inspector Comments: Pruning piles on waterward berm.					

No Photos

LM Start	1.55	Rating **	U	Issue No.	57
LM End	1.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			38.482327 °	38.482327 °
				-121.550848 °	-121.550848 °
DWR ID	DWR_RD0765_01_s _ 2015_57				
Action/Comments					
Note and monitor erosion site.					
Inspector Comments: Caving greater than one inch deep and greater that three inches in length on landward shoulder.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_57\_20150914\_00061.jpg



Looking east at caving on landward shoulder.

LM Start	<b>1.55</b>	Rating **	U	Issue No.	<b>57 (cont)</b>
LM End	<b>1.55</b>	Issue Type +	Ma	Location *	LS

Photo 2 of 2 : FA\_2015\_RD0765\_211\_57\_20150914\_00062.jpg



Looking south at caving on landward shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.66	Rating **	A/W	Issue No.	53
LM End	1.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.480892 °	°
				-121.549654 °	°
DWR ID	DWR_RD0765_01_s _ 2013_53				
Action/Comments					
Trim trees to at least five feet above ground level.					
Inspector Comments: Trees has been trimmed, but should be monitored.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_53\_20150914\_00052.jpg



Looking north at trimmed trees on waterward slope. (Fall 2014)

LM Start	1.67	Rating **	M	Issue No.	13
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480763 °	38.480632 °
				-121.549581 °	-121.549543 °
DWR ID	DWR_RD0765_01_s _ 2012_13				
Action/Comments					
Prunings					
Inspector Comments: LMA has removed some of the prunings.					

Photo 1 of 3 : FA\_2015\_RD0765\_211\_13\_20150914\_00013.jpg



Looking northeast at tree limbs on waterward slope.

LM Start	<b>1.67</b>	Rating **	M	Issue No.	<b>13 (cont)</b>
LM End	<b>1.68</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : FA\_2015\_RD0765\_211\_13\_20150914\_00014.jpg



Looking east at large tree limb on waterward slope.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.67	Rating **	M	Issue No.	13 (cont)
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480763 °	38.480632 °
				-121.549581 °	-121.549543 °
DWR ID	DWR_RD0765_01_s _ 2012_13				
Action/Comments					
Prunings					
Inspector Comments: LMA has removed some of the prunings.					

Photo 3 of 3 : FA\_2015\_RD0765\_211\_13\_20150914\_00015.jpg



Looking north at large tree limb on waterward slope.

LM Start	1.69	Rating **	A/W	Issue No.	52
LM End	1.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.480519 °	38.480164 °
				-121.549513 °	-121.549445 °
DWR ID	DWR_RD0765_01_s _ 2013_52				
Action/Comments					
Trim trees to at least five feet above ground level.					
Inspector Comments: Trees has been trimmed, but should be monitored.					

Photo 1 of 1 : FA\_2015\_RD0765\_211\_52\_20150914\_00050.jpg



Looking north (upstream) at trimmed trees on landward slope. (Fall 2014)

LM Start	1.71	Rating **	M	Issue No.	20
LM End	1.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480236 °	38.480236 °
				-121.549442 °	-121.549442 °
DWR ID	DWR_RD0765_01_f _ 2015_20				
Action/Comments					
Tree or limb					
Inspector Comments: Broken tree limbs on waterward slope.					

Photo 1 of 2 : FA\_2015\_RD0765\_211\_20\_20150925\_00076.jpg



Looking northeast at broken and cracked tree branches on waterward slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2015**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/25/2015 09/25/2015	Richard Willoughby

LM Start	1.71	Rating **	M	Issue No.	20 (cont)
LM End	1.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480236 °	38.480236 °
				-121.549442 °	-121.549442 °
DWR ID	DWR_RD0765_01_f_2015_20				
Action/Comments					
Tree or limb					
Inspector Comments: Broken tree limbs on waterward slope.					

Photo 2 of 2 : FA\_2015\_RD0765\_211\_20\_20150925\_00077.jpg



Looking south at broken and cracked tree branches on waterward slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---