

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start		Rating **	M	Issue No.	18
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2013_18				
Comment Code					
Inspector Comment					
The LMA does not have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	44
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_44				
Comment Code					
Inspector Comment					
LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	46
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_46				
Comment Code					
Inspector Comment					
LMA has not recently attended Flood Fight Training.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	0.07	Rating **	M	Issue No.	42
LM End	0.07	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.501920 °	38.501920 °
				-121.560368 °	-121.560368 °
DWR ID	DWR_RD0765_01_s_2021_42				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair rutting on the WS shoulder.					

Photo 1 of 1 : FA_2021_RD0765_211_42_20210823_00020.jpg



View of the WS levee slope damaged by vehicle traffic. Spring 2021.

LM Start	0.18	Rating **	M	Issue No.	17
LM End	0.18	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.500317 °	38.500317 °
				-121.560546 °	-121.560546 °
DWR ID	DWR_RD0765_01_s_2021_17				
Comment Code					
PR : Prunings					
Inspector Comment					
Remove prunings from LS crown/Slope					

Photo 1 of 1 : FA_2021_RD0765_211_17_20211027_00042.jpg



Prunings on the LS shoulder. Fall 2021

LM Start	0.51	Rating **	A/W	Issue No.	36
LM End	0.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.495748 °	38.495748 °
				-121.559525 °	-121.559525 °
DWR ID	DWR_RD0765_01_f_2020_36				
Comment Code					
V7 : Trees / Woody Vegetation					
Inspector Comment					
Fallen tree with exposed rootball.					

Photo 1 of 1 : FA_2021_RD0765_211_36_20210823_00018.jpg



View of fallen tree with exposed rootball on the waterside slope. Fall 2020

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	0.75	Rating **	M	Issue No.	68
LM End	0.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.492705 °	38.492705 °
				-121.557193 °	-121.557193 °
DWR ID	DWR_RD0765_01_s_2017_68				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair tire rut damage on the LS shoulder.					

Photo 1 of 1 : FA_2021_RD0765_211_68_20210823_00029.jpg



View of the LS levee shoulder damaged by vehicle traffic. Spring 2021.

LM Start	0.75	Rating **	M	Issue No.	63
LM End	0.79	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.492647 °	38.492145 °
				-121.557192 °	-121.556891 °
DWR ID	DWR_RD0765_01_s_2018_63				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Trim brush along the landside toe easement.					

Photo 1 of 1 : FA_2021_RD0765_211_63_20210823_00027.jpg



View of brush on levee slope. Fall 2018

LM Start	0.83	Rating **	M	Issue No.	28
LM End	0.83	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.491610 °	38.491610 °
				-121.556603 °	-121.556603 °
DWR ID	DWR_RD0765_01_s_2020_28				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Trim brush and remove berries near the landside toe.					

Photo 1 of 1 : FA_2021_RD0765_211_28_20211027_00043.jpg



Berry/brush growth on the LS slope and in the easement. Fall 2021

* Location
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

** Rating
A : Acceptable N : Not Inspected/Rated
M : Minimally Acceptable C : Corrected
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	0.87	Rating **	M	Issue No.	29
LM End	0.87	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.491172 °	38.491172 °
				-121.556227 °	-121.556227 °
DWR ID	DWR_RD0765_01_s_2020_29				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove brush/berry growth from the LS slope and easement.					

Photo 1 of 1 : FA_2021_RD0765_211_29_20211027_00044.jpg



Berry and brush growth on the LS slope and in the easement. Fall 2021

LM Start	0.88	Rating **	M	Issue No.	25
LM End	0.88	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.491023 °	38.491023 °
				-121.556046 °	-121.556046 °
DWR ID	DWR_RD0765_01_f_2021_25				
Comment Code					
DE : Debris					
Inspector Comment					
Remove debris from WS slope.					

Photo 1 of 1 : FA_2021_RD0765_211_25_20211027_00045.jpg



Debris pile on the WS slope. Fall 2021

LM Start	0.94	Rating **	U	Issue No.	24
LM End	0.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.490265 °	38.490265 °
				-121.555617 °	-121.555617 °
DWR ID	DWR_RD0765_01_s_2019_24				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Erosion and footpath on the WS slope need to be repaired.					

Photo 1 of 1 : FA_2021_RD0765_211_24_20211027_00046.jpg



Erosion on the WS footpath. Fall 2021

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	0.95	Rating **	U	Issue No.	23
LM End	0.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.490067 °	38.490067 °
				-121.555530 °	-121.555530 °
DWR ID	DWR_RD0765_01_s_2019_23				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion at the footpath on the WS slope.					

Photo 1 of 1 : FA_2021_RD0765_211_23_20211027_00047.jpg



Erosion at the footpath on the WS slope. Fall 2021

LM Start	1.02	Rating **	C	Issue No.	30
LM End	1.03	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489235 °	38.489048 °
				-121.555145 °	-121.554988 °
DWR ID	DWR_RD0765_01_s_2020_30				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Vegetation has been maintained.					

No Photos

LM Start	1.08	Rating **	M	Issue No.	14
LM End	1.08	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.488401 °	38.488401 °
				-121.554658 °	-121.554658 °
DWR ID	DWR_RD0765_01_f_2021_14				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove fallen tree from with 20' of the crown.					

Photo 1 of 1 : FA_2021_RD0765_211_14_20211027_00050.jpg



Fallen tree log within 20 of the WS crown. Fall 2021

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	1.29	Rating **	M	Issue No.	15
LM End	1.30	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485644 °	38.485445 °
				-121.553128 °	-121.553014 °
DWR ID	DWR_RD0765_01_s_2019_15				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild vines and growth on the LS slope.					

Photo 1 of 1 : FA_2021_RD0765_211_15_20211027_00051.jpg



Ivy growth on the LS slope. Fall 2021

LM Start	1.31	Rating **	M	Issue No.	20
LM End	1.31	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485382 °	38.485382 °
				-121.552842 °	-121.552842 °
DWR ID	DWR_RD0765_01_s_2019_20				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove a fallen tree from the levee slope.					

Photo 1 of 1 : FA_2021_RD0765_211_20_20210823_00010.jpg



View looking upstream at fallen tree on levee slope. Spring 2019

LM Start	1.33	Rating **	M	Issue No.	7
LM End	1.33	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485045 °	38.485045 °
				-121.552767 °	-121.552767 °
DWR ID	DWR_RD0765_01_s_2015_7				
Comment Code					
TR : Tree or limb					
Inspector Comment					

Photo 1 of 1 : FA_2021_RD0765_211_7_20210823_00003.jpg



View looking downstream at tree log on levee slope. Spring 2019

*** Location**
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

**** Rating**
A : Acceptable N : Not Inspected/Rated
M : Minimally Acceptable C : Corrected
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	1.36	Rating **	M	Issue No.	33
LM End	1.43	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.484698 °	38.483852 °
				-121.552490 °	-121.551890 °
DWR ID	DWR_RD0765_01_s_2020_33				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild berry bushes at the landside toe.					

Photo 1 of 1 : FA_2021_RD0765_211_33_20211027_00053.jpg



Berry growth on the LS toe. Fall 2021

LM Start	1.42	Rating **	A/W	Issue No.	10
LM End	1.42	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.483973 °	38.483973 °
				-121.551855 °	-121.551855 °
DWR ID	DWR_RD0765_01_f_2021_10				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Monitor two footpaths for erosion.					

Photo 1 of 1 : FA_2021_RD0765_211_10_20211027_00054.jpg



Footpaths on the WS slope. Fall 2021

LM Start	1.43	Rating **	M	Issue No.	67
LM End	1.43	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.483810 °	38.483810 °
				-121.551747 °	-121.551747 °
DWR ID	DWR_RD0765_01_s_2017_67				
Comment Code					
GA : Garbage					
Inspector Comment					
Remove sofas dumped on waterside slope.					

Photo 1 of 1 : FA_2021_RD0765_211_67_20211027_00055.jpg



Sofas on the WS slope. Fall 2021

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	1.45	Rating **	M	Issue No.	41
LM End	1.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.483609 °	38.483609 °
				-121.551628 °	-121.551628 °
DWR ID	DWR_RD0765_01_s_2021_41				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair rutting on the WS slope.					

Photo 1 of 1 : FA_2021_RD0765_211_41_20210823_00019.jpg



View of the WS levee slope damaged by vehicle traffic. Spring 2021.

LM Start	1.47	Rating **	C	Issue No.	52
LM End	1.70	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.483340 °	38.480345 °
				-121.551565 °	-121.549658 °
DWR ID	DWR_RD0765_01_f_2018_52				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Brush has been trimmed.					

No Photos

LM Start	1.51	Rating **	C	Issue No.	45
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.482835 °	38.482835 °
				-121.551083 °	-121.551083 °
DWR ID	DWR_RD0765_01_s_2018_45				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Log has been removed.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	1.51	Rating **	M	Issue No.	31
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.482788 °	38.482788 °
				-121.551048 °	-121.551048 °
DWR ID	DWR_RD0765_01_f_2019_31				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair slope damage caused by vehicle traffic.					

Photo 1 of 1 : FA_2021_RD0765_211_31_20211027_00056.jpg



Erosion and rutting from vehicle traffic on the WS slope. Fall 2021

LM Start	1.58	Rating **	M	Issue No.	1
LM End	1.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.481959 °	38.481959 °
				-121.550527 °	-121.550527 °
DWR ID	DWR_RD0765_01_f_2017_1				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove logs/limbs within 20' of the crown.					

Photo 1 of 1 : FA_2021_RD0765_211_1_20211027_00058.jpg



Decaying logs within 20' of the WS crown. Fall 2021

LM Start	1.61	Rating **	N	Issue No.	9
LM End	1.61	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481560 °	38.481560 °
				-121.550295 °	-121.550295 °
DWR ID	DWR_RD0765_01_s_2020_9				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2021

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	10/26/2021 10/26/2021	Marvin Marshall

LM Start	1.68	Rating **	C	Issue No.	13
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480632 °	38.480632 °
				-121.549543 °	-121.549543 °
DWR ID	DWR_RD0765_01_s_2012_13				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Limbs and logs have been cut back 20' from the crown.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---