

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2024

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/17/2024 09/17/2024	Marvin Marshall

LM Start		Rating **	A	Issue No.	18
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment				
DWR ID	DWR_RD0765_01_s _ 2013_18				
Comment Code					
ES : Emergency Supplies & Equipment					
Inspector Comment					
The District is part of the Delta Emergency plan where supplies are kept in a central location that they can gain access to if and when needed.					

No Photos

LM Start		Rating **	A	Issue No.	44
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals				
DWR ID	DWR_RD0765_01_s _ 2012_44				
Comment Code					
OM : O&M Manuals					
Inspector Comment					
LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	46
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training				
DWR ID	DWR_RD0765_01_s _ 2012_46				
Comment Code					
FP : Flood Preparedness & Training					
Inspector Comment					
LMA has not recently attended Flood Fight Training.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections****Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2024****Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/17/2024 09/17/2024	Marvin Marshall

LM Start	0.02	Rating **	U	Issue No.	20
LM End	0.02	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.502711°	38.502711°
				-121.560019°	-121.560019°
DWR ID	DWR_RD0765_01_f_2023_20				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Repair erosion caused by foot traffic.					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_20\_20240911\_00010.jpg



Footpath on the WS slope. Spring 2024

LM Start	0.43	Rating **	U	Issue No.	5
LM End	0.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.496750°	38.495772°
				-121.560018°	-121.559551°
DWR ID	DWR_RD0765_01_f_2024_5				
Comment Code					
T1 : Trim and thin trees to at least five feet above ground level to allow visibility of the ground and room to flood fight.					
Inspector Comment					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_5\_20240918\_00017.jpg



Trees on the LS slope. Fall 2024

LM Start	0.75	Rating **	M	Issue No.	68
LM End	0.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Rills			38.492705°	38.492705°
				-121.557193°	-121.557193°
DWR ID	DWR_RD0765_01_s_2017_68				
Comment Code					
E5 : Schedule repair of rills prior to the next inspection.					
Inspector Comment					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_68\_20240918\_00018.jpg



Erosion on the LS slope. Fall 2024

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		

**Flood Control Project Maintenance  
Levee Inspections****Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2024****Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/17/2024 09/17/2024	Marvin Marshall

LM Start	0.92	Rating **	M	Issue No.	6
LM End	0.92	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.490514°	38.490514°
				-121.555831°	-121.555831°
DWR ID	DWR_RD0765_01_f_2024_6				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_6\_20240918\_00019.jpg



Rutting on the LS shoulder. Fall 2024

LM Start	0.94	Rating **	U	Issue No.	24
LM End	0.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.490265°	38.490265°
				-121.555617°	-121.555617°
DWR ID	DWR_RD0765_01_s_2019_24				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Erosion and footpath on the WS slope need to be repaired.					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_24\_20240911\_00012.jpg



Erosion on the WS footpath. Spring 2024

LM Start	0.95	Rating **	U	Issue No.	23
LM End	0.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.490067°	38.490067°
				-121.555530°	-121.555530°
DWR ID	DWR_RD0765_01_s_2019_23				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion at the footpath on the WS slope.					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_23\_20240911\_00011.jpg



Erosion at the footpath on the WS slope. Spring 2023

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2024**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/17/2024 09/17/2024	Marvin Marshall

LM Start	1.04	Rating **	C	Issue No.	3
LM End	1.04	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.489000°	38.489000°
				-121.554900°	-121.554900°
DWR ID	DWR_RD0765_01_s_2024_3				
Comment Code					
T2 : Tree or limb.					
Inspector Comment					

No Photos

LM Start	1.31	Rating **	C	Issue No.	15
LM End	1.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.485300°	38.485300°
				-121.553000°	-121.553000°
DWR ID	DWR_RD0765_01_s_2019_15				
Comment Code					
T2 : Tree or limb.					
Inspector Comment					

No Photos

LM Start	1.42	Rating **	M	Issue No.	10
LM End	1.42	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.483973°	38.483973°
				-121.551855°	-121.551855°
DWR ID	DWR_RD0765_01_f_2021_10				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_10\_20240911\_00005.jpg



Footpaths on the WS slope. Fall 2021

* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2024

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	09/17/2024 09/17/2024	Marvin Marshall

LM Start	1.46	Rating **	M	Issue No.	2
LM End	1.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.483414°	38.483414°
				-121.551472°	-121.551472°
DWR ID	DWR_RD0765_01_s _ 2023_2				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair rutting on the WS shoulder.					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_2\_20240911\_00002.jpg



Rutting on the WS shoulder. Spring 2023

LM Start	1.61	Rating **	N	Issue No.	9
LM End	1.61	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481560°	38.481560°
				-121.550295°	-121.550295°
DWR ID	DWR_RD0765_01_s _ 2020_9				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					
Remove stump on the WS slope.					


Photo 1 of 1 : FA\_2024\_RD0765\_211\_9\_20240911\_00004.jpg



Tree stump on the WS slope. Fall 2022

LM Start	1.64	Rating **	M	Issue No.	1
LM End	1.64	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.481151°	38.481151°
				-121.549866°	-121.549866°
DWR ID	DWR_RD0765_01_s _ 2023_1				
Comment Code					
V2 : Remove the wild growth and woody vegetation other than native grasses from the levee slopes.					
Inspector Comment					
Remove woody vegetation from within 20' of the crown. Trim trees to 5' above grade.					

Photo 1 of 1 : FA\_2024\_RD0765\_211\_1\_20240911\_00001.jpg

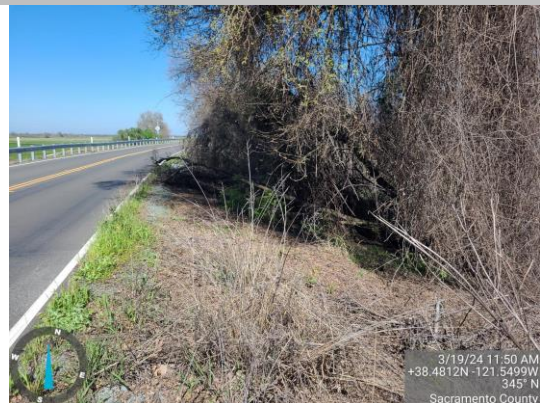

Limbs and woody growth on the WS slope. Spring 2023

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--