

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start		Rating **	M	Issue No.	18
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2013_18				
Comment Code					
Inspector Comment					
The LMA does not have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	44
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_44				
Comment Code					
Inspector Comment					
LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	46
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_46				
Comment Code					
Inspector Comment					
LMA does not have a written flood preparedness plan. Also LMA staff has not been involved in flood training recently.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	0.04	Rating **	A	Issue No.	25
LM End	0.24	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.502332 °	38.499468 °
				-121.560078 °	-121.560375 °
DWR ID	DWR_RD0765_01_s_2019_25				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
LMA has maintained annual vegetation in this section.					

No Photos

LM Start	0.05	Rating **	M	Issue No.	3
LM End	0.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.502253 °	38.502253 °
				-121.560192 °	-121.560192 °
DWR ID	DWR_RD0765_01_s_2012_3				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Trim trees that are blocking view of the landside slope.					

LM Start	0.05	Rating **	M	Issue No.	3 (cont)
LM End	0.05	Issue Type +	Ma	Location *	LS

Photo 1 of 3 : SP_2019_RD0765_211_3_20190307_00003.jpg



Looking north at untrimmed trees along landward slope. (Spring 2017)

Photo 2 of 3 : SP_2019_RD0765_211_3_20190307_00004.jpg



Looking southwest at untrimmed trees on landward slope.(Fall 2016)

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	---	--	---	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	0.05	Rating **	M	Issue No.	3 (cont)	
LM End	0.05	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Trim / Thin Trees			38.502253 °		38.502253 °
				-121.560192 °		-121.560192 °
DWR ID	DWR_RD0765_01_s_2012_3					
Comment Code						
T1 : Trim trees to at least five feet above ground level.						
Inspector Comment						
Trim trees that are blocking view of the landside slope.						

Photo 3 of 3 : SP_2019_RD0765_211_3_20190307_00005.jpg



Looking north (upstream) at trees on landside slope. (Spring 2016)

LM Start	0.28	Rating **	C	Issue No.	57
LM End	0.28	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.498988 °	38.498988 °
				-121.560473 °	-121.560473 °
DWR ID	DWR_RD0765_01_s_2018_57				
Comment Code					
DE : Debris					
Inspector Comment					

No Photos

LM Start	0.75	Rating **	M	Issue No.	68
LM End	0.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.492705 °	38.492705 °
				-121.557193 °	-121.557193 °
DWR ID	DWR_RD0765_01_s_2017_68				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair slope damage likely caused by a truck.					

Photo 1 of 2 : SP_2019_RD0765_211_68_20190307_00041.jpg



Looking south on landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain			

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	0.75	Rating **	M	Issue No.	68 (cont)	
LM End	0.75	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Slope Stability			38.492705 °		38.492705 °
				-121.557193 °		-121.557193 °
DWR ID	DWR_RD0765_01_s_2017_68					
Comment Code						
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.						
Inspector Comment						
Repair slope damage likely caused by a truck.						

Photo 2 of 2 : SP_2019_RD0765_211_68_20190307_00042.jpg



Looking south at levee damage caused by vehicle traffic. (Spring 2017)

LM Start	0.75	Rating **	M	Issue No.	63
LM End	0.79	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.492647 °	38.492145 °
				-121.557192 °	-121.556891 °
DWR ID	DWR_RD0765_01_s_2018_63				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP_2019_RD0765_211_63_20190307_00039.jpg



View of wild brush on levee slope. Fall 2018

LM Start	0.79	Rating **	C	Issue No.	30
LM End	0.79	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.492247 °	38.492247 °
				-121.556872 °	-121.556872 °
DWR ID	DWR_RD0765_01_f_2018_30				
Comment Code					
DE : Debris					
Inspector Comment					
Remove sofa and debris dumped on slope.					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	0.94	Rating **	M	Issue No.	24
LM End	0.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.490265 °	38.490265 °
				-121.555617 °	-121.555617 °
DWR ID	DWR_RD0765_01_s_2019_24				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_RD0765_211_24_20190410_00060.jpg



View looking downstream at footpath that cuts into levee slope. Spring 2019

LM Start	0.95	Rating **	M	Issue No.	23
LM End	0.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.490067 °	38.490067 °
				-121.555530 °	-121.555530 °
DWR ID	DWR_RD0765_01_s_2019_23				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_RD0765_211_23_20190410_00059.jpg



View looking east at footpath that cuts into levee slope. Spring 2019

LM Start	0.96	Rating **	M	Issue No.	11
LM End	0.96	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489927 °	38.489927 °
				-121.555567 °	-121.555567 °
DWR ID	DWR_RD0765_01_s_2019_11				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.17	Rating **	M	Issue No.	14
LM End	1.21	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.487247 °	38.486632 °
				-121.553975 °	-121.553655 °
DWR ID	DWR_RD0765_01_s_2019_14				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	1.27	Rating **	M	Issue No.	21
LM End	1.27	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485932 °	38.485932 °
				-121.553127 °	-121.553127 °
DWR ID	DWR_RD0765_01_s_2019_21				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	1.28	Rating **	U	Issue No.	15
LM End	1.32	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485728 °	38.485210 °
				-121.553042 °	-121.552862 °
DWR ID	DWR_RD0765_01_s_2019_15				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild vines including the vines that have climbed up utility pole, which present a fire hazard.					

Photo 1 of 1 : SP_2019_RD0765_211_15_20190410_00057.jpg



View looking west at wild vines that have climbed up utility pole. Spring 2019

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.31	Rating **	M	Issue No.	20	
LM End	1.31	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Encroachments			38.485382 °	38.485382 °	
				-121.552842 °	-121.552842 °	
DWR ID	DWR_RD0765_01_s_2019_20					
Comment Code						
TR : Tree or limb						
Inspector Comment						
Remove fallen tree from levee slope.						

Photo 1 of 1 : SP_2019_RD0765_211_20_20190410_00056.jpg



View looking upstream at fallen tree on levee slope. Spring 2019

LM Start	1.31	Rating **	C	Issue No.	49
LM End	1.31	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485337 °	38.485337 °
				-121.552907 °	-121.552907 °
DWR ID	DWR_RD0765_01_f_2018_49				
Comment Code					
PR : Prunings					
Inspector Comment					
Remove prunings from slope.					

No Photos

LM Start	1.32	Rating **	M	Issue No.	7
LM End	1.34	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.485287 °	38.485014 °
				-121.552818 °	-121.552618 °
DWR ID	DWR_RD0765_01_s_2015_7				
Comment Code					
TR : Tree or limb					
Inspector Comment					
LMA removed some but not all tree logs.					

Photo 1 of 2 : SP_2019_RD0765_211_7_20190410_00061.jpg



View looking downstream at tree log on levee slope. Spring 2019

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.32	Rating **	M	Issue No.	7 (cont)	
LM End	1.34	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Encroachments			38.485287 °		38.485014 °
				-121.552818 °		-121.552618 °
DWR ID	DWR_RD0765_01_s_2015_7					
Comment Code						
TR : Tree or limb						
Inspector Comment						
LMA removed some but not all tree logs.						

Photo 2 of 2 : SP_2019_RD0765_211_7_20190307_00009.jpg



Looking southeast at branch on waterward slope.

LM Start	1.36	Rating **	M	Issue No.	16
LM End	1.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.484762 °	38.484135 °
				-121.552523 °	-121.552138 °
DWR ID	DWR_RD0765_01_s_2019_16				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	1.37	Rating **	C	Issue No.	4
LM End	1.37	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.484563 °	38.484563 °
				-121.552289 °	-121.552289 °
DWR ID	DWR_RD0765_01_s_2012_4				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	---	--	---	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.43	Rating **	M	Issue No.	67
LM End	1.43	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.483810 °	38.483810 °
				-121.551747 °	-121.551747 °
DWR ID	DWR_RD0765_01_s_2017_67				
Comment Code					
GA : Garbage					
Inspector Comment					
Remove sofa dumped on waterside slope.					

Photo 1 of 1 : SP_2019_RD0765_211_67_20190307_00040.jpg



View of sofa debris dumped on slope. Spring 2018

LM Start	1.44	Rating **	M	Issue No.	41
LM End	1.44	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483640 °	38.483640 °
				-121.551727 °	-121.551727 °
DWR ID	DWR_RD0765_01_s_2012_41				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Trim trees to at least five feet above slope.					

Photo 1 of 1 : SP_2019_RD0765_211_41_20190307_00021.jpg



View of low branches and prunings on slope. Fall 2018

LM Start	1.47	Rating **	M	Issue No.	52
LM End	1.70	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.483340 °	38.480345 °
				-121.551565 °	-121.549658 °
DWR ID	DWR_RD0765_01_f_2018_52				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Trim tall brush along slope.					

Photo 1 of 3 : SP_2019_RD0765_211_52_20190307_00030.jpg



View of tall brush on levee slope. Fall 2018

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.47	Rating **	M	Issue No.	52 (cont)	
LM End	1.70	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			38.483340 °		38.480345 °
				-121.551565 °		-121.549658 °
DWR ID	DWR_RD0765_01_f_2018_52					
Comment Code						
V2 : Remove the wild growth other than native grasses from the levee slopes.						
Inspector Comment						
Trim tall brush along slope.						

Photo 2 of 3 : SP_2019_RD0765_211_52_20190307_00031.jpg



View of tall brush on levee slope. Fall 2018

LM Start	1.47	Rating **	M	Issue No.	52 (cont)
LM End	1.70	Issue Type +	Ma	Location *	LS

Photo 3 of 3 : SP_2019_RD0765_211_52_20190307_00032.jpg



View of tall brush on levee slope. Fall 2018

LM Start	1.48	Rating **	M	Issue No.	42
LM End	1.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.483170 °	38.482965 °
				-121.551367 °	-121.551265 °
DWR ID	DWR_RD0765_01_s_2012_42				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2019_RD0765_211_42_20190307_00022.jpg



View of low tree branches partially blocking visibility. Fall 2018

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.51	Rating **	C	Issue No.	50
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.482870 °	38.482870 °
				-121.551127 °	-121.551127 °
DWR ID	DWR_RD0765_01_s _ 2016_50				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
LMA trimmed trees but left prunings on slope.					

No Photos

LM Start	1.51	Rating **	A/W	Issue No.	45
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.482835 °	38.482835 °
				-121.551083 °	-121.551083 °
DWR ID	DWR_RD0765_01_s _ 2018_45				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Tree log used to control vehicle traffic access to levee.					

Photo 1 of 1 : SP_2019_RD0765_211_45_20190307_00024.jpg



Tree log on waterside slope is used to control vehicle access. Spring 2018

LM Start	1.51	Rating **	M	Issue No.	31
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.482788 °	38.482788 °
				-121.551048 °	-121.551048 °
DWR ID	DWR_RD0765_01_s _ 2018_31				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_RD0765_211_31_20190307_00018.jpg



View looking southeast at slope instability due to vehicle traffic. Spring 2018

* Location
LS : Land Side N/A : Not Applicable
WS : Water Side
CR : Crown

** Rating
A : Acceptable
M : Minimally Acceptable
U : Unacceptable
N : Not Inspected/Rated
C : Corrected
A/W : Acceptable but Monitor & Maintain

+ Issue Type
Ma : Maintenance Deficiency
Ob : Design & System Obsolescence
En : Enforcement

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.53	Rating **	M	Issue No.	28
LM End	1.53	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482607 °	38.482607 °
				-121.550885 °	-121.550885 °
DWR ID	DWR_RD0765_01_s_2019_28				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild growth down to 20' from levee shoulder.					

No Photos

LM Start	1.58	Rating **	M	Issue No.	17
LM End	1.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481973 °	38.481973 °
				-121.550547 °	-121.550547 °
DWR ID	DWR_RD0765_01_s_2019_17				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

LM Start	1.58	Rating **	M	Issue No.	1
LM End	1.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.481959 °	38.481959 °
				-121.550527 °	-121.550527 °
DWR ID	DWR_RD0765_01_f_2017_1				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove fallen tree on waterside slope.					

Photo 1 of 1 : SP_2019_RD0765_211_1_20190307_00001.jpg



View looking north at the fallen tree. Fall 2017

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.59	Rating **	C	Issue No.	39
LM End	1.59	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.481798 °	38.481798 °
				-121.550449 °	-121.550449 °
DWR ID	DWR_RD0765_01_f_2016_39				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Downed tree on waterside slope.					

No Photos

LM Start	1.67	Rating **	M	Issue No.	13	
LM End	1.68	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Encroachments			38.480763 °	38.480632 °	
				-121.549581 °	-121.549543 °	
DWR ID	DWR_RD0765_01_s_2012_13					
Comment Code						
TR : Tree or limb						
Inspector Comment						
Remove large tree branch on waterside slope.						

Photo 1 of 2 : SP_2019_RD0765_211_13_20190307_00014.jpg



Looking northwest at tree limb in vegetation on waterside slope. Fall 2017

LM Start	1.67	Rating **	M	Issue No.	13 (cont)
LM End	1.68	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2019_RD0765_211_13_20190307_00015.jpg



Looking northwest at large tree limb on waterward slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/10/2019 04/10/2019	Luz Dial

LM Start	1.68	Rating **	M	Issue No.	27
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.480708 °	38.480708 °	
			-121.549515 °	-121.549515 °	
DWR ID	DWR_RD0765_01_s_2019_27				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---