

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start		Rating **	M	Issue No.	<b>18</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2013_18				
Comment Code					
ES : Emergency Supplies & Equipment					
Inspector Comment					
The LMA does not have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	<b>44</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_44				
Comment Code					
OM : O&M Manuals					
Inspector Comment					
LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	M	Issue No.	<b>46</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_46				
Comment Code					
FP : Flood Preparedness & Training					
Inspector Comment					
LMA has not recently attended Flood Fight Training.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	0.02	Rating **	U	Issue No.	20
LM End	0.02	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.502711°	38.502711°
				-121.560019°	-121.560019°
DWR ID	DWR_RD0765_01_f _ 2022_20				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Repair erosion caused by foot traffic.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_20\_20230418\_00025.jpg



Footpath on the WS slope. Spring 2023

LM Start	0.29	Rating **	C	Issue No.	34
LM End	0.29	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.498798°	38.498798°
				-121.560501°	-121.560501°
DWR ID	DWR_RD0765_01_f_2020_34				
Comment Code					
DE : Debris					
Inspector Comment					
Debris has been removed.					

No Photos

LM Start	0.51	Rating **	C	Issue No.	36
LM End	0.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.495748°	38.495748°
				-121.559525°	-121.559525°
DWR ID	DWR_RD0765_01_f_2020_36				
Comment Code					
T3 : Fallen tree with root ball.					
Inspector Comment					
Tree has been displaced due to high water, no erosion of slope observed.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>N : Not Inspected/Rated</b> C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	0.75	Rating **	M	Issue No.	68
LM End	0.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.492705°	38.492705°
				-121.557193°	-121.557193°
DWR ID	DWR_RD0765_01_s_2017_68				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair tire rut damage on the LS shoulder.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_68\_20230306\_00024.jpg



View of the LS levee shoulder damaged by vehicle traffic. Spring 2021.

LM Start	0.94	Rating **	U	Issue No.	24
LM End	0.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.490265°	38.490265°
				-121.555617°	-121.555617°
DWR ID	DWR_RD0765_01_s_2019_24				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Erosion and footpath on the WS slope need to be repaired.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_24\_20230306\_00011.jpg



Erosion on the WS footpath. Fall 2022

LM Start	0.95	Rating **	U	Issue No.	23
LM End	0.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.490067°	38.490067°
				-121.555530°	-121.555530°
DWR ID	DWR_RD0765_01_s_2019_23				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion at the footpath on the WS slope.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_23\_20230418\_00026.jpg



Erosion at the footpath on the WS slope. Spring 2023

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	0.99	Rating **	M	Issue No.	35
LM End	0.99	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.489574°	38.489574°
				-121.555308°	-121.555308°
DWR ID	DWR_RD0765_01_s_2022_35				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair rutting on the waterside shoulder.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_35\_20230418\_00027.jpg



Rutting on the waterside shoulder. Spring 2023

LM Start	1.00	Rating **	A/W	Issue No.	30
LM End	1.00	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.489503°	38.489503°
				-121.555272°	-121.555272°
DWR ID	DWR_RD0765_01_s_2022_30				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Monitor footpath for further erosion.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_30\_20230306\_00013.jpg



Footpath on the waterside slope. Spring 2022

LM Start	1.08	Rating **	C	Issue No.	14
LM End	1.08	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.488401°	38.488401°
				-121.554658°	-121.554658°
DWR ID	DWR_RD0765_01_f_2021_14				
Comment Code					
T2 : Tree or limb.					
Inspector Comment					
Tree has been cut back 20' from the crown.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	1.29	Rating **	U	Issue No.	15
LM End	1.30	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.485644°	38.485445°
				-121.553128°	-121.553014°
DWR ID	DWR_RD0765_01_s_2019_15				
Comment Code					
V2 : Remove the wild growth and woody vegetation other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild vines and growth on the LS slope.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_15\_20230306\_00006.jpg



Ivy growth on the LS slope. Fall 2021

LM Start	1.33	Rating **	U	Issue No.	4
LM End	1.33	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.485062°	38.485062°
				-121.552635°	-121.552635°
DWR ID	DWR_RD0765_01_s_2023_4				
Comment Code					
T2 : Tree or limb.					
Inspector Comment					
Remove logs and limbs from WS slope within 20' of the crown.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_4\_20230418\_00031.jpg



Logs on the WS slope. Spring 2023

LM Start	1.38	Rating **	M	Issue No.	3
LM End	1.38	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.484507°	38.484507°
				-121.552229°	-121.552229°
DWR ID	DWR_RD0765_01_s_2023_3				
Comment Code					
GA : Garbage					
Inspector Comment					
Remove appliance from WS slope.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_3\_20230418\_00032.jpg



Appliance on the WS slope. Spring 2023

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	1.42	Rating **	A/W	Issue No.	10
LM End	1.42	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Foot Traffic			38.483973°	38.483973°
				-121.551855°	-121.551855°
DWR ID	DWR_RD0765_01_f_2021_10				
Comment Code					
E3 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
Monitor two footpaths for erosion.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_10\_20230306\_00002.jpg



Footpaths on the WS slope. Fall 2021

LM Start	1.43	Rating **	M	Issue No.	67
LM End	1.43	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.483810°	38.483810°
				-121.551747°	-121.551747°
DWR ID	DWR_RD0765_01_s_2017_67				
Comment Code					
GA : Garbage					
Inspector Comment					
Remove sofas dumped on waterside slope.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_67\_20230306\_00023.jpg



Sofas on the WS slope. Fall 2021

LM Start	1.46	Rating **	M	Issue No.	2
LM End	1.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.483414°	38.483414°
				-121.551472°	-121.551472°
DWR ID	DWR_RD0765_01_s_2023_2				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair rutting on the WS shoulder.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_2\_20230418\_00033.jpg



Rutting on the WS shoulder. Spring 2023

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2023

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	04/14/2023 04/14/2023	Marvin Marshall

LM Start	1.51	Rating **	C	Issue No.	31
LM End	1.51	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Vehicle Traffic			38.482788°	38.482788°
				-121.551048°	-121.551048°
DWR ID	DWR_RD0765_01_f_2019_31				
Comment Code					
E6 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Rock has been placed, this is a maintenance ramp.					

No Photos

LM Start	1.61	Rating **	N	Issue No.	9
LM End	1.61	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481560°	38.481560°
				-121.550295°	-121.550295°
DWR ID	DWR_RD0765_01_s_2020_9				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					
Remove stump on the WS slope.					

Photo 1 of 1 : SP\_2023\_RD0765\_211\_9\_20230306\_00001.jpg



Tree stump on the WS slope. Fall 2022

LM Start	1.64	Rating **	M	Issue No.	1
LM End	1.64	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481151°	38.481151°
				-121.549866°	-121.549866°
DWR ID	DWR_RD0765_01_s_2023_1				
Comment Code					
T2 : Tree or limb.					
Inspector Comment					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---