

**Flood Control Project Maintenance  
Levee Inspections**

**Fall 2014 Levee Maintenance Deficiency Summary Report**

**Overall LMA & Unit Ratings, including USACE Erosion Survey**

**Sacramento River Basin**

<b>RD0784</b>	Overall LMA Rating	Total LMA Miles							
<b>Reclamation District No. 0784 Plumas Lake</b>	<b>A</b>	<b>33.20</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Earthen Levee</i>									
Vegetation	0.01		0.01	0.03%					
Encroachments					1.69	1.46			
<i>Supplemental</i>									
USACE Erosion Survey	0.43		0.43	1.30%					
DWR UCIP Field Study					0.13				
<i>LMA Totals:</i>	0.44	0.00	0.44	1.33%	1.82	1.46	0.00	0.00	
<b>Unit No. 01 Yuba River LB</b>	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>2.21</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Earthen Levee</i>									
Vegetation	0.01		0.01	0.45%					
Encroachments						0.61			
<i>Supplemental</i>									
DWR UCIP Field Study					0.01				
<i>Unit Totals:</i>	0.01	0.00	0.01	0.45%	0.01	0.61	0.00	0.00	
<b>Unit No. 02A Feather River LB</b>	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>2.54</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
No Items									
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%					
<b>Unit No. 02B Feather River LB</b>	Overall Unit Rating	Total Unit Miles							
RD0784	<b>M</b>	<b>3.95</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Earthen Levee</i>									
Encroachments					0.10				
<i>Supplemental</i>									
USACE Erosion Survey	0.42		0.42	10.64%					
DWR UCIP Field Study					0.01				
<i>Unit Totals:</i>	0.42	0.00	0.42	10.64%	0.11	0.00	0.00	0.00	
<b>Unit No. 03A Bear River RB</b>	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>0.78</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Supplemental</i>									
USACE Erosion Survey	0.01		0.01	1.28%					
<i>Unit Totals:</i>	0.01	0.00	0.01	1.28%	0.00	0.00	0.00	0.00	

**Flood Control Project Maintenance  
Levee Inspections**

**Fall 2014 Levee Maintenance Deficiency Summary Report**

**Overall LMA & Unit Ratings, including USACE Erosion Survey**

**Sacramento River Basin (cont.)**

Unit No. 03B Bear River RB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>1.49</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Supplemental</i>									
DWR UCIP Field Study					0.01				
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%	0.01	0.00	0.00	0.00	
Unit No. 04 Interceptor Canal RB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>6.33</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Supplemental</i>									
DWR UCIP Field Study					0.02				
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%	0.02	0.00	0.00	0.00	
Unit No. 05 Interceptor Canal LB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>4.19</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Earthen Levee</i>									
Encroachments					1.59	0.85			
<i>Supplemental</i>									
DWR UCIP Field Study					0.06				
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%	1.65	0.85	0.00	0.00	
Unit No. 06 South Dry Creek RB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>0.25</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Supplemental</i>									
DWR UCIP Field Study					0.01				
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%	0.01	0.00	0.00	0.00	
Unit No. 07 Yuba River LB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>3.82</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
<i>Supplemental</i>									
DWR UCIP Field Study					0.01				
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%	0.01	0.00	0.00	0.00	
Unit No. 08 Three Rivers RB	Overall Unit Rating	Total Unit Miles							
RD0784	<b>A</b>	<b>1.93</b>							
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence		
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles	
No Items									
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%					

**Flood Control Project Maintenance  
Levee Inspections**

**Fall 2014 Levee Maintenance Deficiency Summary Report  
Overall LMA & Unit Ratings, including USACE Erosion Survey**

**Sacramento River Basin (cont.)**

Unit No. 09 Feather River LB RD0784	Overall Unit Rating	Total Unit Miles						
		<b>A</b>	<b>5.71</b>					
Rated Item	Maintenance Deficiency				Enforcement		Design & System Obsolescence	
	M Miles	U Miles	M + 4U Miles	Threshold %	M Miles	U Miles	M Miles	U Miles
No Items								
<i>Unit Totals:</i>	0.00	0.00	0.00	0.00%				

**Flood Control Project Maintenance  
Levee Inspections**  
**LMA District Cover Sheet**  
**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)			<b>A</b>	

\*\* Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

\* **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

**FALL INSPECTIONS:** The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments


**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 01 Yuba River		Left	2.21	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.21	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>4</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals			°	°
DWR ID	DWR_RD0784_01_s_2013_4				
Action/Comments					
Inspector Comments: O&M manuals are located at the district office.					

No Photos

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>5</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Emergency Supplies & Equipment			°	°
DWR ID	DWR_RD0784_01_s_2013_5				
Action/Comments					
Inspector Comments: RD 784 participates with the neighboring districts to strategically place flood fight supplies around the local districts for fast response. They also have a shipping container at their district office full of flood fight supplies.					

No Photos

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>6</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Flood Preparedness & Training			°	°
DWR ID	DWR_RD0784_01_s_2013_6				
Action/Comments					
Inspector Comments: RD 784 and its employees host and participate in a Flood Fight class put on by DWR every fall in their district.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.21	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>0.51</b>	Rating **	U	Issue No.	<b>12</b>
LM End	<b>1.00</b>	Issue Type +	En	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		39.131558 °	39.129475 °	
			-121.560668 °	-121.569209 °	
DWR ID	DWR_RD0784_01_f_2012_12				
Action/Comments					
Urban					

Photo 1 of 1 : FA\_2014\_RD0784\_178\_12\_20140929\_00002.jpg



Levee mile 0.53-1.00, this photo shows the fences and other obstruction near the toe of the levee on the landside.

LM Start	<b>0.83</b>	Rating **	A	Issue No.	<b>3</b>
LM End	<b>0.83</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.129794 °	39.129794 °	
			-121.566146 °	-121.566146 °	
DWR ID	DWR_RD0784_01_f_2014_3				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_178\_3\_20141003\_00005.jpg



This photo was taken from the levee crown facing west looking down the waterward levee slope at acceptable vegetation maintenance.

LM Start	<b>1.00</b>	Rating **	U	Issue No.	<b>13</b>
LM End	<b>1.12</b>	Issue Type +	En	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		39.129475 °	39.129615 °	
			-121.569210 °	-121.571371 °	
DWR ID	DWR_RD0784_01_f_2012_13				
Action/Comments					
Fence					

Photo 1 of 1 : FA\_2014\_RD0784\_178\_13\_20140929\_00003.jpg



Levee mile 1.00-1.12, this photo shows a fence near the levee toe on the landside.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	U * : M Longer than 2 Years	Ma : Maintenance Deficiency
WS : Water Side		M : Minimally Acceptable	C : Corrected		Ob : Design & System Obsolescence
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain		En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.21	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>1.28</b>	Rating **	M	Issue No.	<b>2</b>
LM End	<b>1.28</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.129783 °	39.129783 °
				-121.574384 °	-121.574384 °
DWR ID	DWR_RD0784_01_s_2012_2				
Action/Comments					
Elderberries are blocking visibility and flood fight capability.					

Photo 1 of 1 : FA\_2014\_RD0784\_178\_2\_20140929\_00001.jpg



W/S slope vegetation, Elderberry.

LM Start	<b>1.31</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>1.31</b>	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.129826 °	39.129826 °
				-121.574940 °	-121.574940 °
DWR ID	DWR_RD0784_01_f_2014_1				
Action/Comments					
Inspector Comments: FS_ID:29363 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: No permit identified for this crossing. Need to determine if owner has permit. FIELD_STRUCT_DESC: Fiber Optic Communication lines cross levee. Diameter unknown. FS Date: 2/13/2014 9:24:00 AM					

No Photos

<b>* Location</b> LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 02A Feather River		Left	2.54	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*



**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 02B Feather River		Left	3.95	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			<b>M</b>	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02B Feather River	Left	3.95	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>9.25</b>	Rating **	M	Issue No.	<b>2</b>
LM End	<b>9.25</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.005970 °	39.005970 °
				-121.578008 °	-121.578008 °
DWR ID	DWR_RD0784_02B_f_2014_2				
Action/Comments					
Inspector Comments: FS_ID:29288 EP_NO: 18227 Repair Type: Crossing Status: UCIP Comments: Gate on enclosure at LS toe is not locked. Vaults on WS toe are open and need to be secured. FIELD_STRUCT_DESC: 1 of 3: 30-inch HDPE irrigation pipe through the levee 3-feet below the crown. Siphon breaker and air relief valve in vault on waterside shoulder. Pumps in pump house on the bank. Gate valves in concrete distribution box. Chain link enclosure at the landside toe. Discharges into concrete box on the landward side. (Permit No. 18227, 2007) FS Date: 2/13/2014 9:24:24 AM					

No Photos

LM Start	<b>9.40</b>	Rating **	C	Issue No.	<b>1</b>
LM End	<b>9.40</b>	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			39.003905 °	39.003905 °
				-121.578774 °	-121.578774 °
DWR ID	DWR_RD0784_02_s_2012_1				
Action/Comments					
Building					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---



**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 03A Bear River		Right	0.78	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03A Bear River	Right	0.78	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>3.19</b>	Rating **	A	Issue No.	<b>2</b>
LM End	<b>3.19</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.974679 °	38.974679 °	
			-121.535478 °	-121.535478 °	
DWR ID	DWR_RD0784_03A_f_2014_2				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_533\_2\_20141003\_00002.jpg



This photo was taken from the levee crown facing east looking down the waterward levee slope at acceptable vegetation maintenance.

LM Start	<b>4.31</b>	Rating **	M	Issue No.	<b>3</b>
LM End	<b>4.32</b>	Issue Type +	Ma	Location *	WS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	USACE Erosion Survey		38.981400 °	38.981271 °	
			-121.515848 °	-121.515999 °	
DWR ID	DWR_RD0784_03A_f_2014_3				
Action/Comments					
Inspector Comments: 2009 - Small site which could be repaired with maintenance. Erosion into the levee toe, rock has started to fail. 2013: No observed changes. [2013 Site ID: BER_4-9_R]					

Photo 1 of 1 : FA\_2014\_RD0784\_533\_3\_20140929\_00001.jpg



USACE 2013 Photo #1

<b>* Location</b> LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 03B Bear River		Right	1.49	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/09/2014 - 04/09/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03B Bear River	Right	1.49	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>4.12</b>	Rating **	A	Issue No.	<b>2</b>
LM End	<b>4.12</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.979542 °	38.979542 °	
			-121.518508 °	-121.518508 °	
DWR ID	DWR_RD0784_03B_f_2014_2				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_534\_2\_20141003\_00002.jpg



This photo was taken from the levee crown facing east looking down the landward levee slope at acceptable vegetation maintenance.

LM Start	<b>4.69</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>4.69</b>	Issue Type +	En	Location *	LS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		38.985247 °	38.985247 °	
			-121.511075 °	-121.511075 °	
DWR ID	DWR_RD0784_03B_f_2014_1				
Action/Comments					
Inspector Comments: FS_ID:29284 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Flap gate blocked by vegetation on WS toe. Unable to locate inlet. FIELD_STRUCT_DESC: 18-inch CM drain pipe through the levee 20-feet below the crown. Gate valve on waterward side. Originally included in O+M Manual (1955). FS Date: 2/13/2014 9:16:07 AM					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 04 Interceptor Canal		Right	6.33	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/09/2014 - 04/09/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Interceptor Canal	Right	6.33	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>1.55</b>	Rating **	A	Issue No.	<b>3</b>
LM End	<b>1.55</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.997023 °	38.997023 °
				-121.539335 °	-121.539335 °
DWR ID	DWR_RD0784_04_f_2014_3				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_181\_3\_20141003\_00004.jpg



This photo was taken from the levee crown facing north looking down the waterward levee slope at acceptable vegetation maintenance.

LM Start	<b>3.59</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>3.59</b>	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.026347 °	39.026347 °
				-121.542343 °	-121.542343 °
DWR ID	DWR_RD0784_04_f_2014_1				
Action/Comments					
Inspector Comments: FS_ID:29289 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: No permit identified for crossing. FIELD_STRUCT_DESC: Communication line through the levee at unknown depth on downstream side of bridge. FS Date: 2/13/2014 9:24:53 AM					

No Photos

<b>* Location</b> LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Interceptor Canal	Right	6.33	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>6.24</b>	Rating **	M	Issue No.	<b>2</b>
LM End	<b>6.24</b>	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.058533 °	39.058533 °
				-121.550485 °	-121.550485 °
DWR ID	DWR_RD0784_04_f_2014_2				
Action/Comments					
Inspector Comments: FS_ID:29285 EP_NO: 5384 Repair Type: Crossing Status: UCIP Comments: Large animal burrough along pipe alignment on WS has undermined pipe for an unknown length. Pipe is corroded through on WS. Pipe should be properly abandoned. FIELD_STRUCT_DESC: 8-inch pipe through the levee 2.6 feet below the crown. Vertical pump unit and service pole on the waterward side. Discharge into concrete riser on the landward side. (Permit No. 5384) 1966. FS Date: 2/26/2013					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 05 Interceptor Canal		Left	4.19	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/09/2014 - 04/09/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.19	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>1.86</b>	Rating **	M	Issue No.	<b>2</b>
LM End	<b>1.86</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.000975 °	39.000975 °
				-121.537779 °	-121.537779 °
DWR ID	DWR_RD0784_05_f_2014_2				
Action/Comments					
Inspector Comments: FS_ID:29291 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Inlet burried. Good candidate for video inspection as pipe is corroded. FIELD_STRUCT_DESC: 18-inch CM drain pipe through the levee, 14.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on the waterward side. Originally included in O+M manual (1955). FS Date: 2/13/2014 9:25:46 AM					

No Photos

LM Start	<b>2.04</b>	Rating **	M	Issue No.	<b>3</b>
LM End	<b>2.04</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.003643 °	39.003643 °
				-121.538292 °	-121.538292 °
DWR ID	DWR_RD0784_05_f_2014_3				
Action/Comments					
Inspector Comments: FS_ID:29292 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Erosion at outlet may or may not be an issue. FIELD_STRUCT_DESC: 18-inch CM drain pipe through the levee, 14.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on the waterward side. PVC weir on inlet. Originally included in O+M manual (1955). FS Date: 2/13/2014 9:26:10 AM					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.19	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>2.10</b>	Rating **	A	Issue No.	<b>11</b>
LM End	<b>2.10</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.004504 °	39.004504 °
				-121.538492 °	-121.538492 °
DWR ID	DWR_RD0784_05_f_2014_11				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_182\_11\_20141003\_00009.jpg



This photo was taken from the levee crown facing west looking down the waterward levee slope at acceptable vegetation maintenance.

LM Start	<b>2.11</b>	Rating **	M	Issue No.	<b>9</b>
LM End	<b>3.07</b>	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			39.004562 °	39.015593 °
				-121.538482 °	-121.528533 °
DWR ID	DWR_RD0784_05_s_2012_9				
Action/Comments					
Ditch					

No Photos

LM Start	<b>2.47</b>	Rating **	M	Issue No.	<b>4</b>
LM End	<b>2.47</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.008994 °	39.008994 °
				-121.535679 °	-121.535679 °
DWR ID	DWR_RD0784_05_f_2014_4				
Action/Comments					
Inspector Comments: FS_ID:29293 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Heavy erosion around inlet headwall due to beaver activity. FIELD_STRUCT_DESC: 18-inch CM drain pipe through the levee, 15.5 feet below the crown. Flap gate on the waterward end. Concrete "U" headwall on the waterward side. Originally included in O+M manual (1955). FS Date: 2/13/2014 9:26:39 AM					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.19	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>2.51</b>	Rating **	U	Issue No.	<b>5</b>
LM End	<b>3.36</b>	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			39.009439 °	39.017779 °
				-121.535210 °	-121.524150 °
DWR ID	DWR_RD0784_05_s_2013_5				
Action/Comments					
Fence					

Photo 1 of 1 : FA\_2014\_RD0784\_182\_5\_20140929\_00001.jpg



Fence at L/S levee toe.

LM Start	<b>3.06</b>	Rating **	M	Issue No.	<b>7</b>
LM End	<b>3.06</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.015549 °	39.015549 °
				-121.528590 °	-121.528590 °
DWR ID	DWR_RD0784_05_f_2014_7				
Action/Comments					
Inspector Comments: FS_ID:29294 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Pipe has been sliplined with PVC, but the liner appears to be eroding at outlet and may be disjointed internal to the levee. See pic. Good candidate for video inspection. FIELD_STRUCT_DESC: 12-inch CM drain pipe through the levee, 12.0 feet below the crown. Flap gate and concrete "U" headwall on the waterward side. PVC weir on inlet at LS toe. Originally included in O+M manual (1955). FS Date: 2/13/2014 9:27:13 AM					

No Photos

<b>* Location</b> LS : Land Side WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.19	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>3.96</b>	Rating **	M	Issue No.	<b>8</b>
LM End	<b>3.96</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.019787 °	39.019787 °
				-121.513386 °	-121.513386 °
DWR ID	DWR_RD0784_05_f_2014_8				
Action/Comments					
Inspector Comments: FS_ID:29295 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Pipe burried on LS toe and flap gate is blocked by soil on WS toe. FIELD_STRUCT_DESC: 18-inch CM pipe through the levee, 10.0 feet below the crown. Flap gate on the waterward end. Originally included in O+M manual (1955). FS Date: 2/13/2014 9:27:34 AM					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 06 South Dry Creek		Right	0.25	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/09/2014 - 04/09/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	0.25	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>0.06</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>0.06</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.985999 °	38.985999 °
				-121.509618 °	-121.509618 °
DWR ID	DWR_RD0784_06_f_2014_1				
Action/Comments					
Inspector Comments: FS_ID:29296 EP_NO: N/A Repair Type: Crossing Status: UCIP Comments: Pipe partially blocked on LS and flap gate blocked on WS. FIELD_STRUCT_DESC: 18-inch CM drain pipe through the levee 19-feet below the crown. Gate valve on waterward side. Originally included in O+M Manual (1955). See Dwg. 2-4-106 Sheet 2. FS Date: 2/13/2014 9:27:53 AM					

No Photos

LM Start	<b>0.18</b>	Rating **	A	Issue No.	<b>18</b>
LM End	<b>0.18</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.986983 °	38.986983 °
				-121.507783 °	-121.507783 °
DWR ID	DWR_RD0784_06_f_2014_18				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_183\_18\_20141003\_00016.jpg



This photo was taken from the levee crown facing east looking down the landward levee slope at acceptable vegetation maintenance.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 07 Yuba River		Left	3.82	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 07 Yuba River	Left	3.82	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>0.68</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>0.68</b>	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			39.138326 °	39.138326 °
				-121.540655 °	-121.540655 °
DWR ID	DWR_RD0784_07_f_2014_1				
Action/Comments					
Inspector Comments: FS_ID:29286 EP_NO: 3446 Repair Type: Crossing Status: UCIP Comments: USAA paint on roadway and flags along levee alignment. Needs proper markers. FIELD_STRUCT_DESC: 1-1/4-inch PG&E gas line through the levee, 2 feet below the crown. (Permit No. 3446) FS Date: 2/13/2014 9:22:37 AM					

No Photos

LM Start	<b>1.97</b>	Rating **	A	Issue No.	<b>2</b>
LM End	<b>1.97</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.147537 °	39.147537 °
				-121.520566 °	-121.520566 °
DWR ID	DWR_RD0784_07_f_2014_2				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_184\_2\_20141003\_00003.jpg



This photo was taken from the levee crown facing west looking down the landward levee slope at acceptable vegetation maintenance.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 08 Three Rivers		Right	1.93	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Fall 2014**

**Reclamation District No. 0784 Plumas Lake**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 08 Three Rivers	Right	1.93	10/01/2014 10/01/2014	Matthew Hoffman

LM Start	<b>0.61</b>	Rating **	A	Issue No.	<b>1</b>
LM End	<b>0.61</b>	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.957281 °	38.957281 °
				-121.564089 °	-121.564089 °
DWR ID	DWR_RD0784_08_f_2014_1				
Action/Comments					
Control annual grass and weeds on the levee slopes and easements.					

Photo 1 of 1 : FA\_2014\_RD0784\_437\_1\_20141013\_00002.jpg



This photo was taken from the crown facing east looking down the landward levee slope at acceptable vegetation maintenance.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	U * : M Longer than 2 Years	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	-----------------------------	---

**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Fall 2014 Levee Inspection Results**

**Reclamation District No. 0784 Plumas Lake**

Waterway		Bank	Unit Miles	
Unit No. 09 Feather River		Left	5.71	
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)			A	
Date of Inspection	04/08/2014 - 04/08/2014		10/01/2014 - 10/01/2014	
DWR Inspector	Matthew Hoffman		Matthew Hoffman	
Accompanied By	Patrick Meagher RD 784		Patrick Meagher RD 784	

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

