

**Flood Control Project Maintenance  
Levee Inspections**  
**LMA District Cover Sheet**  
**Spring 2017 Levee Inspection Results**

**Reclamation District No. 1602 Del Puerto**

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
† Overall LMA Rating (Fall Only)				

\*\* Non-receipt of Summer or Winter Inspection  
Reports may effect overall annual rating.

† SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments


**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Spring 2017 Levee Inspection Results**

**Reclamation District No. 1602 Del Puerto**

Waterway			Bank	Unit Miles
Unit No. 01 San Joaquin River			Left	6.24
	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	4/6/2017 - 4/6/2017			
DWR Inspector	Pavel Kazi			
Accompanied By	Tony Martinez RD 1602			

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>39</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals				
DWR ID	DWR_RD1602_01_s_2012_39				
Comment Code					
Inspector Comment					
The LMA has all the O&M manuals.					

No Photos

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>77</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Emergency Supplies & Equipment				
DWR ID	DWR_RD1602_01_s_2012_77				
Comment Code					
Inspector Comment					
The LMA has enough flood materials in case of an incident.					

No Photos

LM Start	<b>0.00</b>	Rating **	A	Issue No.	<b>97</b>
LM End	<b>0.00</b>	Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Flood Preparedness & Training				
DWR ID	DWR_RD1602_01_s_2012_97				
Comment Code					
Inspector Comment					
The LMA has solid understanding and most of them have flood preparedness training. They will have more training this year with other districts.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.00	Rating **	U	Issue No.	1
LM End	0.11	Issue Type +	En	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.476560 °	37.477295 °
				-121.083862 °	-121.082087 °
DWR ID	DWR_RD1602_01_s_2012_1				
Comment Code					
BU : Building					
Inspector Comment					
Animal pens across levee crown. FIR #6301 was created for this issue.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_1\_20170327\_00001.jpg



Looking at animal pens on crown of levee from LM 0.00 to 0.11.

LM Start	0.13	Rating **	M	Issue No.	16
LM End	0.60	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.477228 °	37.479964 °
				-121.081733 °	-121.074593 °
DWR ID	DWR_RD1602_01_f_2016_16				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_16\_20170410\_00091.jpg



View of the vegetation on the waterside of the levee. Spring 2017

LM Start	0.13	Rating **	M	Issue No.	17
LM End	0.60	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.477228 °	37.479964 °
				-121.081733 °	-121.074593 °
DWR ID	DWR_RD1602_01_f_2016_17				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_17\_20170410\_00092.jpg



View of the vegetation on the landside of the levee. Spring 2017

**\* Location**  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.18	Rating **	M	Issue No.	20
LM End	0.18	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.477575 °	37.477575 °
				-121.080943 °	-121.080943 °
DWR ID	DWR_RD1602_01_f_2016_20				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	0.20	Rating **	M	Issue No.	28
LM End	0.20	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.477706 °	37.477706 °
				-121.080674 °	-121.080674 °
DWR ID	DWR_RD1602_01_f_2015_28				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 2 : SP\_2017\_RD1602\_110\_28\_20170327\_00013.jpg



Updated picture of the rodent hole on the waterside of the levee during spring 2016 inspection.

LM Start	<b>0.20</b>	Rating **	M	Issue No.	<b>28 (cont)</b>
LM End	<b>0.20</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP\_2017\_RD1602\_110\_28\_20170327\_00014.jpg



A rodent hole was found on the waterside of the levee.

* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

# Reclamation District No. 1602 Del Puerto

No Photos

60-inch CMP riser on WS shoulder.

Page 4 of 53



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.58	Rating **	A/W	Issue No.	200 (cont)
LM End	0.58	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.480182 °	37.480182 °
				-121.074765 °	-121.074765 °
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51325  
DS\_ID:20215  
EP\_NO: N/A  
Repair Type: No Action Needed  
Crossing Status: Found  
UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to No Action Needed a cover has been added to the CMP riser. (O. Magana - DWR UCIP)10/01/2013 Open 60-inch CMP riser on WS needs lid as it's depth may be a hazard to the public. (W. Wylie - DWR UCIP)  
FIELD\_STRUCT\_DESC: 16-inch steel drainage pipe through levee, 11.3 feet below crown. Slide gate in 60-inch corrugated metal pipe (CMP) riser located on the waterside (WS). Concrete inlet is approximately 110 feet west of the levee crown or 110 feet off landside (LS) toe next to roadway. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 0.58), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

LM Start	<b>0.58</b>	Rating **	A/W	Issue No.	<b>200 (cont)</b>
LM End	<b>0.58</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : UCIP\_SP\_2017\_51325\_36701.jpg



CMP riser with slide gate on WS shoulder.

Photo 3 of 3 : UCIP\_SP\_2017\_51325\_36700.jpg



Damaged Wooden lid on WS toe.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.58	Rating **	M	Issue No.	201
LM End	0.58	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			37.480176 °	37.480176 °
				-121.074736 °	-121.074736 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:22937 DS_ID:24681 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: No permit identified for this crossing. FIELD_STRUCT_DESC: Communication line through the levee at an unknown depth. FS Date: 10/1/2013					

LM Start	<b>0.58</b>	Rating **	M	Issue No.	<b>201 (cont)</b>
LM End	<b>0.58</b>	Issue Type +	En	Location *	WS

Photo 1 of 3 : UCIP\_SP\_2017\_22937\_39050.jpg



Communication line access box on LS shoulder.

Photo 2 of 3 : UCIP\_SP\_2017\_22937\_39049.jpg



Communication line access box on LS shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.58	Rating **	M	Issue No.	201 (cont)	
LM End	0.58	Issue Type +	En	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP Field Study			37.480176 °	37.480176 °	
				-121.074736 °	-121.074736 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:22937 DS_ID:24681 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: No permit identified for this crossing. FIELD_STRUCT_DESC: Communication line through the levee at an unknown depth. FS Date: 10/1/2013						

Photo 3 of 3 : UCIP\_SP\_2017\_22937\_39048.jpg



Communication line marker on LS shoulder.

LM Start	0.60	Rating **	M	Issue No.	70
LM End	0.71	Issue Type +	En	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.479967 °	37.478514 °
				-121.074582 °	-121.073435 °
DWR ID	DWR_RD1602_01_s_2012_70				
Comment Code					
FE : Fence					
Inspector Comment					
Barbed wire fence along the landward toe.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_70\_20170327\_00042.jpg



View of barbed wire fence at landward toe looking upstream.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.74	Rating **	C	Issue No.	21
LM End	0.74	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.478279 °	37.478279 °
				-121.073010 °	-121.073010 °
DWR ID	DWR_RD1602_01_f_2016_21				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	0.77	Rating **	A/W	Issue No.	202
LM End	0.77	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.477993 °	37.477993 °
				-121.072645 °	-121.072645 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51634 DS_ID:20216 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to No Action Needed the debris blocking the outlet has been cleared. (O. Magana - DWR UCIP)10/01/2013 Flap gate blocked from functioning by soil buildup on WS toe. Soil should be cleared. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert through levee, 14.4 feet below crown. Concrete "U" headwall on the waterside (WS) and landside (LS) ends. Slide gate in 6-foot by 7-foot concrete surge box is located on the WS shoulder. Flap gate is located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 0.78), Drawing No. 7-4-1784]. FS Date: 11/18/2016					

Photo 1 of 3 : UCIP\_SP\_2017\_51634\_36723.jpg



Inlet on LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	0.77	Rating **	A/W	Issue No.	202 (cont)
LM End	0.77	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.477993 °	37.477993 °
				-121.072645 °	-121.072645 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51634 DS_ID:20216 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to No Action Needed the debris blocking the outlet has been cleared. (O. Magana - DWR UCIP)10/01/2013 Flap gate blocked from functioning by soil buildup on WS toe. Soil should be cleared. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert through levee, 14.4 feet below crown. Concrete "U" headwall on the waterside (WS) and landside (LS) ends. Slide gate in 6-foot by 7-foot concrete surge box is located on the WS shoulder. Flap gate is located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 0.78), Drawing No. 7-4-1784]. FS Date: 11/18/2016					

Photo 2 of 3 : UCIP\_SP\_2017\_51634\_36722.jpg



Slide gate in concrete box on WS shoulder.

LM Start	<b>0.77</b>	Rating **	A/W	Issue No.	<b>202 (cont)</b>
LM End	<b>0.77</b>	Issue Type +	Ma	Location *	WS

Photo 3 of 3 : UCIP\_SP\_2017\_51634\_36721.jpg



Concrete inlet on LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.00	Rating **	M	Issue No.	36
LM End	1.00	Issue Type +	En	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.478810 °	37.478810 °
				-121.068738 °	-121.068738 °
DWR ID	DWR_RD1602_01_s_2012_36				
Comment Code					
RA : Ramp					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_36\_20170327\_00018.jpg



View of the ramp on the crown. The picture was taken from crown looking downstream.

LM Start	1.00	Rating **	M	Issue No.	203
LM End	1.00	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.478816 °	37.478816 °
				-121.068780 °	-121.068780 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51636 DS_ID:20217 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to Non-Urgent a flap gate has been added to the WS but pipe is currently not connected to pump. According to Tony Martinez, LMA representative, this crossing is currently not in use. Owner will need to coordinate with CVFPB to obtain permit. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned and if so should be done so properly. Flapgate missing. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: *ABANDONED* 1 of 2: 16-inch steel drainage pipe through levee, 17 feet below crown. Pumps on the pump platform are located on the landside (LS). Siphon breaker in 24-inch corrugated metal pipe (CMP) riser is located on the waterside (WS) shoulder. Concrete "U" headwall and flap gate are located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.01), Drawing No. 7-4-1784]. FS Date: 11/18/2016					

Photo 1 of 3 : UCIP\_SP\_2017\_51636\_36758.jpg



Pumping plant on LS toe. Pipe visible under walkway.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>1.00</b>	Rating **	M	Issue No.	<b>203 (cont)</b>
LM End	<b>1.00</b>	Issue Type +	Ma	Location *	WS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP LMA Responsibility		37.478816 °	37.478816 °	
			-121.068780 °	-121.068780 °	
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51636  
DS\_ID:20217  
EP\_NO: N/A  
Repair Type: Non-Urgent  
Crossing Status: Found  
UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to Non-Urgent a flap gate has been added to the WS but pipe is currently not connected to pump. According to Tony Martinez, LMA representative, this crossing is currently not in use. Owner will need to coordinate with CVFPB to obtain permit. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned and if so should be done so properly. Flapgate missing. (W. Wylie - DWR UCIP)  
FIELD\_STRUCT\_DESC: \*ABANDONED\* 1 of 2: 16-inch steel drainage pipe through levee, 17 feet below crown. Pumps on the pump platform are located on the landside (LS). Siphon breaker in 24-inch corrugated metal pipe (CMP) riser is located on the waterside (WS) shoulder. Concrete "U" headwall and flap gate are located on the WS end.  
[Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.01), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

LM Start	<b>1.00</b>	Rating **	M	Issue No.	<b>203 (cont)</b>
LM End	<b>1.00</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : UCIP\_SP\_2017\_51636\_36757.jpg



Siphon breaker in 24-inch CMP riser on WS shoulder.

Photo 3 of 3 : UCIP\_SP\_2017\_51636\_36756.jpg



Siphon breaker in 24-inch CMP riser on WS shoulder.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>1.00</b>	Rating **	M	Issue No.	<b>204</b>
LM End	<b>1.00</b>	Issue Type +	Ma	Location *	WS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP LMA Responsibility		37.478817 °	37.478817 °	
			-121.068773 °	-121.068773 °	
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51637  
DS\_ID:20219  
EP\_NO: N/A  
Repair Type: Non-Urgent  
Crossing Status: Found  
UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to Non-Urgent a flap gate has been added to the WS. According to Tony Martinez, LMA representative, this crossing is currently not in use. Owner will need to coordinate with CVFPB to obtain permit. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned siphon breakers covered in soil and flapgate missing. (W. Wylie - DWR UCIP) FIELD\_STRUCT\_DESC: \*ABANDONED\* 2 of 2: 16-inch steel drainage pipe through levee, 17 feet below crown. Pump on pump platform located on the landside (LS). Siphon breaker in 24-inch riser located on the waterside (WS) shoulder. Concrete "U" headwall and flap gate are located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.01), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

LM Start	<b>1.00</b>	Rating **	M	Issue No.	<b>204 (cont)</b>
LM End	<b>1.00</b>	Issue Type +	Ma	Location *	WS

Photo 1 of 3 : UCIP\_SP\_2017\_51637\_36772.jpg



Pipe visible under walkway at puming plant on LS toe.

Photo 2 of 3 : UCIP\_SP\_2017\_51637\_36771.jpg



Siphon breaker covered in soil at CMP riser on WS shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.00	Rating **	M	Issue No.	204 (cont)	
LM End	1.00	Issue Type +	Ma	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			37.478817 °	37.478817 °	
				-121.068773 °	-121.068773 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51637						
DS_ID:20219						
EP_NO: N/A						
Repair Type: Non-Urgent						
Crossing Status: Found						
UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to Non-Urgent a flap gate has been added to the WS. According to Tony Martinez, LMA representative, this crossing is currently not in use. Owner will need to coordinate with CVFPB to obtain permit. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned siphon breakers covered in soil and flapgate missing. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: *ABANDONED* 2 of 2: 16-inch steel drainage pipe through levee, 17 feet below crown. Pump on pump platform located on the landside (LS). Siphon breaker in 24-inch riser located on the waterside (WS) shoulder. Concrete "U" headwall and flap gate are located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.01), Drawing No. 7-4-1784].						
FS Date: 11/18/2016						

Photo 3 of 3 : UCIP\_SP\_2017\_51637\_36770.jpg



Concrete headwall on WS toe with missing flapgate.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.02	Rating **	U	Issue No.	205
LM End	1.02	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.478779 °	37.478779 °
				-121.068508 °	-121.068508 °
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51329  
DS\_ID:20218  
EP\_NO: N/A  
Repair Type: Urgent  
Crossing Status: Found  
UCIP Comments: 11/18/2016 Same as previous inspection headwall on the WS toe has separated from pipe and flap gate is still missing. Erosion around concrete headwall and undermined WS slope are visible from WS. The slope undermined appears to have progressed but no photos were taken due to the dense vegetation covering area. According to Tony Martinez, LMA representative, the WS concrete headwall has been detached since 2008/2009. LMA has been in contact with CVFPB, DWR, and USACE regarding this site. (O. Magana - DWR UCIP)10/01/2013 Headwall on WS toe separated from pipe. Erosion around concrete headwall and undermined at WS toe. Flap gate missing from WS toe headwall. (W. Wylie - DWR UCIP) FIELD\_STRUCT\_DESC: 30-inch square reinforced concrete box culvert through levee, 25.4 feet below crown. Concrete "U" headwalls on both waterside (WS) and landside (LS) ends. Slide gate in concrete surge box located on the WS slope. A 5-foot by 5-foot concrete box is located on LS toe. Flap gate is located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.02), Drawing No. 7-4-1784]. FS Date: 11/18/2016

LM Start	<b>1.02</b>	Rating **	U	Issue No.	<b>205 (cont)</b>
LM End	<b>1.02</b>	Issue Type +	Ma	Location *	WS

Photo 1 of 3 : UCIP\_SP\_2017\_51329\_36786.jpg



Grated inlet and 5'X5' concrete box on LS toe.

Photo 2 of 3 : UCIP\_SP\_2017\_51329\_36785.jpg



Grated inlet at LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.02	Rating **	U	Issue No.	205 (cont)	
LM End	1.02	Issue Type +	Ma	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			37.478779 °	37.478779 °	
				-121.068508 °	-121.068508 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51329 DS_ID:20218 EP_NO: N/A Repair Type: Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Same as previous inspection headwall on the WS toe has separated from pipe and flap gate is still missing. Erosion around concrete headwall and undermined WS slope are visible from WS. The slope undermined appears to have progressed but no photos were taken due to the dense vegetation covering area. According to Tony Martinez, LMA representative, the WS concrete headwall has been detached since 2008/2009. LMA has been in contact with CVFPB, DWR, and USACE regarding this site. (O. Magana - DWR UCIP)10/01/2013 Headwall on WS toe seperated from pipe. Erosion around concrete headwall and undermined at WS toe. Flap gate missing from WS toe headwall. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert through levee, 25.4 feet below crown. Concrete "U" headwalls on both waterside (WS) and landside (LS) ends. Slide gate in concrete surge box located on the WS slope. A 5-foot by 5-foot concrete box is located on LS toe. Flap gate is located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 1.02), Drawing No. 7-4-1784]. FS Date: 11/18/2016						

Photo 3 of 3 : UCIP\_SP\_2017\_51329\_36789.jpg



Slide gate in concrete riser next to shed on WS shoulder.

LM Start	1.05	Rating **	M	Issue No.	37
LM End	1.05	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			37.478567 °	37.478567 °
				-121.067847 °	-121.067847 °
DWR ID	DWR_RD1602_01_s_2012_37				
Comment Code					
S1 : Repair slope instability.					
Inspector Comment					
Small amount of slumping at waterside toe of the levee.					

Photo 1 of 2 : SP\_2017\_RD1602\_110\_37\_20170327\_00019.jpg



View of the depression at the waterside toe of the levee. The picture was taken from the crown of the levee looking upstream during fall 2011 inspection.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.05	Rating **	M	Issue No.	37 (cont)	
LM End	1.05	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Slope Stability			37.478567 °		37.478567 °
				-121.067847 °		-121.067847 °
DWR ID	DWR_RD1602_01_s_2012_37					
Comment Code						
S1 : Repair slope instability.						
Inspector Comment						
Small amount of slumping at waterside toe of the levee.						

Photo 2 of 2 : SP\_2017\_RD1602\_110\_37\_20170327\_00020.jpg



Depression at the waterside slope of the levee during Spring 2011 inspection.

LM Start	1.06	Rating **	C	Issue No.	23	
LM End	1.49	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			37.478525 °		37.478702 °
				-121.067700 °		-121.060421 °
DWR ID	DWR_RD1602_01_f_2016_23					
Comment Code						
V1 : Control annual grass and weeds on the levee slopes and easements.						
Inspector Comment						

No Photos

LM Start	1.11	Rating **	C	Issue No.	11
LM End	1.11	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.478371 °	37.478371 °
				-121.066793 °	-121.066793 °
DWR ID	DWR_RD1602_01_s_2013_11				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.14	Rating **	C	Issue No.	65
LM End	1.14	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.478285 °	37.478285 °
				-121.066299 °	-121.066299 °
DWR ID	DWR_RD1602_01_f_2012_65				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	1.51	Rating **	C	Issue No.	26
LM End	2.97	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.478610 °	37.464948 °
				-121.060253 °	-121.044393 °
DWR ID	DWR_RD1602_01_f_2016_26				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	1.60	Rating **	C	Issue No.	27
LM End	1.84	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.477843 °	37.474521 °
				-121.058875 °	-121.057945 °
DWR ID	DWR_RD1602_01_f_2016_27				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.61	Rating **	M	Issue No.	43
LM End	2.27	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.477663 °	37.470264 °
				-121.058716 °	-121.054377 °
DWR ID	DWR_RD1602_01_s_2012_43				
Comment Code					
FE : Fence					
Inspector Comment					
Fence at the landside toe of the levee.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_43\_20170327\_00024.jpg



View of the fence on the landside toe of the levee. The picture was taken from crown looking upstream.

LM Start	1.70	Rating **	M	Issue No.	55
LM End	1.70	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.476482 °	37.476482 °
				-121.058136 °	-121.058136 °
DWR ID	DWR_RD1602_01_s_2017_55				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_55\_20170410\_00093.jpg



View of a rodent hole on the waterside slope of the levee.

LM Start	1.88	Rating **	C	Issue No.	29
LM End	1.88	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.473961 °	37.473961 °
				-121.057936 °	-121.057936 °
DWR ID	DWR_RD1602_01_f_2016_29				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	1.89	Rating **	M	Issue No.	76
LM End	1.89	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			37.473718 °	37.473718 °
				-121.057926 °	-121.057926 °
DWR ID	DWR_RD1602_01_s_2017_76				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_76\_20170410\_00094.jpg



View of crown depression on the levee looking upstream.

LM Start	2.01	Rating **	M	Issue No.	78
LM End	2.22	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.472100 °	37.470129 °
				-121.057838 °	-121.055181 °
DWR ID	DWR_RD1602_01_s_2017_78				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_78\_20170410\_00095.jpg



View of the vegetation on the waterside of the levee.

LM Start	2.03	Rating **	M	Issue No.	45
LM End	2.03	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.471734 °	37.471734 °
				-121.057670 °	-121.057670 °
DWR ID	DWR_RD1602_01_s_2012_45				
Comment Code					
EQ : Equipment					
Inspector Comment					
A well is present at the toe of the landside of the slope.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_45\_20170327\_00025.jpg



A well is located at the landside toe of the levee. The picture was taken from the crown looking toward the landside of the levee.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.06	Rating **	C	Issue No.	33
LM End	2.37	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.471367 °	37.470468 °
				-121.057471 °	-121.052584 °
DWR ID	DWR_RD1602_01_f_2016_33				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.23	Rating **	M	Issue No.	59
LM End	3.30	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.470119 °	37.461147 °
				-121.055117 °	-121.041785 °
DWR ID	DWR_RD1602_01_s_2012_59				
Comment Code					
DT : Ditch					
Inspector Comment					
Concrete ditch was constructed before the levee was built.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_59\_20170327\_00032.jpg



Concrete drain was built at the toe of the levee. The picture was taken from the crown looking upstream.

LM Start	2.29	Rating **	M	Issue No.	79
LM End	2.29	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.470348 °	37.470348 °
				-121.053987 °	-121.053987 °
DWR ID	DWR_RD1602_01_s_2017_79				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.37	Rating **	A	Issue No.	80	
LM End	2.37	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Vegetation			37.470477 °		37.470477 °
				-121.052553 °		-121.052553 °
DWR ID	DWR_RD1602_01_s_2017_80					
Comment Code						
V1 : Control annual grass and weeds on the levee slopes and easements.						
Inspector Comment						
LMA cleared the vegetation on the landside slope of the levee.						

No Photos

LM Start	2.56	Rating **	M	Issue No.	81
LM End	2.56	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.469268 °	37.469268 °
				-121.049413 °	-121.049413 °
DWR ID	DWR_RD1602_01_s_2017_81				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_81\_20170410\_00096.jpg



View of a rodent hole on the waterside slope of the levee.

LM Start	2.56	Rating **	C	Issue No.	34
LM End	2.56	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.469250 °	37.469250 °
				-121.049415 °	-121.049415 °
DWR ID	DWR_RD1602_01_f_2016_34				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.65	Rating **	C	Issue No.	38
LM End	2.90	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.468381 °	37.465845 °
				-121.048324 °	-121.045159 °
DWR ID	DWR_RD1602_01_f_2016_38				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.67	Rating **	M	Issue No.	19
LM End	2.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.468212 °	37.468212 °
				-121.048096 °	-121.048096 °
DWR ID	DWR_RD1602_01_s_2016_19				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_19\_20170327\_00006.jpg



View of rodent holes on the waterside of the levee.

LM Start	2.73	Rating **	M	Issue No.	40
LM End	2.73	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.467507 °	37.467507 °
				-121.047245 °	-121.047245 °
DWR ID	DWR_RD1602_01_f_2016_40				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 2 : SP\_2017\_RD1602\_110\_40\_20170410\_00097.jpg



Updated picture of the rodent holes on the landside of the levee during spring 2017 inspection.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.73	Rating **	M	Issue No.	40 (cont)	
LM End	2.73	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Animal Control			37.467507 °		37.467507 °
				-121.047245 °		-121.047245 °
DWR ID	DWR_RD1602_01_f_2016_40					
Comment Code						
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.						
Inspector Comment						

Photo 2 of 2 : SP\_2017\_RD1602\_110\_40\_20170327\_00021.jpg



View of rodent hole on the landside of the levee. Fall 2016

LM Start	2.74	Rating **	M	Issue No.	82
LM End	2.74	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.467408 °	37.467408 °
				-121.047101 °	-121.047101 °
DWR ID	DWR_RD1602_01_s_2017_82				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_82\_20170410\_00098.jpg



View of rodent holes on the waterside slope of the levee. Spring 2017

LM Start	2.79	Rating **	M	Issue No.	41
LM End	2.79	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.466887 °	37.466887 °
				-121.046460 °	-121.046460 °
DWR ID	DWR_RD1602_01_f_2016_41				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_41\_20170327\_00022.jpg



View of rodent holes on the waterside slope of the levee. Fall 2016

\* Location  
LS : Land Side N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable N : Not Inspected/Rated  
M : Minimally Acceptable C : Corrected  
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.82	Rating **	M	Issue No.	44
LM End	2.82	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.466645 °	37.466645 °
				-121.046148 °	-121.046148 °
DWR ID	DWR_RD1602_01_f_2016_44				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	2.85	Rating **	M	Issue No.	46
LM End	2.85	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.466294 °	37.466294 °
				-121.045693 °	-121.045693 °
DWR ID	DWR_RD1602_01_f_2016_46				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	2.86	Rating **	M	Issue No.	47
LM End	2.86	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.466166 °	37.466166 °
				-121.045527 °	-121.045527 °
DWR ID	DWR_RD1602_01_f_2016_47				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_47\_20170327\_00026.jpg



View of rodent holes on the waterside of the levee. Fall 2016

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	2.89	Rating **	M	Issue No.	49
LM End	2.89	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.465898 °	37.465898 °
				-121.045209 °	-121.045209 °
DWR ID	DWR_RD1602_01_f_2016_49				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_49\_20170410\_00099.jpg



View of rodent holes on the waterside slope of the levee. Spring 2017

LM Start	2.94	Rating **	M	Issue No.	51
LM End	2.94	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.465332 °	37.465332 °
				-121.044712 °	-121.044712 °
DWR ID	DWR_RD1602_01_f_2016_51				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	3.09	Rating **	C	Issue No.	52
LM End	3.09	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.463663 °	37.463663 °
				-121.042950 °	-121.042950 °
DWR ID	DWR_RD1602_01_f_2016_52				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.10	Rating **	M	Issue No.	24
LM End	3.10	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.463563 °	37.463563 °
				-121.042784 °	-121.042784 °
DWR ID	DWR_RD1602_01_s_2016_24				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_24\_20170327\_00010.jpg



View of rodent holes on the waterside of the levee looking upstream.

LM Start	3.16	Rating **	M	Issue No.	25
LM End	3.16	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.462947 °	37.462947 °
				-121.041967 °	-121.041967 °
DWR ID	DWR_RD1602_01_s_2016_25				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_25\_20170327\_00011.jpg



View of rodent holes on the waterside toe of the levee looking upstream.  
Fall 2016

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.27	Rating **	U	Issue No.	206
LM End	3.27	Issue Type +	En	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			37.461507 °	37.461507 °
				-121.041609 °	-121.041609 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51330 DS_ID:20204 EP_NO: 8193 Repair Type: Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Same as previous inspection riser cover and handle on slide gate are still missing. Crossing remains Urgent due to the pubic safety issue of the 60-inch CMP cover still missing. According to Tony Martinez, LMA representative, the condition and future use of this crossing is being evaluated. Owner will need to coordinate with CVFPB for future use requirements or proper abandonment/removal. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned, and if so should be done so properly. No handle on slide gate, no cover on CMP standpipe on WS shoulder. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 16-inch steel irrigation pipe through levee, 11.5 feet below crown. Slide gate in 60-inch corrugated metal pipe riser is located on the waterside (WS) slope. Pipe discharges into concrete-lined ditch on the landside (LS) (Permit No. 8193, 1964 - Sabatte). [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 0.58), Drawing No. 7-4-1784]. FS Date: 11/18/2016					

LM Start	<b>3.27</b>	Rating **	U	Issue No.	<b>206 (cont)</b>
LM End	<b>3.27</b>	Issue Type +	En	Location *	WS

Photo 1 of 3 : UCIP\_SP\_2017\_51330\_36805.jpg



Pipe visible in concrete channel on LS toe.

Photo 2 of 3 : UCIP\_SP\_2017\_51330\_36804.jpg



Slide gate in 60-inch CMP riser on WS shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.27	Rating **	U	Issue No.	206 (cont)	
LM End	3.27	Issue Type +	En	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP Field Study			37.461507 °	37.461507 °	
				-121.041609 °	-121.041609 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51330 DS_ID:20204 EP_NO: 8193 Repair Type: Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Same as previous inspection riser cover and handle on slide gate are still missing. Crossing remains Urgent due to the pubic safety issue of the 60-inch CMP cover still missing. According to Tony Martinez, LMA representative, the condition and future use of this crossing is being evaluated. Owner will need to coordinate with CVFPB for future use requirements or proper abandonment/removal. (O. Magana - DWR UCIP)10/01/2013 Appears abandoned, and if so should be done so properly. No handle on slide gate, no cover on CMP standpipe on WS shoulder. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 16-inch steel irrigation pipe through levee, 11.5 feet below crown. Slide gate in 60-inch corrugated metal pipe riser is located on the waterside (WS) slope. Pipe discharges into concrete-lined ditch on the landside (LS) (Permit No. 8193, 1964 - Sabatte). [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 0.58), Drawing No. 7-4-1784]. FS Date: 11/18/2016						

Photo 3 of 3 : UCIP\_SP\_2017\_51330\_76527.jpg



Overview of levee crown at pipe crossing.

LM Start	3.30	Rating **	M	Issue No.	54
LM End	3.46	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.461147 °	37.459242 °
				-121.041785 °	-121.043582 °
DWR ID	DWR_RD1602_01_f_2013_54				
Comment Code					
DT : Ditch					
Inspector Comment					
Concrete lined ditch on the landside toe of the levee.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_54\_20170327\_00030.jpg



A concrete lined ditch was found on the landside toe of the levee looking upstream.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.30	Rating **	C	Issue No.	53
LM End	3.30	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.461103 °	37.461103 °
				-121.041820 °	-121.041820 °
DWR ID	DWR_RD1602_01_f_2016_53				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	3.32	Rating **	M	Issue No.	56
LM End	3.32	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.460811 °	37.460811 °
				-121.042078 °	-121.042078 °
DWR ID	DWR_RD1602_01_s_2017_56				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_56\_20170327\_00031.jpg



View of rodent holes on the landside of the levee. Fall 2016

LM Start	3.34	Rating **	M	Issue No.	50
LM End	3.53	Issue Type +	En	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.460644 °	37.458373 °
				-121.042231 °	-121.044081 °
DWR ID	DWR_RD1602_01_s_2012_50				
Comment Code					
DT : Ditch					
Inspector Comment					
A ditch is located on waterside toe of the levee.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_50\_20170327\_00028.jpg



A ditch was located on the waterside toe of the levee. The picture was taken from the crown looking upstream.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.34	Rating **	C	Issue No.	57
LM End	3.43	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.460644 °	37.459573 °
				-121.042239 °	-121.043275 °
DWR ID	DWR_RD1602_01_f_2016_57				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

LM Start	3.62	Rating **	C	Issue No.	58
LM End	3.62	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.457110 °	37.457110 °
				-121.044705 °	-121.044705 °
DWR ID	DWR_RD1602_01_f_2016_58				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	3.63	Rating **	M	Issue No.	60
LM End	3.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.456943 °	37.456943 °
				-121.044718 °	-121.044718 °
DWR ID	DWR_RD1602_01_f_2016_60				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_60\_20170327\_00033.jpg



View of rodent hole on the landside toe of the levee. Fall 2016

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.66	Rating **	C	Issue No.	68
LM End	3.66	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.456593 °	37.456593 °
				-121.044654 °	-121.044654 °
DWR ID	DWR_RD1602_01_f_2016_68				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	3.76	Rating **	M	Issue No.	83
LM End	3.76	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.455414 °	37.455414 °
				-121.043765 °	-121.043765 °
DWR ID	DWR_RD1602_01_s_2017_83				
Comment Code					
TR : Tree or limb					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_83\_20170410\_00100.jpg



View of a tree trunk on the waterside slope of the levee.

LM Start	3.82	Rating **	M	Issue No.	42
LM End	3.82	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.454574 °	37.454574 °
				-121.043142 °	-121.043142 °
DWR ID	DWR_RD1602_01_s_2012_42				
Comment Code					
V6 : Landscaping					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_42\_20170327\_00023.jpg



Remove landscaping from within 10' of landside toe.

* Location LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance  
Levee Inspections**

## Levee Inspection Report By Mile - Spring 2017

### Reclamation District No. 1602 Del Puerto

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>3.86</b>	Rating **	U	Issue No.	<b>207</b>
LM End	<b>3.86</b>	Issue Type +	En	Location *	LS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		37.454097 °	37.454097 °	
			-121.042810 °	-121.042810 °	
DWR ID					

#### Comment Code

#### Inspector Comment

FS\_ID:51331  
DS\_ID:20206  
EP\_NO: 7796  
Repair Type: Urgent  
Crossing Status: Indicator Found  
UCIP Comments: 11/18/2016 Same as previous inspection crossing is missing markers visible from levee crown. PG&E completed some construction work on this line from September - November 3rd, 2016 and installed a marker on WS approximately 341 feet from levee crown. UCIP inspector will need to contact Mr. Chris Williams, Associate Construction Specialist, Gas Construction Management Central Valley Region with PG&E at 1-209-272-2811 to determine extent of inspection through levee. (O. Magana - DWR UCIP)10/01/2013 Gasline needs sign markers at levee. (W. Wylie - DWR UCIP)  
FIELD\_STRUCT\_DESC: 12.75-inch gas line crossing through levee, 3 feet below crown. Gas line is near Prune Avenue and Paradise Avenue. For emergencies call PG&E at 1-800-811-4111. (12.75-inch line authorized under Permit No. 7796, 1972 - Pacific Gas and Electric Company [PG&E], related permits include Permit No. 7796-A issued to amend plans to allow installing gas line under river by boring method, and Permit No. 7796-B issued to modify condition no. 18 by allowing work before July 20, 1972) [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 3.90), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

LM Start	<b>3.86</b>	Rating **	U	Issue No.	<b>207 (cont)</b>
LM End	<b>3.86</b>	Issue Type +	En	Location *	LS

Photo 1 of 3 : UCIP\_SP\_2017\_51331\_76534.jpg



Overview of levee crown at pipe crossing.

Photo 2 of 3 : UCIP\_SP\_2017\_51331\_76535.jpg



View of LS.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
N/A : Not Applicable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance  
Levee Inspections**

## Levee Inspection Report By Mile - Spring 2017

### Reclamation District No. 1602 Del Puerto

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.86	Rating **	U	Issue No.	207 (cont)
LM End	3.86	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			37.454097 °	37.454097 °
				-121.042810 °	-121.042810 °
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51331  
DS\_ID:20206  
EP\_NO: 7796  
Repair Type: Urgent  
Crossing Status: Indicator Found  
UCIP Comments: 11/18/2016 Same as previous inspection crossing is missing markers visible from levee crown. PG&E completed some construction work on this line from September - November 3rd, 2016 and installed a marker on WS approximately 341 feet from levee crown. UCIP inspector will need to contact Mr. Chris Williams, Associate Construction Specialist, Gas Construction Management Central Valley Region with PG&E at 1-209-272-2811 to determine extent of inspection through levee. (O. Magana - DWR UCIP)10/01/2013 Gasline needs sign markers at levee. (W. Wylie - DWR UCIP)  
FIELD\_STRUCT\_DESC: 12.75-inch gas line crossing through levee, 3 feet below crown. Gas line is near Prune Avenue and Paradise Avenue. For emergencies call PG&E at 1-800-811-4111. (12.75-inch line authorized under Permit No. 7796, 1972 - Pacific Gas and Electric Company [PG&E], related permits include Permit No. 7796-A issued to amend plans to allow installing gas line under river by boring method, and Permit No. 7796-B issued to modify condition no. 18 by allowing work before July 20, 1972) [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 3.90), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

Photo 3 of 3 : UCIP\_SP\_2017\_51331\_76536.jpg



PVC riser with yellow cover located along fence on LS.

LM Start	3.87	Rating **	M	Issue No.	66
LM End	3.92	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.453936 °	37.453309 °
				-121.042673 °	-121.042191 °
DWR ID	DWR RD1602 01 f 2013 66				

**Comment Code**

FE : Fence

**Inspector Comment**

Photo 1 of 1 : SP\_2017\_RD1602\_110\_66\_20170327\_00040.jpg



Fences were found on the landside toe of the levee looking upstream.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.90	Rating **	M	Issue No.	84
LM End	3.90	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.453566 °	37.453566 °
				-121.042376 °	-121.042376 °
DWR ID	DWR_RD1602_01_s_2017_84				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	3.93	Rating **	M	Issue No.	62
LM End	3.93	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			37.453216 °	37.453216 °
				-121.042127 °	-121.042127 °
DWR ID	DWR_RD1602_01_s_2012_62				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Significant damage to USACE constructed seepage berm due to human activity.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_62\_20170327\_00035.jpg



Repair damage to USACE constructed seepage berm by pedestrian and cycle traffic.

LM Start	3.94	Rating **	M	Issue No.	63
LM End	4.04	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.452983 °	37.451866 °
				-121.042301 °	-121.041206 °
DWR ID	DWR_RD1602_01_s_2012_63				
Comment Code					
FE : Fence					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_63\_20170327\_00036.jpg



View of a barbed wire fence on the landward slope looking upstream.

\* Location  
LS : Land Side N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable N : Not Inspected/Rated  
M : Minimally Acceptable C : Corrected  
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	3.96	Rating **	M	Issue No.	85
LM End	3.96	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			37.452931 °	37.452931 °
				-121.041863 °	-121.041863 °
DWR ID	DWR_RD1602_01_s_2017_85				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					

No Photos

LM Start	3.98	Rating **	M	Issue No.	69
LM End	3.98	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.452640 °	37.452640 °
				-121.041646 °	-121.041646 °
DWR ID	DWR_RD1602_01_f_2016_69				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	4.05	Rating **	A	Issue No.	86
LM End	4.05	Issue Type +	Ob	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Seepage / Sandboils			37.451803 °	37.451803 °
				-121.041065 °	-121.041065 °
DWR ID	DWR_RD1602_01_s_2017_86				
Comment Code					
Inspector Comment					
LMA placed sack ring around the sand boils.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_86\_20170410\_00101.jpg



View of sack rings on the landside toe of the levee. Spring 2017

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                  A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	4.21	Rating **	A	Issue No.	87
LM End	4.21	Issue Type +	Ob	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Seepage / Sandboils			37.449953 °	37.449953 °
				-121.039167 °	-121.039167 °
DWR ID	DWR_RD1602_01_s_2017_87				
Comment Code					
Inspector Comment					
LMA placed sack rings on the toe of the levee.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_87\_20170410\_00102.jpg



View of a sack ring on the landside toe of the levee looking upstream.  
Spring 2017

LM Start	4.24	Rating **	M	Issue No.	71
LM End	4.24	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.449608 °	37.449608 °
				-121.038968 °	-121.038968 °
DWR ID	DWR_RD1602_01_f_2016_71				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	4.35	Rating **	M	Issue No.	88	
LM End	4.35	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Animal Control			37.448170 °		37.448170 °
				-121.038072 °		-121.038072 °
DWR ID	DWR_RD1602_01_s_2017_88					
Comment Code						
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.						
Inspector Comment						

Photo 1 of 1 : SP\_2017\_RD1602\_110\_88\_20170410\_00103.jpg



View of a rodent hole on the waterside slope of the levee.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain			

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	4.40	Rating **	A/W	Issue No.	89
LM End	4.40	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			37.447433 °	37.447433 °
				-121.037639 °	-121.037639 °
DWR ID	DWR_RD1602_01_s_2017_89				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
LMA placed wavewash (400 ft) on the waterside slope of the levee.					

Photo 1 of 2 : SP\_2017\_RD1602\_110\_89\_20170410\_00104.jpg



View of wave wash installed by the LMA on the waterside toe of the levee. Spring 2017

LM Start	<b>4.40</b>	Rating **	A/W	Issue No.	<b>89 (cont)</b>
LM End	<b>4.40</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP\_2017\_RD1602\_110\_89\_20170410\_00105.jpg



Another view of wave wash installed by the LMA on the waterside toe of the levee. Spring 2017

LM Start	4.42	Rating **	M	Issue No.	67
LM End	4.88	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.447213 °	37.441014 °
				-121.037665 °	-121.036932 °
DWR ID	DWR_RD1602_01_s_2012_67				
Comment Code					
FE : Fence					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_67\_20170327\_00041.jpg



View of the fence on the landside toe of the levee. The picture was taken from the crown looking upstream.

\* Location  
LS : Land Side N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable N : Not Inspected/Rated  
M : Minimally Acceptable C : Corrected  
U : Unacceptable A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>4.47</b>	Rating **	M	Issue No.	<b>208</b>
LM End	<b>4.47</b>	Issue Type +	En	Location *	LS
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		37.446545 °	37.446545 °	
			-121.037941 °	-121.037941 °	
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51332  
DS\_ID:20207  
EP\_NO: 8195  
Repair Type: Non-Urgent  
Crossing Status: Found  
UCIP Comments: 11/18/2016 60-inch riser has a temporary cover therefore crossing has been downgraded from Urgent to Non-Urgent. (O. Magana - DWR UCIP) 10/01/2013 Lid missing from 60-inch CMP riser, may be an attractive nuisance or hazard to public. (W. Wylie - DWR UCIP)  
FIELD\_STRUCT\_DESC: 18-inch steel pipe through levee, 10 feet below crown. Slide gate in 60-inch corrugated metal pipe riser located on the waterside (WS) slope. Concrete discharge box is located on landside (LS) end. Pipe is buried across WS berm to pump located on the riverbank approximately 1,000 feet from the levee. (18-inch pipe authorized under Permit No. 8195, 1972 - Buehner). [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 4.51), Drawing No. 7-4-1784].  
FS Date: 11/18/2016

LM Start	<b>4.47</b>	Rating **	M	Issue No.	<b>208 (cont)</b>
LM End	<b>4.47</b>	Issue Type +	En	Location *	LS

Photo 1 of 3 : UCIP\_SP\_2017\_51332\_36819.jpg



Slide gate in CMP riser on WS slope.

Photo 2 of 3 : UCIP\_SP\_2017\_51332\_36818.jpg



Slide gate in CMP riser on WS slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	4.47	Rating **	M	Issue No.	208 (cont)	
LM End	4.47	Issue Type +	En	Location *	LS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP Field Study			37.446545 °	37.446545 °	
				-121.037941 °	-121.037941 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51332 DS_ID:20207 EP_NO: 8195 Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: 11/18/2016 60-inch riser has a temporary cover therefore crossing has been downgraded from Urgent to Non-Urgent. (O. Magana - DWR UCIP) 10/01/2013 Lid missing from 60-inch CMP riser, may be an attractive nuisance or hazard to public. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 18-inch steel pipe through levee, 10 feet below crown. Slide gate in 60-inch corrugated metal pipe riser located on the waterside (WS) slope. Concrete discharge box is located on landside (LS) end. Pipe is buried across WS berm to pump located on the riverbank approximately 1,000 feet from the levee. (18-inch pipe authorized under Permit No. 8195, 1972 - Buehner). [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 4.51), Drawing No. 7-4-1784]. FS Date: 11/18/2016						

Photo 3 of 3 : UCIP\_SP\_2017\_51332\_36817.jpg



Concrete ditch at outlet from pipe on LS toe.

LM Start	4.47	Rating **	M	Issue No.	64
LM End	4.63	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.446485 °	37.444290 °
				-121.038037 °	-121.037953 °
DWR ID	DWR_RD1602_01_s_2012_64				
Comment Code					
DT : Ditch					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_64\_20170327\_00037.jpg



View of a ditch on the landside toe of the levee looking upstream.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	4.48	Rating **	M	Issue No.	90
LM End	4.48	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.446413 °	37.446413 °
				-121.037888 °	-121.037888 °
DWR ID	DWR_RD1602_01_s_2017_90				
Comment Code					
PR : Prunings					
Inspector Comment					

No Photos

LM Start	4.52	Rating **	M	Issue No.	35
LM End	4.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.445785 °	37.445785 °
				-121.037774 °	-121.037774 °
DWR ID	DWR_RD1602_01_s_2016_35				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_35\_20170327\_00017.jpg



View of an animal hole on the waterside shoulder of the levee looking downstream.

LM Start	4.55	Rating **	M	Issue No.	91	
LM End	4.55	Issue Type +	Ma	Location *	WS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start		End
Item	Animal Control			37.445402 °		37.445402 °
				-121.037706 °		-121.037706 °
DWR ID	DWR_RD1602_01_s_2017_91					
Comment Code						
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.						
Inspector Comment						

Photo 1 of 1 : SP\_2017\_RD1602\_110\_91\_20170410\_00106.jpg



View of rodent holes on the waterside of the levee looking downstream. Spring 2017

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	4.77	Rating **	M	Issue No.	74
LM End	4.77	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.442465 °	37.442465 °
				-121.036947 °	-121.036947 °
DWR ID	DWR_RD1602_01_s_2015_74				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_74\_20170327\_00044.jpg



View of a rodent hole on the waterside toe of the levee.

LM Start	4.86	Rating **	M	Issue No.	72
LM End	5.23	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.441265 °	37.436208 °
				-121.036779 °	-121.036128 °
DWR ID	DWR_RD1602_01_f_2016_72				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	4.86	Rating **	M	Issue No.	73
LM End	5.23	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.441264 °	37.436208 °
				-121.036779 °	-121.036128 °
DWR ID	DWR_RD1602_01_f_2016_73				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_73\_20170327\_00043.jpg



View of vegetation on the landside slope of the levee. Fall 2016

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.09	Rating **	M	Issue No.	199
LM End	5.09	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.438165 °	37.438165 °
				-121.037073 °	-121.037073 °
DWR ID	DWR_RD1602_01_s_2014_199				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_199\_20170327\_00046.jpg



Rodent holes were found on the waterside toe of the levee looking upstream.

LM Start	5.13	Rating **	M	Issue No.	92
LM End	5.13	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.437527 °	37.437527 °
				-121.036967 °	-121.036967 °
DWR ID	DWR_RD1602_01_s_2017_92				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_92\_20170410\_00107.jpg



View of a rodent hole on the waterside shoulder of the levee looking downstream.

LM Start	5.18	Rating **	U	Issue No.	48
LM End	5.18	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			37.436785 °	37.436785 °
				-121.036593 °	-121.036593 °
DWR ID	DWR_RD1602_01_s_2016_48				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent holes possibly worsen by dogs.					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_48\_20170327\_00027.jpg



View of rodent holes on the waterside of the levee looking downstream.

**\* Location**

LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**

A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**

Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	<b>5.19</b>	Rating **	M	Issue No.	<b>209</b>
LM End	<b>5.19</b>	Issue Type +	Ma	Location *	WS
Category	Supplemental	GPS Latitude/Longitude			
		Start		End	
Item	DWR UCIP LMA Responsibility	37.436748 °		37.436748 °	
		-121.036597 °		-121.036597 °	
DWR ID					

**Comment Code**

**Inspector Comment**

FS\_ID:51336

DS\_ID:20208

EP\_NO: N/A

Repair Type: Non-Urgent

Crossing Status: Found

UCIP Comments: 11/18/2016 Same as previous inspection soil and debris prevent flap gate from properly functioning and slide gate won't close due to sediment build up. Crossing has been downgraded from Urgent to Non-Urgent due to no pipe or levee integrity issues observed during the site visit. Need to contact owner to determine status of crossing. If crossing is no longer in use owner will need to coordinate with CVFPB to properly abandon or remove according to Title 23 requirements. (O. Magana - DWR UCIP)10/01/2013 Soil and debris prevent flapgate from proper function. Slide gate won't close completely due to sediment buildup. CMP riser needs cover. (W. Wylie - DWR UCIP)

FIELD\_STRUCT\_DESC: 24-inch steel pipe through levee, 11.6 feet below crown. Concrete headwall on the landside (LS) end. Concrete "U" headwall and flap gate located on the waterside (WS) end. Slide gate in 60-inch corrugated metal pipe (CMP) riser is located on the WS slope. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 5.23), Drawing No. 7-4-1784].

FS Date: 11/18/2016

LM Start	<b>5.19</b>	Rating **	M	Issue No.	<b>209 (cont)</b>
LM End	<b>5.19</b>	Issue Type +	Ma	Location *	WS

Photo 1 of 3 : UCIP\_SP\_2017\_51336\_36822.jpg



Slide gate in CMP riser on WS slope. Outlet visible under tree in background.

Photo 2 of 3 : UCIP\_SP\_2017\_51336\_36821.jpg



Flapgate in Concrete headwall on WS toe under tree.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.19	Rating **	M	Issue No.	209 (cont)	
LM End	5.19	Issue Type +	Ma	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start		End
Item	DWR UCIP LMA Responsibility			37.436748 °	37.436748 °	
				-121.036597 °	-121.036597 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:51336 DS_ID:20208 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Same as previous inspection soil and debris prevent flap gate from properly functioning and slide gate won't close due to sediment build up. Crossing has been downgraded from Urgent to Non-Urgent due to no pipe or levee integrity issues observed during the site visit. Need to contact owner to determine status of crossing. If crossing is no longer in use owner will need to coordinate with CVFPB to properly abandon or remove according to Title 23 requirements. (O. Magana - DWR UCIP)10/01/2013 Soil and debris prevent flapgate from proper function. Slide gate won't close completely due to sediment buildup. CMP riser needs cover. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 24-inch steel pipe through levee, 11.6 feet below crown. Concrete headwall on the landside (LS) end. Concrete "U" headwall and flap gate located on the waterside (WS) end. Slide gate in 60-inch corrugated metal pipe (CMP) riser is located on the WS slope. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 5.23), Drawing No. 7-4-1784]. FS Date: 11/18/2016						

Photo 3 of 3 : UCIP\_SP\_2017\_51336\_36820.jpg



Concrete headwall at inlet on LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.23	Rating **	A/W	Issue No.	210
LM End	5.23	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.436246 °	37.436246 °
				-121.036193 °	-121.036193 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21665 DS_ID:20209 EP_NO: 8192 Repair Type: No Action Needed Crossing Status: Found UCIP Comments: FIELD_STRUCT_DESC: 1 of 2: 36-inch square reinforced concrete box culvert through levee 15.8 feet below crown. Slide gate in 6'X7'concrete surge boxe on the waterward slope. 36-inch concrete pipes are buried on both sides of the levee and connected to the reinforced concrete box culvert. Constructed through the levee section (ABO No. 8192, 1972). Originally included in 1964 O&M manual. FS Date: 10/1/2013					

Photo 1 of 2 : UCIP\_SP\_2017\_21665\_36829.jpg



Shed with slide gate in Concrete riser on WS shoulder.

LM Start	<b>5.23</b>	Rating **	A/W	Issue No.	<b>210 (cont)</b>
LM End	<b>5.23</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : UCIP\_SP\_2017\_21665\_36828.jpg



Likely risers for pipe off LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable  N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.23	Rating **	A/W	Issue No.	211
LM End	5.23	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.436227 °	37.436227 °
				-121.036169 °	-121.036169 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21668					
DS_ID:20222					
EP_NO: 8192					
Repair Type: No Action Needed					
Crossing Status: Found					
UCIP Comments:					
FIELD_STRUCT_DESC: 2 of 2: 36-inch square reinforced concrete box culvert through levee 15.8 feet below crown. Slide gate in 6'X7' concrete surge boxe on the waterward slope. 36-inch concrete pipes are buried on both sides of the levee and connected to the R.C.B.C. Constructed through the levee section (ABO No. 8192, 1972). Originally included in 1964 O&M manual.					
FS Date: 10/1/2013					

Photo 1 of 2 : UCIP\_SP\_2017\_21668\_36835.jpg



Slide gate in Concrete vault on WS shoulder.

LM Start	<b>5.23</b>	Rating **	A/W	Issue No.	<b>211 (cont)</b>
LM End	<b>5.23</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : UCIP\_SP\_2017\_21668\_36834.jpg



Possible concrete risers for pipe off LS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.24	Rating **	A/W	Issue No.	212
LM End	5.24	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.436129 °	37.436129 °
				-121.036065 °	-121.036065 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21672					
DS_ID:20210					
EP_NO: N/A					
Repair Type: No Action Needed					
Crossing Status: Found					
UCIP Comments:					
FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert through levee 12.9 feet below crown. Slide gate in concrete surge box on the waterward slope. Concrete discharge boxes on both ends. Originally included in 1964 O&M manual.					
FS Date: 10/1/2013					

Photo 1 of 3 : UCIP\_SP\_2017\_21672\_36848.jpg



Slidegate in concrete riser on WS shoulder.

LM Start	<b>5.24</b>	Rating **	A/W	Issue No.	<b>212 (cont)</b>
LM End	<b>5.24</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : UCIP\_SP\_2017\_21672\_36847.jpg



Concrete outlet on WS toe.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.24	Rating **	A/W	Issue No.	212 (cont)	
LM End	5.24	Issue Type +	Ma	Location *	WS	
Category	Supplemental			GPS Latitude/Longitude		
				Start	End	
Item	DWR UCIP LMA Responsibility			37.436129 °	37.436129 °	
				-121.036065 °	-121.036065 °	
DWR ID						
Comment Code						
Inspector Comment						
FS_ID:21672						
DS_ID:20210						
EP_NO: N/A						
Repair Type: No Action Needed						
Crossing Status: Found						
UCIP Comments:						
FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert						
through levee 12.9 feet below crown. Slide gate in concrete surge box						
on the waterward slope. Concrete discharge boxes on both ends.						
Originally included in 1964 O&M manual.						
FS Date: 10/1/2013						

Photo 3 of 3 : UCIP\_SP\_2017\_21672\_36846.jpg



Concrete inlet on LS toe.

LM Start	5.29	Rating **	M	Issue No.	75
LM End	6.22	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.435555 °	37.429165 °
				-121.035362 °	-121.029682 °
DWR ID	DWR_RD1602_01_s_2012_75				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_75\_20170327\_00045.jpg



Vegetation was found on the waterside slope of the levee looking upstream during fall 2016 inspection.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.35	Rating **	M	Issue No.	61
LM End	6.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			37.434732 °	37.429165 °
				-121.035088 °	-121.029682 °
DWR ID	DWR_RD1602_01_s_2012_61				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_61\_20170327\_00034.jpg



Vegetation was obstructing the view of the landside of the levee.

LM Start	5.38	Rating **	M	Issue No.	22
LM End	5.44	Issue Type +	En	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			37.434447 °	37.433791 °
				-121.034865 °	-121.034000 °
DWR ID	DWR_RD1602_01_f_2012_22				
Comment Code					
FE : Fence					
Inspector Comment					

Photo 1 of 1 : SP\_2017\_RD1602\_110\_22\_20170327\_00008.jpg



A fence was found on the landside toe of the levee looking upstream.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---



**Flood Control Project Maintenance  
Levee Inspections**

## Levee Inspection Report By Mile - Spring 2017

### Reclamation District No. 1602 Del Puerto

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	5.46	Rating **	M	Issue No.	213
LM End	5.46	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.433646 °	37.433646 °
				-121.033846 °	-121.033846 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21674					
DS_ID:20211					
EP_NO: N/A					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Pipe appears abandoned and if so should be done so properly.					
FIELD_STRUCT_DESC: *ABANDONED* 12-inch drain pipe through levee 6.9 feet below c own. Flap gate on the waterward end. (Maint. 1602) (could not locate 3/84) Originally included in 1964 O&M manual.					
FS Date: 10/1/2013					

Photo 1 of 1 : UCIP\_SP\_2017\_21674\_36854.jpg



Pipe and flapgate visible on WS toe.

LM Start	5.72	Rating **	M	Issue No.	214
LM End	5.72	Issue Type +	Ma	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			37.433003 °	37.433003 °
				-121.029346 °	-121.029346 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:51337 DS_ID:20212 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Found UCIP Comments: 11/18/2016 Crossing has been downgraded from Urgent to Non-Urgent flap gate is functional. Recommend clearing dense vegetation from WS and LS slopes. (O. Magana - DWR UCIP)10/01/2013 Flapgate has minor blockage preventing gate from fully closing. (W. Wylie - DWR UCIP) FIELD_STRUCT_DESC: 30-inch square reinforced concrete box culvert through levee, 9 feet below crown. Slide gate in concrete surge box is located on the waterside (WS) slope. Concrete "U" headwalls are located on both the waterside (WS) and landside (LS) ends. Flap gate is located on the WS end. [Additional Reference(s): DWR Levee Log, 1992. USACE San Joaquin River O&M Manual Unit 13, April 1964, (HLM 5.28), Drawing No. 7-4-1784]. FS Date: 11/18/2016					

Photo 1 of 3 : UCIP\_SP\_2017\_51337\_36878.jpg



Slide gate in concrete riser on WS shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---





**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	6.24	Rating **	M	Issue No.	215
LM End	6.24	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			37.429032 °	37.429032 °
				-121.029867 °	-121.029867 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21683					
DS_ID:20214					
EP_NO: 8194					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Pipe heavily deteriorated on LS toe. May indicate condition of rest of pipe is bad. Good candidate for video inspection.					
FIELD_STRUCT_DESC: 18-inch concrete pipe through levee 3.0 feet below crown (Permit No. 8194 1972). Slide gate inside 36-inch concrete standpipe on WS shoulder. Originally included in 1964 O&M manual.					
FS Date: 10/1/2013					

Photo 1 of 3 : UCIP\_SP\_2017\_21683\_36882.jpg



Drainage/irrigation canal on LS toe.

LM Start	<b>6.24</b>	Rating **	M	Issue No.	<b>215 (cont)</b>
LM End	<b>6.24</b>	Issue Type +	En	Location *	LS

Photo 2 of 3 : UCIP\_SP\_2017\_21683\_36881.jpg



36-inch concrete standpipe on WS shoulder.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown		<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2017**

**Reclamation District No. 1602 Del Puerto**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 San Joaquin River	Left	6.24	04/06/2017 04/06/2017	Pavel Kazi

LM Start	6.24	Rating **	M	Issue No.	215 (cont)
LM End	6.24	Issue Type +	En	Location *	LS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			37.429032 °	37.429032 °
				-121.029867 °	-121.029867 °
DWR ID					
Comment Code					
Inspector Comment					
FS_ID:21683					
DS_ID:20214					
EP_NO: 8194					
Repair Type: Non-Urgent					
Crossing Status: Found					
UCIP Comments: Pipe heavily deteriorated on LS toe. May indicate condition of rest of pipe is bad. Good candidate for video inspection.					
FIELD_STRUCT_DESC: 18-inch concrete pipe through levee 3.0 feet below crown (Permit No. 8194 1972). Slide gate inside 36-inch concrete standpipe on WS shoulder. Originally included in 1964 O&M manual.					
FS Date: 10/1/2013					

Photo 3 of 3 : UCIP\_SP\_2017\_21683\_36880.jpg



Pipe deteriorated on LS at outlet.

\* Location  
 LS : Land Side    N/A : Not Applicable  
 WS : Water Side  
 CR : Crown

\*\* Rating  
 A : Acceptable  
 M : Minimally Acceptable  
 U : Unacceptable  
 N : Not Inspected/Rated  
 C : Corrected  
 A/W : Acceptable but Monitor & Maintain

+ Issue Type  
 Ma : Maintenance Deficiency  
 Ob : Design & System Obsolescence  
 En : Enforcement