

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Spring 2012 Levee Inspection Results

Reclamation District No. 2058 Pescadero

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

* **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2012 Levee Inspection Results

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles
Unit No. 01 Paradise Cut	Left	6.71

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	3/28/2012 - 3/28/2012			
DWR Inspector	Jim Eto			
Accompanied By	Greg Pombo			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway		Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut		Left	6.71	03/28/2012 03/28/2012	Jim Eto

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1			Earthen Levee	Operations & Maintenance Manuals	WS	A Ma		°	°	75
								DWR ID: DWR_RD2058_01_s_2012_75		
2			Earthen Levee	Emergency Supplies & Equipment	WS	A Ma		°	°	76
								DWR ID: DWR_RD2058_01_s_2012_76		
3			Earthen Levee	Flood Preparedness & Training	WS	A Ma	Inspector Comments: Written action plan was presented to me along with supporting documentation (phone list, contacts, etc.).	°	°	77
								DWR ID: DWR_RD2058_01_s_2012_77		
4	0.20	0.20	Earthen Levee	Trim / Thin Trees	CR	C Ma	T4 : Trim trees over roadway to at least 12 feet above ground level. Inspector Comments: Tree over roadway needs to be trimmed to allow 12' clearance underneath.	37.804038 ° -121.418855 °	37.804038 ° -121.418855 °	4
								DWR ID: DWR_RD2058_01_s_2012_4		
5	0.22	0.28	Earthen Levee	Vegetation	WS	C Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Vegetation growth is too high and needs to be cleared.	37.804238 ° -121.418598 °	37.804705 ° -121.417778 °	6
								DWR ID: DWR_RD2058_01_s_2012_6		
6	0.42	0.42	Earthen Levee	Vegetation	WS	M Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Thick vegetation at this point, needs to be removed.	37.803813 ° -121.415578 °	37.803813 ° -121.415578 °	8 Y
								DWR ID: DWR_RD2058_01_s_2012_8		
7	0.70	0.70	Earthen Levee	Encroachments	LS	C Ma	PI : Pipe	37.801887 ° -121.411328 °	37.801887 ° -121.411328 °	13
								DWR ID: DWR_RD2058_01_s_2012_13		
8	0.97	1.05	Earthen Levee	Trim / Thin Trees	WS	C Ma	T1 : Trim trees to at least five feet above ground level.	37.801378 ° -121.406636 °	37.801442 ° -121.405179 °	957
								DWR ID: DWR_RD2058_01_s_2012_957		
9	1.12	1.17	Earthen Levee	Trim / Thin Trees	WS	C Ma	T1 : Trim trees to at least five feet above ground level.	37.801687 ° -121.404178 °	37.801900 ° -121.403308 °	5
								DWR ID: DWR_RD2058_01_s_2012_5		
10	1.24	1.24	Earthen Levee	Encroachments	CRA/W	PI : Pipe Ma		37.802314 ° -121.401984 °	37.802314 ° -121.401984 °	22 Y
								DWR ID: DWR_RD2058_01_s_2012_22		
11	1.33	1.33	Earthen Levee	Trim / Thin Trees	CR	C Ma	T4 : Trim trees over roadway to at least 12 feet above ground level. Inspector Comments: Tree on waterside crown is hanging over roadway and needs to be trimmed up to 12'.	37.802712 ° -121.400340 °	37.802712 ° -121.400340 °	15
								DWR ID: DWR_RD2058_01_s_2012_15		
12	1.69	1.72	Earthen Levee	Vegetation	WS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS.	37.804158 ° -121.394169 °	37.804329 ° -121.393612 °	961
								DWR ID: DWR_RD2058_01_s_2012_961		

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
13	2.15	2.15	Supplemental	DWR Erosion Survey	WS	M Ma	Inspector Comments: 09/02/2011: Site was not visited due to the time limit.09/22/2010: No significant changes observed. Vegetation downstream, upstream and on the lower slope of the site have managed. These areas were also fenced off during the site visit, making it difficult for us to examine the condition of the lower slope. Possible leak or spill from the siphon breaker is creating notches along the slope and developing into a headward erosion. If the problem continues, it will erode the slope and fully expose the pipe to outside elements.07/23/2009: A possible leak or spill from a siphon breaker is eroding the slope and developing into a headward erosion; a portion of the buried pipe is exposed; the lower slope seems to be lined with chunks of concrete debris or other rock material. [2011 Site ID:RD2058U01RM1.78]	37.803769 ° -121.386341 °	37.803769 ° -121.386341 °	1 Y
DWR ID: DWR_RD2058_01_s_2012_1										
14	2.15	2.15	Earthen Levee	Encroachments	CRA/W	PI : Pipe Ma		37.803910 ° -121.386295 °	37.803910 ° -121.386295 °	23 Y
DWR ID: DWR_RD2058_01_s_2012_23										
15	2.42	2.42	Earthen Levee	Vegetation	LS A/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma	Inspector Comments: Elderberr growing on landside toe.	37.802782 ° -121.381413 °	37.802782 ° -121.381413 °	16 Y
DWR ID: DWR_RD2058_01_s_2012_16										
16	2.64	2.64	Earthen Levee	Vegetation	WSA/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma	Inspector Comments: Elderberry on water side slope.	37.801962 ° -121.377684 °	37.801962 ° -121.377684 °	63 Y
DWR ID: DWR_RD2058_01_s_2012_63										
17	2.66	2.66	Earthen Levee	Vegetation	WSA/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma		37.801876 ° -121.377291 °	37.801876 ° -121.377291 °	64
DWR ID: DWR_RD2058_01_s_2012_64										
18	2.67	2.67	Earthen Levee	Vegetation	WSA/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma		37.801823 ° -121.377068 °	37.801823 ° -121.377068 °	65
DWR ID: DWR_RD2058_01_s_2012_65										
19	2.76	2.76	Earthen Levee	Vegetation	WSA/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma		37.801497 ° -121.375586 °	37.801497 ° -121.375586 °	66
DWR ID: DWR_RD2058_01_s_2012_66										
20	2.89	2.89	Earthen Levee	Encroachments	WSA/W	PI : Pipe Ma		37.800894 ° -121.373135 °	37.800894 ° -121.373135 °	24 Y
DWR ID: DWR_RD2058_01_s_2012_24										
21	3.19	3.19	Earthen Levee	Trim / Thin Trees	WS	T1 : Trim trees to at least five feet above ground level. Ma		37.798877 ° -121.368653 °	37.798877 ° -121.368653 °	938
DWR ID: DWR_RD2058_01_s_2012_938										
22	3.41	3.41	Earthen Levee	Encroachments	CRA/W	PI : Pipe Ma	Inspector Comments: Drainage discharge.	37.796421 ° -121.366254 °	37.796421 ° -121.366254 °	27
DWR ID: DWR_RD2058_01_s_2012_27										
23	3.57	3.57	Earthen Levee	Vegetation	LS A/W	V4 : Elderberries are blocking visibility and flood fight capability. Ma		37.794396 ° -121.364944 °	37.794396 ° -121.364944 °	68
DWR ID: DWR_RD2058_01_s_2012_68										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway		Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut		Left	6.71	03/28/2012 03/28/2012	Jim Eto

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
24	3.76	3.76	Earthen Levee	Vegetation	WS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability. Inspector Comments: Flagged bushes obstructing visibility and access	37.791856 ° -121.363514 °	37.791856 ° -121.363514 °	974
DWR ID: DWR_RD2058_01_s_2012_974										
25	3.77	3.77	Earthen Levee	Vegetation	WS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability. Inspector Comments: Removal of this type of vegetation is currently prohibited by FWS.	37.791745 ° -121.363553 °	37.791745 ° -121.363553 °	939 Y
DWR ID: DWR_RD2058_01_s_2012_939										
26	3.79	5.49	Earthen Levee	Vegetation	LS	C Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Landside vegetation as not been addressed yet. Goats have been working up to this point.	37.791512 ° -121.363325 °	37.781497 ° -121.340385 °	19
DWR ID: DWR_RD2058_01_s_2012_19										
27	3.85	3.85	Earthen Levee	Vegetation	WSA/W	Ob	V8 : Environmental Requirements. Inspector Comments: Revegetation site.	37.790807 ° -121.362905 °	37.790807 ° -121.362905 °	20 Y
DWR ID: DWR_RD2058_01_s_2012_20										
28	4.01	4.01	Earthen Levee	Vegetation	LS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability. Inspector Comments: Elderberry on landside hinge point.	37.789128 ° -121.361042 °	37.789128 ° -121.361042 °	26 Y
DWR ID: DWR_RD2058_01_s_2012_26										
29	4.01	5.99	Earthen Levee	Vegetation	WS	C Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Waterside vegetation growth needs to be removed on top 20'.	37.789115 ° -121.361033 °	37.775817 ° -121.336097 °	28
DWR ID: DWR_RD2058_01_s_2012_28										
30	4.01	4.01	Earthen Levee	Vegetation	WSA/W	Ma	V4 : Elderberries are blocking visibility and flood fight capability.	37.789096 ° -121.360966 °	37.789096 ° -121.360966 °	69
DWR ID: DWR_RD2058_01_s_2012_69										
31	4.10	4.10	Earthen Levee	Trim / Thin Trees	LS	C Ma	T1 : Trim trees to at least five feet above ground level.	37.788730 ° -121.359537 °	37.788730 ° -121.359537 °	9
DWR ID: DWR_RD2058_01_s_2012_9										
32	4.36	4.36	Earthen Levee	Vegetation	WSA/W	Ma	V4 : Elderberries are blocking visibility and flood fight capability.	37.789794 ° -121.354883 °	37.789794 ° -121.354883 °	71
DWR ID: DWR_RD2058_01_s_2012_71										
33	4.46	4.46	Earthen Levee	Vegetation	LS	C Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Wild rose on levee slope completely blocks access and visibility. Removal of this type of vegetation is not allowed by FWS due to RBR habitat.	37.790000 ° -121.353140 °	37.790000 ° -121.353140 °	32
DWR ID: DWR_RD2058_01_s_2012_32										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
34	4.49	4.53	Supplemental	DWR Erosion Survey	WS	M Ma	Inspector Comments: 09/02/2011: This site was not visited due to the time limit.09/22/2010: No significant changes observed. Minor pocket erosions are lined at the lower bank. Two large Oak and Willow trees are on midslope and bench. The remaining bench was re-measured and found to be approximately 10 feet. There was no indication of active erosion on site during the site visit.08/05/2010: Recommended for annual assessment and monitoring of site during flood events, per CLRO.07/23/2009: No major change observed since last visit; site is a 200-ft. long near-vertical berm erosion; recommend annual assessment and monitoring of erosion site, per CLRO CES Evaluation 2008 Report; Site # is the same site previously reported as RM4.0,LM4.51; previously rated "U".09/10/2008: Two large trees (2-3' DBH) with partial roots exposed.2007: Visited site 03/13/2007. [2011 Site ID:RD2058U01RM3.97]	37.789810 ° -121.352490 °	37.789810 ° -121.352490 °	2 Y
DWR ID: DWR_RD2058_01_s_2012_2										
35	4.81	4.81	Earthen Levee	Trim / Thin Trees	WS	C Ma	T1 : Trim trees to at least five feet above ground level.	37.786005 ° -121.350508 °	37.786005 ° -121.350508 °	941
DWR ID: DWR_RD2058_01_s_2012_941										
36	4.87	4.87	Earthen Levee	Trim / Thin Trees	WS	C Ma	T1 : Trim trees to at least five feet above ground level.	37.785190 ° -121.350078 °	37.785190 ° -121.350078 °	11
DWR ID: DWR_RD2058_01_s_2012_11										
37	5.16	5.16	Earthen Levee	Encroachments	LS	U En	RA : Ramp Inspector Comments: New Ramp construction Connecting Dairy to levee. Construction of ramp results in a new pond on the landside of the levee. 2/21/2012, owner has said that he will contact the CVFPB to resolve this issue.	37.783102 ° -121.345682 °	37.783102 ° -121.345682 °	29 Y
DWR ID: DWR_RD2058_01_s_2012_29										
38	5.37	5.37	Earthen Levee	Encroachments	LS	U En	RA : Ramp Inspector Comments: Ramp constructed to dairy. Raised ramps, see issue 29 are creating new holding ponds for dairy at levee toe.	37.782268 ° -121.342257 °	37.782268 ° -121.342257 °	30 Y
DWR ID: DWR_RD2058_01_s_2012_30										
39	5.62	5.99	Earthen Levee	Vegetation	LS	C Ma	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Landside vegetation blocks visibility of the landside slope and toe.	37.779795 ° -121.339923 °	37.775818 ° -121.336092 °	31
DWR ID: DWR_RD2058_01_s_2012_31										
40	6.57	6.57	Earthen Levee	Encroachments	LS	C En	AD : Agricultural Ditch Inspector Comments: Ditch has been created to discourage trespassing, needs to be backfilled.	37.770188 ° -121.329665 °	37.770188 ° -121.329665 °	33
DWR ID: DWR_RD2058_01_s_2012_33										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	6
Start Levee Mile	0.42
End Levee Mile	0.42
Location	Water Side
Category	Earthen Levee
Item	Vegetation
11/08/2011 Thick brush in this area needs to be taken back to 20' from hinge point.	
jeto_s_20120309_216.jpg	



Levee Mile Report Line	10
Start Levee Mile	1.24
End Levee Mile	1.24
Location	Crown
Category	Earthen Levee
Item	Encroachments
Drainage discharge to Paradise Cut.	
jeto_s_20120309_221.jpg	



Levee Mile Report Line	13
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey
Downstream view of site. Note the fenced area	
jeto_s_20120309_206.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	13
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey

Direct view of siphon breaker.

jeto_s_20120309_207.jpg



Levee Mile Report Line	13
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey

Direct view of siphon breaker.

jeto_s_20120309_208.jpg



Levee Mile Report Line	13
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey

Notches created by water leaking/overflowing from the siphon breaker.

jeto_s_20120309_209.jpg



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	14
Start Levee Mile	2.15
End Levee Mile	2.15
Location	Crown
Category	Earthen Levee
Item	Encroachments
Drainage discharge to Paradise Cut.	
jeto_s_20120309_222.jpg	



Levee Mile Report Line	15
Start Levee Mile	2.42
End Levee Mile	2.42
Location	Land Side
Category	Earthen Levee
Item	Vegetation
03/28/2012 Large elderberry bush on landside slope.	
jeto_s_20120329_721.jpg	



Levee Mile Report Line	16
Start Levee Mile	2.64
End Levee Mile	2.64
Location	Water Side
Category	Earthen Levee
Item	Vegetation
03/28/2012 Large elderberry bush located on waterward slope.	
jeto_s_20120329_722.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	20
Start Levee Mile	2.89
End Levee Mile	2.89
Location	Water Side
Category	Earthen Levee
Item	Encroachments

Irrigation intake from Paradise Cut.

jeto_s_20120309_223.jpg



Levee Mile Report Line	25
Start Levee Mile	3.77
End Levee Mile	3.77
Location	Water Side
Category	Earthen Levee
Item	Vegetation

Tall brush on top 20' of waterside slope obstructs access and visibility.

jeto_s_20120309_233.jpg



Levee Mile Report Line	27
Start Levee Mile	3.85
End Levee Mile	3.85
Location	Water Side
Category	Earthen Levee
Item	Vegetation

11/08/2011 Revegetation site, cannot trim or cut vegetation in this area.

jeto_s_20120309_220.jpg



<p>* Location</p> <p>LS : Land Side WS : Water Side CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p> <p>N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain</p>	<p>+ Issue Type</p> <p>Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement</p>
---	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	28
Start Levee Mile	4.01
End Levee Mile	4.01
Location	Land Side
Category	Earthen Levee
Item	Vegetation
11/08/2011 thick stand of elderberry bushes in this area.	
jeto_s_20120309_224.jpg	



Levee Mile Report Line	34
Start Levee Mile	4.49
End Levee Mile	4.53
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey
Downstream view. Seasonal vegetation covering one of several pocket erosions lined along the bank.	
jeto_s_20120309_210.jpg	



Levee Mile Report Line	34
Start Levee Mile	4.49
End Levee Mile	4.53
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey
Upstream view of the base of 1 of 2 large Oake trees on site. No signs of scouring on the base.	
jeto_s_20120309_211.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	34
Start Levee Mile	4.49
End Levee Mile	4.53
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey
Upstream view of both Oak trees located on the bench.	
jeto_s_20120309_212.jpg	



Levee Mile Report Line	34
Start Levee Mile	4.49
End Levee Mile	4.53
Location	Water Side
Category	Supplemental
Item	DWR Erosion Survey
Upstream view of the waterside slope. Vegetation on the slope was recently sprayed.	
jeto_s_20120309_213.jpg	



Levee Mile Report Line	37
Start Levee Mile	5.16
End Levee Mile	5.16
Location	Land Side
Category	Earthen Levee
Item	Encroachments
11/08/2011 New ramp has been constructed by Dairy farmer connecting his barns to the levee.	
jeto_s_20120309_225.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2012

Reclamation District No. 2058 Pescadero

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Paradise Cut	Left	6.71	03/28/2012 03/28/2012	Jim Eto

Levee Mile Report Line	37
Start Levee Mile	5.16
End Levee Mile	5.16
Location	Land Side
Category	Earthen Levee
Item	Encroachments
11/08/2011 New ramp has been constructed by Dairy farmer connecting his barns to the levee.	
jeto_s_20120309_226.jpg	



Levee Mile Report Line	38
Start Levee Mile	5.37
End Levee Mile	5.37
Location	Land Side
Category	Earthen Levee
Item	Encroachments
11/08/2011 Photo shows existing middle ramp to the levee which has been raised.	
jeto_s_20120309_227.jpg	



Levee Mile Report Line	38
Start Levee Mile	5.37
End Levee Mile	5.37
Location	Land Side
Category	Earthen Levee
Item	Encroachments
11/08/2011 Photo shows view from the levee looking to the left of the middle ramp.	
jeto_s_20120309_228.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---