

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Spring 2020 Levee Inspection Results

Reclamation District No. 1600 Mull

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
† Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection
Reports may effect overall annual rating.

† **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2020 Levee Inspection Results

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles
Unit No. 01 Sacramento River	Right	10.46

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	4/8/2020 - 4/8/2020			
DWR Inspector	Zach Jojola			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start		Rating **	A	Issue No.	32
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Operations & Maintenance Manuals			o	
				o	
DWR ID	DWR_RD1600_01_s_2013_32				
Comment Code					
Inspector Comment					
RD 1600 has copies of the O&M manuals.					

No Photos

LM Start		Rating **	A	Issue No.	33
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Emergency Supplies & Equipment			o	
				o	
DWR ID	DWR_RD1600_01_s_2019_33				
Comment Code					
Inspector Comment					
RD 1600 maintains a stockpile of flood response material.					

No Photos

LM Start		Rating **	A	Issue No.	34
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Flood Preparedness & Training			o	
				o	
DWR ID	DWR_RD1600_01_s_2013_34				
Comment Code					
Inspector Comment					
RD 1600 has a written flood response plan and flood response training.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.10	Rating **	M	Issue No.	129
LM End	0.10	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.676467 °	38.676467 °	
			-121.631217 °	-121.631217 °	
DWR ID	DWR_RD1600_01_s_2020_129				
Comment Code					
BU : Building					
Inspector Comment					
Well pump house.					

Photo 1 of 1 : SP_2020_RD1600_191_129_20200228_00033.jpg



View of the building. Fall 2016.

LM Start	0.11	Rating **	A/W	Issue No.	1
LM End	0.11	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.676524 °	38.676524 °	
			-121.631243 °	-121.631243 °	
DWR ID	DWR_RD1600_01_f_2018_1				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Rills forming on overbuilt section of levee. Not within the prism. Recommend monitoring.					

No Photos

LM Start	0.11	Rating **	A/W	Issue No.	38
LM End	0.11	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.676524 °	38.676524 °	
			-121.631245 °	-121.631245 °	
DWR ID	DWR_RD1600_01_f_2018_38				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Vehicle ruts on the landside slope.					

Photo 1 of 1 : SP_2020_RD1600_191_38_20200228_00017.jpg



View of ruts on the landside slope. Fall 2018.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.11	Rating **	A/W	Issue No.	49
LM End	0.23	Issue Type +	Ob	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.676577 °	38.678131 °	
			-121.631290 °	-121.632324 °	
DWR ID	DWR_RD1600_01_s_2012_49				
Comment Code					
V8 : Environmental Requirements.					
Inspector Comment					

Photo 1 of 2 : SP_2020_RD1600_191_49_20200228_00022.jpg



Sign stating revegetation site. Spring 2016.

LM Start	0.11	Rating **	A/W	Issue No.	49 (cont)
LM End	0.23	Issue Type +	Ob	Location *	WS

Photo 2 of 2 : SP_2020_RD1600_191_49_20200228_00023.jpg



View of the revegetation site and fence on the waterward side of the levee looking upstream. Spring 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.13	Rating **	M	Issue No.	1203
LM End	0.13	Issue Type +	En	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		38.676802 °	38.676802 °	
			-121.631442 °	-121.631442 °	
DWR ID	21459				
Comment Code					
Inspector Comment					
DS_ID:21459 FS_ID:15087 EP_NO: 1929 Repair Type: Non-Urgent Crossing Status: Indicator Found UCIP Comments: Line should be located with carsonite signs on both sides of levee. FIELD_STRUCT_DESC: Telephone conduit of an unknown size or material through the levee, 3 feet below the crown. Telephone line at joint pole (JP) off the landside (LS) toe. (Permit No. 1929, 1954 - Pacific Telephone and Telegraph Company [PT&T]). [Additional Reference(s): DWR Levee Log, 1988]. FS Date: 6/18/2013					

Photo 1 of 1 : UCIP_SP_2020_15087_24812.jpg



Line visible on JP off LS toe. Likely this is the source of crossing.

LM Start	0.34	Rating **	C	Issue No.	27
LM End	0.37	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.679590 °	38.680014 °	
			-121.633125 °	-121.633341 °	
DWR ID	DWR_RD1600_01_f_2019_27				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.46	Rating **	C	Issue No.	42
LM End	0.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.681232 °	38.681232 °	
			-121.633757 °	-121.633757 °	
DWR ID	DWR_RD1600_01_f_2018_42				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					

No Photos

LM Start	0.52	Rating **	M	Issue No.	44
LM End	0.52	Issue Type +	En	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.682046 °	38.682046 °	
			-121.634064 °	-121.634064 °	
DWR ID	DWR_RD1600_01_s_2020_44				
Comment Code					
PO : Pole					
Inspector Comment					
Telephone pole over the levee crown.					

Photo 1 of 1 : SP_2020_RD1600_191_44_20200228_00020.jpg



View of telephone line over levee crown. Fall 2018.

LM Start	0.53	Rating **	M	Issue No.	133
LM End	0.53	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.682140 °	38.682140 °	
			-121.634083 °	-121.634083 °	
DWR ID	DWR_RD1600_01_f_2013_133				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					
There appears to be a footpath and settlement on landside slope over pipe crossing.					

Photo 1 of 1 : SP_2020_RD1600_191_133_20200228_00034.jpg



View of settlement and footpath on landside slope. Fall 2019.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.56	Rating **	C	Issue No.	24
LM End	0.66	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 USACE Erosion Survey			38.682707 °	38.684106 °
				-121.633830 °	-121.634219 °
DWR ID	DWR_RD1600_01_s_2020_24				
Comment Code					
Inspector Comment					
DWR Inspector Comment: Erosion repaired as of inspection date by USACE.					
2017 Site ID: SAC 71.3 R Status: Under Construction 2017 Field Notes: New erosion pocket and fresh toe erosion. Site is currently under construction. Site History: 2000 - Very cohesive vertical bank. 2003 - Some minor new erosion. 2006 - Some minor erosion in old pockets. 2009 - Minimal new erosion. 2011 - Multiple new erosion pockets and a few new tree popouts.					

No Photos

LM Start	0.56	Rating **	A/W	Issue No.	26
LM End	0.66	Issue Type +	Ob	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.682661 °	38.684099 °
				-121.634238 °	-121.634625 °
DWR ID	DWR_RD1600_01_s_2020_26				
Comment Code					
V8 : Environmental Requirements.					
Inspector Comment					
USACE, DWR, and RD 1600 revegetation site.					

Photo 1 of 2 : SP_2020_RD1600_191_26_20200409_00061.jpg



View of revegetation site on the waterside berm. Spring 2020.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.56	Rating **	A/W	Issue No.	26 (cont)
LM End	0.66	Issue Type +	Ob	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.682661 °	38.684099 °
				-121.634238 °	-121.634625 °
DWR ID	DWR_RD1600_01_s_2020_26				

Photo 2 of 2 : SP_2020_RD1600_191_26_20200409_00062.jpg



View of revegetation sign on the waterside berm. Spring 2020.

LM Start	0.69	Rating **	C	Issue No.	47
LM End	0.72	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.684411 °	38.684823 °
				-121.634686 °	-121.634771 °
DWR ID	DWR_RD1600_01_f_2018_47				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

LM Start	0.78	Rating **	N	Issue No.	624
LM End	0.78	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.685713 °	38.685713 °
				-121.634985 °	-121.634985 °
DWR ID	DWR_RD1600_01_s_2017_624				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					
Burnt stump on waterside slope.					

Photo 1 of 1 : SP_2020_RD1600_191_624_20200228_00036.jpg



View of burnt tree on waterside slope. Fall 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.88	Rating **	C	Issue No.	28
LM End	0.88	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.687232 °	38.687232 °	
			-121.635194 °	-121.635194 °	
DWR ID	DWR_RD1600_01_f_2019_28				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Minor runoff beginning to form. Recommend monitoring.					

No Photos

LM Start	0.93	Rating **	C	Issue No.	29
LM End	0.93	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.687827 °	38.687827 °	
			-121.635331 °	-121.635331 °	
DWR ID	DWR_RD1600_01_f_2019_29				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Minor runoff beginning to form. Recommend monitoring.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.94	Rating **	M	Issue No.	1204 (cont)
LM End	0.94	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.688030 °	38.688030 °
				-121.635367 °	-121.635367 °
DWR ID	21463				

Photo 3 of 3 : UCIP_SP_2020_15285_25086.jpg



Filters, boost pump, and gate valve down stream from concrete standpipe off LS toe.

LM Start	0.97	Rating **	M	Issue No.	134
LM End	0.97	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			38.688454 °	38.688454 °
				-121.635528 °	-121.635528 °
DWR ID	DWR_RD1600_01_f_2013_134				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Bank caving on the landside slope.					

Photo 1 of 1 : SP_2020_RD1600_191_134_20200409_00059.jpg



View of bank caving on the landside slope. Spring 2020.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.01	Rating **	A/W	Issue No.	22
LM End	1.10	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.689092 °	38.690368 °	
			-121.635616 °	-121.635669 °	
DWR ID	DWR_RD1600_01_f_2017_22				
Comment Code					
V8 : Environmental Requirements.					
Inspector Comment					

Photo 1 of 2 : SP_2020_RD1600_191_22_20200228_00012.jpg



View of the revegetation site at the berm edge on the waterward side of the levee looking upstream. Spring 2016.

LM Start	1.01	Rating **	A/W	Issue No.	22 (cont)
LM End	1.10	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2020_RD1600_191_22_20200228_00013.jpg



Sign stating revegetation site. Spring 2016.

LM Start	1.10	Rating **	M	Issue No.	40
LM End	1.10	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.690393 °	38.690393 °	
			-121.635688 °	-121.635688 °	
DWR ID	DWR_RD1600_01_f_2019_40				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Bank caving on the landside slope.					

Photo 1 of 1 : SP_2020_RD1600_191_40_20200228_00018.jpg



View of bank caving on the landside slope. Fall 2019.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.40	Rating **	M	Issue No.	4
LM End	1.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.694452 °	38.694452 °	
			-121.634292 °	-121.634292 °	
DWR ID	DWR_RD1600_01_s_2017_4				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Erosion where tire ruts previously were formed.					

Photo 1 of 1 : SP_2020_RD1600_191_4_20200228_00001.jpg



View of erosion on the landside slope. Fall 2019.

LM Start	1.40	Rating **	A/W	Issue No.	5
LM End	1.40	Issue Type +	Ob	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.694469 °	38.694469 °	
			-121.634312 °	-121.634312 °	
DWR ID	DWR_RD1600_01_f_2012_5				
Comment Code					
V8 : Environmental Requirements.					
Inspector Comment					

Photo 1 of 2 : SP_2020_RD1600_191_5_20200228_00003.jpg



View of the revegetation site on the berm of the waterward side of the levee looking upstream. Spring 2016.

LM Start	1.40	Rating **	A/W	Issue No.	5 (cont)
LM End	1.40	Issue Type +	Ob	Location *	WS

Photo 2 of 2 : SP_2020_RD1600_191_5_20200228_00004.jpg



DWR revegetation site. Spring 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.42	Rating **	A/W	Issue No.	52
LM End	1.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.694728 °	38.694728 °	
			-121.634224 °	-121.634224 °	
DWR ID	DWR_RD1600_01_f_2018_52				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Ruts on the landside slope from vehicles. Recommend monitoring for future activity.					

Photo 1 of 1 : SP_2020_RD1600_191_52_20200228_00024.jpg



View of ruts on landside shoulder. Spring 2019.

LM Start	1.65	Rating **	M	Issue No.	46
LM End	1.65	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.697799 °	38.697799 °	
			-121.632396 °	-121.632396 °	
DWR ID	DWR_RD1600_01_f_2019_46				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Ruts on the landside slope.					

No Photos

LM Start	1.70	Rating **	A/W	Issue No.	70
LM End	1.70	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.698414 °	38.698414 °	
			-121.631874 °	-121.631874 °	
DWR ID	DWR_RD1600_01_f_2017_70				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Footpath and vehicle access on landside slope. Recommend monitoring.					

Photo 1 of 1 : SP_2020_RD1600_191_70_20200228_00029.jpg



View of slope instability. Fall 2016.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.72	Rating **	A/W	Issue No.	31
LM End	1.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.698639 °	38.698639 °	
			-121.631687 °	-121.631687 °	
DWR ID	DWR_RD1600_01_s_2012_31				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	2.01	Rating **	M	Issue No.	72
LM End	2.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.701605 °	38.701605 °	
			-121.627954 °	-121.627954 °	
DWR ID	DWR_RD1600_01_s_2018_72				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Bank caving on the landside slope.					

Photo 1 of 1 : SP_2020_RD1600_191_72_20200228_00030.jpg



View of the erosion site. Spring 2017.

LM Start	2.06	Rating **	C	Issue No.	48
LM End	2.06	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.702099 °	38.702099 °	
			-121.627177 °	-121.627177 °	
DWR ID	DWR_RD1600_01_f_2019_48				
Comment Code					
PR : Prunings					
Inspector Comment					
Pruning pile on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.15	Rating **	C	Issue No.	50
LM End	2.15	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.702879 °	38.702879 °	
			-121.625835 °	-121.625835 °	
DWR ID	DWR_RD1600_01_f_2019_50				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the landside slope.					

No Photos

LM Start	2.16	Rating **	C	Issue No.	53
LM End	2.16	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		38.702930 °	38.702930 °	
			-121.625763 °	-121.625763 °	
DWR ID	DWR_RD1600_01_f_2019_53				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent holes on the landside slope and crown.					

No Photos

LM Start	2.19	Rating **	C	Issue No.	55
LM End	2.19	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.703205 °	38.703205 °	
			-121.625368 °	-121.625368 °	
DWR ID	DWR_RD1600_01_f_2019_55				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the crown.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.28	Rating **	A/W	Issue No.	30
LM End	2.28	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		38.704007 °	38.704007 °	
			-121.624032 °	-121.624032 °	
DWR ID	DWR_RD1600_01_s_2020_30				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent holes on landside shoulder. LMA has bait station. Recommend monitoring.					

No Photos

LM Start	2.30	Rating **	M	Issue No.	56
LM End	2.30	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		38.704198 °	38.704198 °	
			-121.623725 °	-121.623725 °	
DWR ID	DWR_RD1600_01_f_2019_56				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					
Rodent holes on landside shoulder.					

No Photos

LM Start	2.31	Rating **	C	Issue No.	57
LM End	2.31	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.704292 °	38.704292 °	
			-121.623564 °	-121.623564 °	
DWR ID	DWR_RD1600_01_f_2019_57				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the waterside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.35	Rating **	A/W	Issue No.	35
LM End	2.40	Issue Type +	Ob	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.704624 °	38.705152 °	
			-121.623034 °	-121.622187 °	
DWR ID	DWR_RD1600_01_s_2012_35				
Comment Code					
V8 : Environmental Requirements.					
Inspector Comment					

Photo 1 of 2 : SP_2020_RD1600_191_35_20200228_00015.jpg



Sign for revegetation site. Spring 2016.

LM Start	2.35	Rating **	A/W	Issue No.	35 (cont)
LM End	2.40	Issue Type +	Ob	Location *	WS

Photo 2 of 2 : SP_2020_RD1600_191_35_20200228_00016.jpg



View of the revegetation site on the waterward side of the levee looking upstream. Spring 2016.

LM Start	2.40	Rating **	A/W	Issue No.	43
LM End	2.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.705154 °	38.705154 °	
			-121.622231 °	-121.622231 °	
DWR ID	DWR_RD1600_01_s_2019_43				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Minor erosion on landside slope. Recommend monitoring.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.61	Rating **	A/W	Issue No.	45
LM End	2.61	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.707311 °	38.707311 °	
			-121.619517 °	-121.619517 °	
DWR ID	DWR_RD1600_01_f_2016_45				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	2.73	Rating **	C	Issue No.	58
LM End	2.73	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.708540 °	38.708540 °	
			-121.617920 °	-121.617920 °	
DWR ID	DWR_RD1600_01_f_2019_58				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the crown.					

No Photos

LM Start	2.76	Rating **	C	Issue No.	59
LM End	2.76	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.708795 °	38.708795 °	
			-121.617586 °	-121.617586 °	
DWR ID	DWR_RD1600_01_f_2019_59				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the crown.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.81	Rating **	M	Issue No.	1205
LM End	2.81	Issue Type +	En	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		38.709350 °	38.709350 °	
			-121.616913 °	-121.616913 °	
DWR ID	21467				
Comment Code					
Inspector Comment					
DS_ID:21467 FS_ID:15108 EP_NO: N/A Repair Type: Non-Urgent Crossing Status: Not Found UCIP Comments: Pipe removed and replaced with a pipe dsid 25565 - permit 18852. Appears abandoned and should be done so properly. Debris buildup on pier. Power cut to pump. FIELD_STRUCT_DESC: *REMOVED* 16-inch steel irrigation pipe through the levee, 2 feet below the crown. Walkway from berm to pump on pile structure in the stream. Siphon breaker on the landside (LS) slope. 12-inch polyvinyl chloride (PVC) standpipe off the LS toe. [Additional Reference(s): DWR Levee Log, 1988. USACE Sacramento O&M Manual 123, August 1955, (RM 73.4) (18-inch pipe listed)]. FS Date: 6/18/2013					

Photo 1 of 3 : UCIP_SP_2020_15108_24826.jpg



Pump on metal platform off WS berm.

LM Start	2.81	Rating **	M	Issue No.	1205 (cont)
LM End	2.81	Issue Type +	En	Location *	

Photo 2 of 3 : UCIP_SP_2020_15108_24825.jpg



Debris buildup at metal platform waterline.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.81	Rating **	M	Issue No.	1205 (cont)
LM End	2.81	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.709350 °	38.709350 °
				-121.616913 °	-121.616913 °
DWR ID	21467				

Photo 3 of 3 : UCIP_SP_2020_15108_24824.jpg



Electrical cut to pump.

LM Start	2.84	Rating **	C	Issue No.	64
LM End	2.84	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.709647 °	38.709647 °
				-121.616537 °	-121.616537 °
DWR ID	DWR_RD1600_01_f_2019_64				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the waterside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	2.99	Rating **	M	Issue No.	15
LM End	3.37	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 USACE Erosion Survey			38.710874 °	38.715134 °
				-121.614239 °	-121.609566 °
DWR ID	DWR_RD1600_01_f_2018_15				
Comment Code					
Inspector Comment					
2017 Site ID: SAC 74.0 R Status: Eroding New 2017 Field Notes: Significant toe erosion. Erosion along entire bank. Tree popouts observed. Site History:					

No Photos

LM Start	3.01	Rating **	C	Issue No.	65
LM End	3.01	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.711359 °	38.711359 °
				-121.614281 °	-121.614281 °
DWR ID	DWR_RD1600_01_f_2019_65				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Large fallen tree branch on the landside slope.					

No Photos

LM Start	3.04	Rating **	A/W	Issue No.	37
LM End	3.04	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.711597 °	38.711597 °
				-121.613890 °	-121.613890 °
DWR ID	DWR_RD1600_01_s_2012_37				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	3.14	Rating **	C	Issue No.	67
LM End	3.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.712686 °	38.712686 °	
			-121.612654 °	-121.612654 °	
DWR ID	DWR_RD1600_01_f_2019_67				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Bank caving on the landside slope.					

No Photos

LM Start	3.20	Rating **	M	Issue No.	51
LM End	3.20	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.713393 °	38.713393 °	
			-121.611828 °	-121.611828 °	
DWR ID	DWR_RD1600_01_s_2017_51				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	3.33	Rating **	M	Issue No.	68
LM End	3.33	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.714861 °	38.714861 °	
			-121.610340 °	-121.610340 °	
DWR ID	DWR_RD1600_01_f_2019_68				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove blackberries on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	3.40	Rating **	M	Issue No.	77
LM End	3.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.715681 °	38.715681 °	
			-121.609555 °	-121.609555 °	
DWR ID	DWR_RD1600_01_f_2019_77				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	3.55	Rating **	C	Issue No.	69
LM End	3.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.717573 °	38.717573 °	
			-121.608124 °	-121.608124 °	
DWR ID	DWR_RD1600_01_f_2019_69				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limb on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	3.58	Rating **	M	Issue No.	16
LM End	3.83	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 USACE Erosion Survey			38.717770 °	38.721351 °
				-121.607423 °	-121.606414 °
DWR ID	DWR_RD1600_01_f_2018_16				
Comment Code					
Inspector Comment					
2017 Site ID: SAC 74.4 R Status: Eroding 2017 Field Notes: Significant erosion at toe in the past year. Fresh tree popout. Site History: 1997 - Steep high bank. 2005 - Some small pockets in the low toe near the waterline. 2006 - Minor slope clearing. 2010 - Minor new erosion. 2011 - Multiple trees have fallen since last year. Some other trees look ready to fall. Significant new erosion since last year. 2012 - Minor new erosion. 2013 - Minor new erosion. 2015 - Minor new toe erosion.					

Photo 1 of 1 : SP_2020_RD1600_191_16_20200228_00005.jpg



USACE 2013 Photo #1

LM Start	4.34	Rating **	A/W	Issue No.	17
LM End	4.86	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 USACE Erosion Survey			38.728684 °	38.736110 °
				-121.605844 °	-121.604153 °
DWR ID	DWR_RD1600_01_f_2018_17				
Comment Code					
Inspector Comment					
2017 Site ID: SAC 75.3 R Status: Eroding 2017 Field Notes: Fresh erosion along lower bank in sections. Site History: 1997 - Very steep bank. 2005 - Lots of small trees down along the bank at the upstream end. 2006 - Minor new erosion, but slow. 2010 - Almost all of the roots are exposed on the trees, appears ready to fall. 2011 - New erosion and tree popouts. 2012 - Site has become overgrown with vegetation, making it hard to observe. 2015 - Dense vegetation made the site difficult to observe.					
DWR Inspector Comment: Worst spot near LM 4.66. Recommend monitoring.					

Photo 1 of 1 : SP_2020_RD1600_191_17_20200228_00006.jpg



USACE 2013 Photo #1

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.43	Rating **	C	Issue No.	71
LM End	4.43	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.730048 °	38.730048 °	
			-121.606012 °	-121.606012 °	
DWR ID	DWR_RD1600_01_f_2019_71				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree on the waterside slope.					

No Photos

LM Start	4.46	Rating **	C	Issue No.	60
LM End	4.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.730441 °	38.730441 °	
			-121.605931 °	-121.605931 °	
DWR ID	DWR_RD1600_01_f_2019_60				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree on the waterside slope.					

No Photos

LM Start	4.49	Rating **	C	Issue No.	73
LM End	4.49	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.730906 °	38.730906 °	
			-121.605970 °	-121.605970 °	
DWR ID	DWR_RD1600_01_f_2019_73				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Bank caving on the landside slope caused by goats.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

Flood Control Project Maintenance
Levee Inspections

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.52	Rating **	M	Issue No.	1208 (cont)
LM End	4.52	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.731280 °	38.731280 °
				-121.605825 °	-121.605825 °
DWR ID	21471				

Photo 2 of 2 : UCIP_SP_2020_41563_27473.jpg



Pipe and remnants of grouted pipe on LS slope.

LM Start	4.66	Rating **	M	Issue No.	36
LM End	4.66	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			38.733296 °	38.733296 °
				-121.605472 °	-121.605472 °
DWR ID	DWR_RD1600_01_s_2020_36				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Runoff on the landside slope.					

No Photos

LM Start	4.72	Rating **	C	Issue No.	18
LM End	4.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.734255 °	38.734255 °
				-121.605190 °	-121.605190 °
DWR ID	DWR_RD1600_01_s_2018_18				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree on waterside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.75	Rating **	A/W	Issue No.	1193
LM End	4.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.734561 °	38.734561 °	
			-121.605113 °	-121.605113 °	
DWR ID	DWR_RD1600_01_s_2015_1193				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	4.76	Rating **	A/W	Issue No.	1194
LM End	4.76	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.734784 °	38.734784 °	
			-121.605048 °	-121.605048 °	
DWR ID	DWR_RD1600_01_s_2015_1194				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	4.79	Rating **	A/W	Issue No.	1195
LM End	4.79	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.735111 °	38.735111 °	
			-121.604923 °	-121.604923 °	
DWR ID	DWR_RD1600_01_s_2015_1195				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.80	Rating **	A/W	Issue No.	1196
LM End	4.80	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.735275 °	38.735275 °	
			-121.604863 °	-121.604863 °	
DWR ID	DWR_RD1600_01_f_2019_1196				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	4.85	Rating **	A/W	Issue No.	1197
LM End	4.85	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.736095 °	38.736095 °	
			-121.604642 °	-121.604642 °	
DWR ID	DWR_RD1600_01_s_2015_1197				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	4.88	Rating **	M	Issue No.	41
LM End	4.88	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.736397 °	38.736397 °	
			-121.604556 °	-121.604556 °	
DWR ID	DWR_RD1600_01_s_2020_41				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Runoff on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	5.02	Rating **	C	Issue No.	74
LM End	5.02	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.738343 °	38.738343 °	
			-121.603759 °	-121.603759 °	
DWR ID	DWR_RD1600_01_f_2019_74				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Fallen tree limbs on the landside slope.					

No Photos

LM Start	5.07	Rating **	C	Issue No.	75
LM End	5.07	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.739057 °	38.739057 °	
			-121.603508 °	-121.603508 °	
DWR ID	DWR_RD1600_01_f_2019_75				
Comment Code					
T4 : Trim trees over roadway to at least 12 feet above ground level.					
Inspector Comment					

No Photos

LM Start	5.42	Rating **	A/W	Issue No.	13
LM End	5.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.743805 °	38.743805 °	
			-121.601319 °	-121.601319 °	
DWR ID	DWR_RD1600_01_s_2012_13				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	5.44	Rating **	A/W	Issue No.	19
LM End	5.77	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.744118 °	38.748210 °	
			-121.601104 °	-121.598025 °	
DWR ID	DWR_RD1600_01_s_2012_19				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Gradual loss of the berm over many years. Erosion is at the waters edge. Walnut trees are close to edge now. Recommend monitoring.					

No Photos

LM Start	5.77	Rating **	M	Issue No.	54
LM End	5.77	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.748258 °	38.748258 °	
			-121.598000 °	-121.598000 °	
DWR ID	DWR_RD1600_01_s_2020_54				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Ruts on the landside slope.					

No Photos

LM Start	5.80	Rating **	M	Issue No.	39
LM End	5.80	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.748639 °	38.748639 °	
			-121.597662 °	-121.597662 °	
DWR ID	DWR_RD1600_01_f_2017_39				
Comment Code					
DE : Debris					
Inspector Comment					
Abandoned pipes on waterside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	5.85	Rating **	M	Issue No.	63
LM End	5.85	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.749253 °	38.749253 °	
			-121.597203 °	-121.597203 °	
DWR ID	DWR_RD1600_01_f_2018_63				
Comment Code					
DE : Debris					
Inspector Comment					
Abandoned pipes on the waterside bench.					

No Photos

LM Start	5.95	Rating **	M	Issue No.	62
LM End	5.95	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.750506 °	38.750506 °	
			-121.596523 °	-121.596523 °	
DWR ID	DWR_RD1600_01_s_2020_62				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Ruts on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	6.19	Rating **	M	Issue No.	1209 (cont)
LM End	6.19	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.753820 °	38.753820 °
				-121.595012 °	-121.595012 °
DWR ID	21476				

Photo 3 of 3 : UCIP_SP_2020_53410_25012.jpg



Pump missing from pier on WS toe.

LM Start	6.51	Rating **	M	Issue No.	78
LM End	6.51	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			38.758447 °	38.758447 °
				-121.594139 °	-121.594139 °
DWR ID	DWR_RD1600_01_s_2020_78				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	6.56	Rating **	M	Issue No.	80
LM End	6.56	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.759131 °	38.759131 °
				-121.594092 °	-121.594092 °
DWR ID	DWR_RD1600_01_s_2017_80				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	7.10	Rating **	A/W	Issue No.	20
LM End	7.10	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.766691 °	38.766691 °	
			-121.596300 °	-121.596300 °	
DWR ID	DWR_RD1600_01_s_2012_20				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Continued erosion within the waterside berm. Not within the prism.					

Photo 1 of 1 : SP_2020_RD1600_191_20_20200228_00007.jpg



View of erosion on the waterside berm.

LM Start	7.21	Rating **	A/W	Issue No.	61
LM End	7.21	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.768094 °	38.768094 °	
			-121.597075 °	-121.597075 °	
DWR ID	DWR_RD1600_01_f_2015_61				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Runoff erosion on landside slope. Recommend monitoring.					

Photo 1 of 1 : SP_2020_RD1600_191_61_20200228_00026.jpg



View of the erosion on the landward side of the levee looking downstream. Fall 2015.

LM Start	7.23	Rating **	A/W	Issue No.	21
LM End	7.23	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.768409 °	38.768409 °	
			-121.597213 °	-121.597213 °	
DWR ID	DWR_RD1600_01_f_2019_21				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Erosion on waterside berm. Not within the prism.					

Photo 1 of 2 : SP_2020_RD1600_191_21_20200228_00009.jpg



The erosion is eroding away the berm area.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	7.23	Rating **	A/W	Issue No.	21 (cont)
LM End	7.23	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.768409 °	38.768409 °	
			-121.597213 °	-121.597213 °	
DWR ID	DWR_RD1600_01_f_2019_21				

Photo 2 of 2 : SP_2020_RD1600_191_21_20200228_00010.jpg



The bank is eroding away and has become very steep.

LM Start	7.38	Rating **	M	Issue No.	81
LM End	7.38	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.770338 °	38.770338 °	
			-121.598542 °	-121.598542 °	
DWR ID	DWR_RD1600_01_s_2019_81				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	7.56	Rating **	M	Issue No.	1210 (cont)
LM End	7.56	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.772560 °	38.772560 °
				-121.600153 °	-121.600153 °
DWR ID	25464				

Photo 3 of 3 : UCIP_SP_2020_50169_75609.jpg



view of levee crown looking upstream from pipe location.

LM Start	8.03	Rating **	M	Issue No.	1211
LM End	8.03	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.777799 °	38.777799 °
				-121.605763 °	-121.605763 °
DWR ID	21480				

Comment Code

Inspector Comment

DS_ID:21480
 FS_ID:16310
 EP_NO: 7339
 Repair Type: Non-Urgent
 Crossing Status: Indicator Found
 UCIP Comments: Need to determine disposition of pipe. If abandoned, it should be done so properly.
 FIELD_STRUCT_DESC: 24-inch steel irrigation pipe through the levee, 3.8 feet below the crown. Steel plate welded on the waterside (WS) end. Pipe not visible on either slope. Pylons in river at the WS toe, and a 4-foot-diameter steel standpipe on the landside (LS) toe. Seepage area at the landside (LS) toe. (Permit No. 7339, 1971 - Layton Knaggs).
 [Additional Reference(s): DWR Levee Log, 1988].
 FS Date: 6/20/2013

Photo 1 of 1 : UCIP_SP_2020_16310_27485.jpg



4-foot diameter steel standpipe at LS toe, may be indicator of pipe location.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	8.19	Rating **	M	Issue No.	79
LM End	8.19	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.778945 °	38.778945 °	
			-121.608198 °	-121.608198 °	
DWR ID	DWR_RD1600_01_s_2020_79				
Comment Code					
EQ : Equipment					
Inspector Comment					
Beehives on the waterside shoulder.					

No Photos

LM Start	9.41	Rating **	M	Issue No.	82
LM End	9.47	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.778534 °	38.777635 °	
			-121.627182 °	-121.627618 °	
DWR ID	DWR_RD1600_01_s_2020_82				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

LM Start	9.49	Rating **	M	Issue No.	83
LM End	9.53	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.777454 °	38.777001 °	
			-121.627792 °	-121.628257 °	
DWR ID	DWR_RD1600_01_s_2020_83				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	9.64	Rating **	M	Issue No.	25
LM End	9.73	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.776106 °	38.775181 °	
			-121.629889 °	-121.631070 °	
DWR ID	DWR_RD1600_01_s_2019_25				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					
Cut back willows.					

No Photos

LM Start	9.85	Rating **	M	Issue No.	14
LM End	9.91	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.773458 °	38.772692 °	
			-121.631753 °	-121.631628 °	
DWR ID	DWR_RD1600_01_s_2019_14				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

LM Start	9.97	Rating **	M	Issue No.	84
LM End	10.04	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.771820 °	38.770795 °	
			-121.631608 °	-121.631669 °	
DWR ID	DWR_RD1600_01_s_2020_84				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	10.46	04/08/2020 04/08/2020	Zach Jojola

LM Start	10.23	Rating **	M	Issue No.	66
LM End	10.45	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		38.768160 °	38.765406 °	
			-121.632950 °	-121.635004 °	
DWR ID	DWR_RD1600_01_f_2016_66				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

Photo 1 of 1 : SP_2020_RD1600_191_66_20200228_00028.jpg



Vegetation on WS slope has been cleared only about 10 ft. from the crown. Fall 2016.

LM Start	10.35	Rating **	M	Issue No.	1202
LM End	10.38	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		38.766652 °	38.766363 °	
			-121.634002 °	-121.634317 °	
DWR ID	DWR_RD1600_01_s_2015_1202				
Comment Code					
DE : Debris					
Inspector Comment					
Concrete pipes and blocks on levee crown.					

Photo 1 of 1 : SP_2020_RD1600_191_1202_20200228_00037.jpg



View of debris on the waterward side of the levee looking upstream. Spring 2015.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2020 Levee Inspection Results

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles
Unit No. 02 Yolo Bypass	Left	4.23

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	4/8/2020 - 4/8/2020			
DWR Inspector	Zach Jojola			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.00	Rating **	M	Issue No.	7
LM End	0.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.736218 °	38.729528 °	
			-121.633662 °	-121.633436 °	
DWR ID	DWR_RD1600_02_s_2020_7				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.26	Rating **	M	Issue No.	9
LM End	0.36	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.732544 °	38.731059 °	
			-121.633441 °	-121.633489 °	
DWR ID	DWR_RD1600_02_s_2020_9				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.89	Rating **	M	Issue No.	10
LM End	1.42	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.723408 °	38.715833 °	
			-121.633400 °	-121.635012 °	
DWR ID	DWR_RD1600_02_s_2020_10				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	0.89	Rating **	M	Issue No.	11
LM End	1.42	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.723408 °	38.715833 °	
			-121.633400 °	-121.635012 °	
DWR ID	DWR_RD1600_02_s_2020_11				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.92	Rating **	M	Issue No.	23
LM End	1.40	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.722948 °	38.716108 °	
			-121.633477 °	-121.634930 °	
DWR ID	DWR_RD1600_02_s_2017_23				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Long section of wave wash damage on waterside levee slope.					
Site ID No:203					
Site Designation:RD 1600-03					

Photo 1 of 1 : SP_2020_RD1600_192_23_20200228_00017.jpg



View of wave wash damage on waterside levee slope. Spring 2017.

LM Start	1.56	Rating **	U	Issue No.	8
LM End	1.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.713900 °	38.713047 °	
			-121.635817 °	-121.636154 °	
DWR ID	DWR_RD1600_02_s_2019_8				
Comment Code					
S1 : Repair slope instability.					
Inspector Comment					
300' sloughing section with multiple plateaus of exposed scarp. The LMA placed visqueen over the issue and will continue to monitor until a repair can be completed.					

Photo 1 of 2 : SP_2020_RD1600_192_8_20200409_00025.jpg



View of sloughing on the landside slope. Spring 2020.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.56	Rating **	U	Issue No.	8 (cont)
LM End	1.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		38.713900 °	38.713047 °	
			-121.635817 °	-121.636154 °	
DWR ID	DWR_RD1600_02_s_2019_8				

Photo 2 of 2 : SP_2020_RD1600_192_8_20200409_00024.jpg



View of sloughing on the landside slope. Spring 2020.

LM Start	1.67	Rating **	M	Issue No.	12
LM End	4.15	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.712297 °	38.677593 °	
			-121.636458 °	-121.643777 °	
DWR ID	DWR_RD1600_02_s_2020_12				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	1.67	Rating **	M	Issue No.	13
LM End	4.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		38.712297 °	38.677583 °	
			-121.636458 °	-121.643773 °	
DWR ID	DWR_RD1600_02_s_2020_13				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	1.79	Rating **	M	Issue No.	14
LM End	2.05	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.710763 °	38.707116 °	
			-121.637147 °	-121.638722 °	
DWR ID	DWR_RD1600_02_s_2019_14				
Comment Code					
E1 : Note and monitor erosion site.					
Inspector Comment					
Wavewash on the waterside slope.					
Site ID No:202					
Site Designation:RD 1600-01					

Photo 1 of 2 : SP_2020_RD1600_192_14_20200228_00007.jpg



A closer view of the wave wash damage along the bypass.

LM Start	1.79	Rating **	M	Issue No.	14 (cont)
LM End	2.05	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : SP_2020_RD1600_192_14_20200228_00008.jpg



Wave wash damage along the slope the cut is 1'-2'.

LM Start	1.86	Rating **	C	Issue No.	4
LM End	1.89	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Cracking		38.709764 °	38.709396 °	
			-121.637552 °	-121.637716 °	
DWR ID	DWR_RD1600_02_f_2019_4				
Comment Code					
CR1 : Monitor and have inspected by geotechnical engineer.					
Inspector Comment					
Large 200' longitudinal crack on the crown. Recommend having a geotechnical engineer conduct a site visit.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	3.71	Rating **	M	Issue No.	24
LM End	3.71	Issue Type +	En	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP Field Study		38.683971 °	38.683971 °	
			-121.644522 °	-121.644522 °	
DWR ID	21501				
Comment Code					
Inspector Comment					
DS_ID:21501 FS_ID:52738 EP_NO: 10944 Repair Type: Non-Urgent Crossing Status: Indicator Found UCIP Comments: 07/17/2018 Gas line markers are not installed. Unable to determine exact location of pipe. Crossing has been downgraded to "Non-Urgent" due to reclassification of gas lines. (O.Yakimov-DWR UCIP)08/16/2016 - unable to locate pipe. Need to install gas line markers on LS and WS of levee crown to denote location. (T. Hatch/UCIP)06/21/2013 - Need to install gasline markers on levee. (W. Wylie/UCIP) FIELD_STRUCT_DESC: 8.625-inch steel gas line through the levee, 2 feet below the crown. (Permit No. 10944, 1975 - Shell Oil Company). [Additional Reference(s): DWR Levee Log, 1988]. FS Date: 7/17/2018 3:18:28 PM					

Photo 1 of 3 : UCIP_SP_2020_52738_27478.jpg



PG&E marker flag on Crown.

LM Start	3.71	Rating **	M	Issue No.	24 (cont)
LM End	3.71	Issue Type +	En	Location *	

Photo 2 of 3 : UCIP_SP_2020_52738_27477.jpg



Carsonite gasline marker visible approximately 1,000-feet east of levee crown.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	3.71	Rating **	M	Issue No.	24 (cont)
LM End	3.71	Issue Type +	En	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP Field Study			38.683971 °	38.683971 °
				-121.644522 °	-121.644522 °
DWR ID	21501				

Photo 3 of 3 : UCIP_SP_2020_52738_77709.jpg



View of levee crown at potential crossing looking upstream.

LM Start	3.78	Rating **	C	Issue No.	5
LM End	3.78	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.682947 °	38.682947 °
				-121.644425 °	-121.644425 °
DWR ID	DWR_RD1600_02_f_2018_5				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Tire ruts on the landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.17	Rating **	A/W	Issue No.	25
LM End	4.17	Issue Type +	Ma	Location *	
Category	Supplemental		GPS Latitude/Longitude		
			Start	End	
Item	DWR UCIP LMA Responsibility		38.677286 °	38.677286 °	
			-121.643683 °	-121.643683 °	
DWR ID	21502				
Comment Code					
Inspector Comment					
DS_ID:21502 FS_ID:15303 EP_NO: N/A Repair Type: No Action Needed Crossing Status: Found UCIP Comments: FIELD_STRUCT_DESC: 72-inch by 72-inch reinforced concrete box drainage culvert through the levee, 26 feet below the crown. Slide gate on the waterside (WS) slope in a 9-foot by 10-foot concrete box. Culvert passes under the bypass canal, the railroad, and County Road 22 and terminates in the canal on the southwest side of the County Road 22 bridge. [Additional Reference(s): DWR Levee Log, 1988. USACE Sacramento O&M Manual 123, August 1955, (Station 155+00)]. FS Date: 6/21/2013					

Photo 1 of 3 : UCIP_SP_2020_15303_25158.jpg



Concrete intake structure on LS.

LM Start	4.17	Rating **	A/W	Issue No.	25 (cont)
LM End	4.17	Issue Type +	Ma	Location *	

Photo 2 of 3 : UCIP_SP_2020_15303_25157.jpg



Concrete intake structure on LS.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2020

Reclamation District No. 1600 Mull

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Left	4.23	04/08/2020 04/08/2020	Zach Jojola

LM Start	4.17	Rating **	A/W	Issue No.	25 (cont)
LM End	4.17	Issue Type +	Ma	Location *	
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	DWR UCIP LMA Responsibility			38.677286 °	38.677286 °
				-121.643683 °	-121.643683 °
DWR ID	21502				

Photo 3 of 3 : UCIP_SP_2020_15303_25156.jpg



Slide gate in 9'X10' concrete box on WS slope.

LM Start	4.19	Rating **	C	Issue No.	6
LM End	4.19	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.677121 °	38.677121 °
				-121.643466 °	-121.643466 °
DWR ID	DWR_RD1600_02_s_2016_6				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove wood debris from landside slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---