

**Flood Control Project Maintenance  
Levee Inspections**  
**LMA District Cover Sheet**  
**Spring 2020 Levee Inspection Results**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
† Overall LMA Rating (Fall Only)				

\*\* Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

† **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

**FALL INSPECTIONS:** The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments


**Flood Control Project Maintenance  
Levee Inspections**

**Unit Cover Sheet**

**Spring 2020 Levee Inspection Results**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

Waterway	Bank	Unit Miles
Unit No. 01 Murphy Slough at M&T Ranch	Left	0.83

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	4/8/2020 - 4/8/2020			
DWR Inspector	Makar Sokol			
Accompanied By				

**Summer & Winter Inspections**

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

*The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.*

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2020**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Murphy Slough at M&T Ranch	Left	0.83	04/08/2020 04/08/2020	Makar Sokol

LM Start		Rating **	A	Issue No.	2
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Flood Preparedness & Training			°	°
DWR ID	DWR_NA0014_01_s_2013_2				
Comment Code					
Inspector Comment					
The LMA completed flood fight training.					

No Photos

LM Start		Rating **	A	Issue No.	3
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Emergency Supplies & Equipment			°	°
DWR ID	DWR_NA0014_01_s_2013_3				
Comment Code					
Inspector Comment					
The LMA has adequate flood fight supplies and equipment.					

No Photos

LM Start		Rating **	A	Issue No.	6
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start		End
Item	Operations & Maintenance Manuals			°	°
DWR ID	DWR_NA0014_01_s_2013_6				
Comment Code					
Inspector Comment					
There is no O&M Manual for M&T Ranch.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>+</b> Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2020**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Murphy Slough at M&T Ranch	Left	0.83	04/08/2020 04/08/2020	Makar Sokol

LM Start	<b>0.00</b>	Rating **	M	Issue No.	<b>1</b>
LM End	<b>0.07</b>	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.667748 °	39.667165 °	
			-121.959205 °	-121.960218 °	
DWR ID	DWR_NA0014_01_s_2012_1				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

LM Start	<b>0.00</b>	Rating **	M	Issue No.	<b>4</b>
LM End	<b>0.09</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.667748 °	39.666983 °	
			-121.959205 °	-121.960997 °	
DWR ID	DWR_NA0014_01_s_2012_4				
Comment Code					
V4 : Elderberries are blocking visibility and flood fight capability.					
Inspector Comment					

No Photos

LM Start	<b>0.00</b>	Rating **	M	Issue No.	<b>9</b>
LM End	<b>0.47</b>	Issue Type +	En	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		39.667748 °	39.666356 °	
			-121.959205 °	-121.967574 °	
DWR ID	DWR_ST0014_01_s_2019_9				
Comment Code					
FE : Fence					
Inspector Comment					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2020**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Murphy Slough at M&T Ranch	Left	0.83	04/08/2020 04/08/2020	Makar Sokol

LM Start	<b>0.24</b>	Rating **	M	Issue No.	<b>10</b>
LM End	<b>0.24</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		39.666506 °	39.666506 °	
			-121.963237 °	-121.963237 °	
DWR ID	DWR_ST0014_01_f_2019_10				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

Photo 1 of 1 : SP\_2020\_ST0014\_372\_10\_20200226\_00003.jpg



View of the erosion at the landside shoulder and slope. Fall 2019.

LM Start	<b>0.28</b>	Rating **	M	Issue No.	<b>11</b>
LM End	<b>0.28</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		39.666403 °	39.666403 °	
			-121.964004 °	-121.964004 °	
DWR ID	DWR_ST0014_01_f_2019_11				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

Photo 1 of 1 : SP\_2020\_ST0014\_372\_11\_20200226\_00004.jpg



View of the erosion at the landside slope. Fall 2019.

LM Start	<b>0.31</b>	Rating **	M	Issue No.	<b>8</b>
LM End	<b>0.31</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Encroachments		39.666319 °	39.666319 °	
			-121.964544 °	-121.964544 °	
DWR ID	DWR_ST0014_01_s_2019_8				
Comment Code					
TR : Tree or limb					
Inspector Comment					
The tree should be removed from the landside toe.					

Photo 1 of 1 : SP\_2020\_ST0014\_372\_8\_20200413\_00005.jpg



View of the tree at the landside toe. Spring 2020.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>N : Not Inspected/Rated</b> C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---

**Flood Control Project Maintenance  
Levee Inspections**

**Levee Inspection Report By Mile - Spring 2020**

**Sutter Maintenance Yard Murphy Slough at M&T Ranch**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Murphy Slough at M&T Ranch	Left	0.83	04/08/2020 04/08/2020	Makar Sokol

LM Start	<b>0.48</b>	Rating **	M	Issue No.	<b>12</b>
LM End	<b>0.48</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		39.666372 °	39.666372 °	
			-121.967691 °	-121.967691 °	
DWR ID	DWR_ST0014_01_f_2019_12				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

No Photos

LM Start	<b>0.56</b>	Rating **	M	Issue No.	<b>5</b>
LM End	<b>0.56</b>	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		39.667026 °	39.667026 °	
			-121.968890 °	-121.968890 °	
DWR ID	DWR_ST0014_01_s_2019_5				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

Photo 1 of 1 : SP\_2020\_ST0014\_372\_5\_20200226\_00001.jpg



View of the erosion on the landside slope. Spring 2019.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---