

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Spring 2011 Levee Inspection Results
Yolo County Service Area 6

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

* SPRING INSPECTIONS: Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports.

Comments

**Flood Control Project Maintenance
Levee Inspections
Unit Cover Sheet
Spring 2011 Levee Inspection Results
Yolo County Service Area 6**

Waterway	Bank	Unit Miles
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	3/15/2011 - 3/17/2011			
DWR Inspector	John Williamson			
Accompanied By	Regina Espinosa Yolo County			

Check one:

During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. We have found no changes in flood project conditions other than the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the enclosed report.

During the current winter (or summer) inspection period, my staff or I have inspected the levee and associated flood project components identified in the attached Levee Inspection Report by Mile. In addition to the results of our normal maintenance and the corrections we have made to maintenance deficiencies identified in the report, we have found the following changes in flood project conditions.

(In the comment section below or on additional sheet(s), identify change of condition by: Start to End Levee Mile or GPS coordinates, location (Land Side, Water Side, or Crown), Item identification, and description of the current condition).

Comments

One of the boxes above is to be checked by the Local Maintaining Agency (LMA). If the second box is checked, additional information must also be submitted. This Unit Cover Sheet should be signed and dated by the LMA Representative and returned to DWR with any additional sheets by September 30 (Summer Inspection) or March 31 (Winter Inspection). Please retain a copy for your records. Please mail all of this information to :

DWR Summer/Winter Inspection Reports
3310 El Camino Avenue, Suite 200
Sacramento, CA 95821-9000

X _____ Date

Signature of LMA Representative

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.00	0.00	Earthen Levee	Animal Control	WS	C	No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.	38.799186 ° -121.724440 °	38.799186 ° -121.724440 °	4
2	0.04	0.20	Earthen Levee	Crown Surface / Depressions / Rutting	CR	C	Keep the crown roadway free of vegetation.	38.799638 ° -121.724004 °	38.801356 ° -121.722079 °	5
3	0.12	0.20	Earthen Levee	Vegetation	WS	M	Remove the wild growth other than native grasses from the levee slopes.	38.800560 ° -121.723324 °	38.801368 ° -121.722054 °	6 Y
4	0.15	0.15	Earthen Levee	Trim / Thin Trees	LS	M	Thin trees to allow visibility of the ground and room to flood fight.	38.800828 ° -121.722903 °	38.800828 ° -121.722903 °	30 Y
5	0.15	0.15	Earthen Levee	Encroachments	WS	PO	Buildings	38.800828 ° -121.722902 °	38.800828 ° -121.722902 °	29 Y
6	0.22	0.26	Earthen Levee	Encroachments	LS	PO	Buildings Inspector Comments: RV park runs on and along levee to bridge	38.801500 ° -121.721878 °	38.801613 ° -121.721328 °	28 Y
7	0.31	0.33	Earthen Levee	Encroachments	LS	PO	Landscaping Inspector Comments: This is a two year old home. I have talked to the owner about a permit and he continues to landscape the landside slope with no permit. Owner has added fence across levee. Gave her an application, did field investigation report.	38.801720 ° -121.720447 °	38.801840 ° -121.720030 °	27 Y
8	0.35	0.39	Earthen Levee	Encroachments	LS	PO	Buildings Inspector Comments: apartments with chainlink fence with lathe woven into it.	38.801967 ° -121.719727 °	38.802105 ° -121.718963 °	26 Y
9	0.50	0.57	Earthen Levee	Encroachments	WS	PO	Landscaping	38.802238 ° -121.716875 °	38.801960 ° -121.715700 °	24 Y
10	0.51	0.57	Earthen Levee	Encroachments	LS	PO	Buildings	38.802172 ° -121.716705 °	38.801958 ° -121.715758 °	25 Y
11	0.57	0.71	Earthen Levee	Encroachments	LS	CO	Landscaping Inspector Comments: oleander hedge	38.801968 ° -121.715707 °	38.801077 ° -121.713335 °	22 Y
12	0.57	0.65	Earthen Levee	Encroachments	WS	PO	Buildings Inspector Comments: yolo sutter boat club	38.801965 ° -121.715705 °	38.801468 ° -121.714348 °	23 Y
13	0.73	0.73	Earthen Levee	Vegetation	LS	M	Remove the wild growth other than native grasses from the levee slopes.	38.800960 ° -121.713153 °	38.800960 ° -121.713153 °	2 Y
14	0.79	0.79	Earthen Levee	Animal Control	LS	C	Exterminate rodents and backfill and compact or grout burrows.	38.800605 ° -121.711901 °	38.800605 ° -121.711901 °	50
15	0.96	0.96	Earthen Levee	Animal Control	WS	C	Exterminate rodents and backfill and compact or grout burrows.	38.800215 ° -121.709055 °	38.800215 ° -121.709055 °	51
16	0.97	1.14	Earthen Levee	Vegetation	LS	M	Remove the wild growth other than native grasses from the levee slopes.	38.800188 ° -121.708918 °	38.800577 ° -121.705830 °	21 Y

* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated C : Corrected W : Watch/Monitor
--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway					Bank	Unit Miles	Inspection Start/End	Inspector		
Unit No. 01 Right Bank of Sacramento River at Knights Landing					Right	5.97	03/15/2011 03/17/2011	John Williamson		
LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
17	1.18	1.34	Earthen Levee	Vegetation	LS	M	Remove the wild growth other than native grasses from the levee slopes.	38.800778 ° -121.705135 °	38.802058 ° -121.702633 °	20 Y
18	1.40	1.40	Earthen Levee	Vegetation	LS	A	Control annual grass and weeds on the levee slopes and easements.	38.802134 ° -121.701712 °	38.802134 ° -121.701712 °	3 Y
19	1.47	1.47	Earthen Levee	Vegetation	WS	A	Control annual grass and weeds on the levee slopes and easements.	38.801770 ° -121.700434 °	38.801770 ° -121.700434 °	7 Y
20	1.78	1.78	Earthen Levee	Encroachments	WS	M	Prunings	38.797916 ° -121.697980 °	38.797916 ° -121.697980 °	9 Y
21	1.91	1.91	Earthen Levee	Encroachments	LS	PO	Landscaping Inspector Comments: sprinklers trenched into levee slope	38.796394 ° -121.696700 °	38.796394 ° -121.696700 °	10 Y
22	1.99	1.99	Earthen Levee	Encroachments	LS	C	Prunings	38.795518 ° -121.695965 °	38.795518 ° -121.695965 °	19
23	2.07	2.07	Earthen Levee	Encroachments	LS	C	Prunings	38.794347 ° -121.695690 °	38.794347 ° -121.695690 °	18
24	2.18	2.18	Earthen Levee	Animal Control	LS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.	38.792956 ° -121.696025 °	38.792956 ° -121.696025 °	8 Y
25	2.22	2.22	Earthen Levee	Encroachments	LS	M	Pipe	38.792499 ° -121.695508 °	38.792499 ° -121.695508 °	40 Y
26	2.22	2.22	Earthen Levee	Animal Control	LS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.	38.792428 ° -121.695495 °	38.792428 ° -121.695495 °	35 Y
27	2.24	2.24	Earthen Levee	Encroachments	LS	M	Firewood	38.792283 ° -121.695447 °	38.792283 ° -121.695447 °	39 Y
28	2.25	2.25	Earthen Levee	Animal Control	LS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.	38.792128 ° -121.695400 °	38.792128 ° -121.695400 °	41 Y
29	2.30	2.30	Earthen Levee	Trim / Thin Trees	WS	U	Trim and thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: tree fell across crown, but still accessible. Tree needs to cut up and remove or burned.	38.791321 ° -121.695261 °	38.791321 ° -121.695261 °	52 Y
30	2.62	2.62	Earthen Levee	Encroachments	LS	PO	Buildings	38.786964 ° -121.694239 °	38.786964 ° -121.694239 °	11 Y
31	2.97	2.97	Earthen Levee	Animal Control	LS	M	No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.	38.782985 ° -121.691518 °	38.782985 ° -121.691518 °	14
32	2.97	2.97	Earthen Levee	Encroachments	LS	C	Prunings	38.782985 ° -121.691518 °	38.782985 ° -121.691518 °	13
33	3.12	3.19	Earthen Levee	Encroachments	LS	PO	Buildings	38.781828 ° -121.689415 °	38.780852 ° -121.688887 °	12 Y
34	3.16	3.16	Earthen Levee	Encroachments	WS	M	Prunings	38.781358 ° -121.689118 °	38.781358 ° -121.689118 °	34 Y

*** Location**

LS : Landside
WS : Waterside
CR : Crown

**** Rating**

A : Acceptable
M : Minimally Acceptable
U : Unacceptable
PO : Partially Obstructing
CO : Completely Obstructing
N : Not Inspected/Rated
C : Corrected
W : Watch/Monitor

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway					Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing					Right	5.97	03/15/2011 03/17/2011	John Williamson

LMR No.	Levee Mile		Category	Item	* Location	** Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
35	3.25	3.25	Earthen Levee	Trim / Thin Trees	WS	M	Trim and thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: dead tree broken during winter storms, needs to be cleaned up	38.780041 ° -121.688499 °	38.780041 ° -121.688499 °	15 Y
36	3.33	3.33	Earthen Levee	Trim / Thin Trees	WS	M	Trim and thin trees to allow visibility of the ground and room to flood fight. Inspector Comments: fallen tree from winter storms, needs to be cleaned up	38.779046 ° -121.687839 °	38.779046 ° -121.687839 °	16 Y
37	3.40	3.40	Earthen Levee	Encroachments	LS	C	Prunings	38.778167 ° -121.687357 °	38.778167 ° -121.687357 °	17
38	4.74	4.95	Supplemental	USACE Erosion Survey	WS	U	Inspector Comments: 2009: 5 ft berm, 1.5:1 slope, slumping, silts, 3.21 ft/s [2009 SiteID:SAC_85-4_R]	38.763314 ° -121.684039 °	38.763486 ° -121.687567 °	33 Y
39	5.60	5.65	Earthen Levee	Encroachments	LS	PO	Buildings	38.759620 ° -121.673903 °	38.759412 ° -121.673167 °	1

<p>* Location</p> <p>LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p> <p>PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated</p> <p>C : Corrected W : Watch/Monitor</p>
---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson


Levee Mile Report Line	3
Start Levee Mile	0.12
End Levee Mile	0.20
Location	Water Side
Category	Earthen Levee
Item	Vegetation
Remove all brush except grasses	
johngw_s_20110228_145.jpg	



Levee Mile Report Line	4
Start Levee Mile	0.15
End Levee Mile	0.15
Location	Land Side
Category	Earthen Levee
Item	Trim / Thin Trees
Fig tree on landside other trees need to be trimmed	
johngw_s_20110228_165.jpg	



Levee Mile Report Line	5
Start Levee Mile	0.15
End Levee Mile	0.15
Location	Water Side
Category	Earthen Levee
Item	Encroachments
Building on waterside	
johngw_s_20110228_164.jpg	

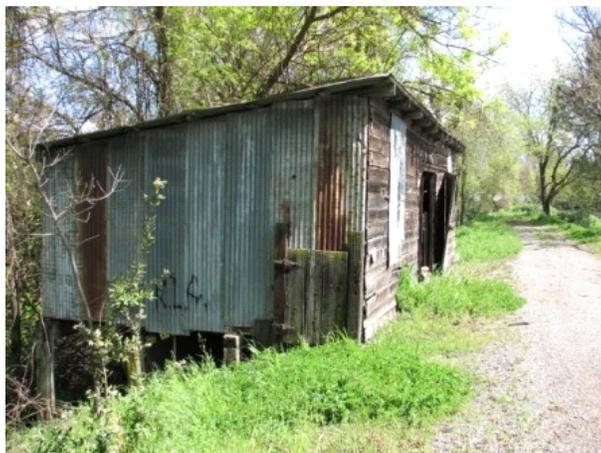

* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	6
Start Levee Mile	0.22
End Levee Mile	0.26
Location	Land Side
Category	Earthen Levee
Item	Encroachments
RV park trailers and vehicles on levee	
johngw_s_20110228_163.jpg	



Levee Mile Report Line	7
Start Levee Mile	0.31
End Levee Mile	0.33
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Fence across levee	
johngw_s_20110228_161.jpg	



Levee Mile Report Line	7
Start Levee Mile	0.31
End Levee Mile	0.33
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Landscape on levee slope	
johngw_s_20110228_162.jpg	



* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	8
Start Levee Mile	0.35
End Levee Mile	0.39
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Apartments and fence	
johngw_s_20110228_160.jpg	



Levee Mile Report Line	9
Start Levee Mile	0.50
End Levee Mile	0.57
Location	Water Side
Category	Earthen Levee
Item	Encroachments
On levee crown	
johngw_s_20110228_158.jpg	



Levee Mile Report Line	10
Start Levee Mile	0.51
End Levee Mile	0.57
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Houses on levee	
johngw_s_20110228_159.jpg	



* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	11
Start Levee Mile	0.57
End Levee Mile	0.71
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Oleanders along shoulder	
johngw_s_20110228_156.jpg	



Levee Mile Report Line	12
Start Levee Mile	0.57
End Levee Mile	0.65
Location	Water Side
Category	Earthen Levee
Item	Encroachments
Yacht club	
johngw_s_20110228_157.jpg	



Levee Mile Report Line	13
Start Levee Mile	0.73
End Levee Mile	0.73
Location	Land Side
Category	Earthen Levee
Item	Vegetation
The berry vines block good visibility to see levee slope.	
johngw_s_20110321_394.jpg	



<p>* Location</p> <p>LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p>	<p>PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated</p>	<p>C : Corrected W : Watch/Monitor</p>
---	---	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	16
Start Levee Mile	0.97
End Levee Mile	1.14
Location	Land Side
Category	Earthen Levee
Item	Vegetation
Vegetation on landside	
johngw_s_20110228_155.jpg	



Levee Mile Report Line	17
Start Levee Mile	1.18
End Levee Mile	1.34
Location	Land Side
Category	Earthen Levee
Item	Vegetation
Vegetation on landside	
johngw_s_20110228_154.jpg	



Levee Mile Report Line	18
Start Levee Mile	1.40
End Levee Mile	1.40
Location	Land Side
Category	Earthen Levee
Item	Vegetation
The landside levee slope has a well maintained grass.	
johngw_s_20110321_395.jpg	



<p>* Location</p> <p>LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p>	<p>PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated</p>	<p>C : Corrected W : Watch/Monitor</p>
---	---	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	19
Start Levee Mile	1.47
End Levee Mile	1.47
Location	Water Side
Category	Earthen Levee
Item	Vegetation
The waterside slope is well maintained.	
johngw_s_20110321_396.jpg	



Levee Mile Report Line	20
Start Levee Mile	1.78
End Levee Mile	1.78
Location	Water Side
Category	Earthen Levee
Item	Encroachments
prunings	
johngw_s_20110228_146.jpg	



Levee Mile Report Line	21
Start Levee Mile	1.91
End Levee Mile	1.91
Location	Land Side
Category	Earthen Levee
Item	Encroachments
sprinklers and landscape	
johngw_s_20110228_147.jpg	



* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	24
Start Levee Mile	2.18
End Levee Mile	2.18
Location	Land Side
Category	Earthen Levee
Item	Animal Control
<p>There is multiple rodent holes but no visiable rodents. Need to backfill and compact.</p>	
<p>johngw_s_20110321_397.jpg</p>	



Levee Mile Report Line	25
Start Levee Mile	2.22
End Levee Mile	2.22
Location	Land Side
Category	Earthen Levee
Item	Encroachments
<p>Pipe along toe</p>	
<p>johngw_s_20110228_168.jpg</p>	



Levee Mile Report Line	26
Start Levee Mile	2.22
End Levee Mile	2.22
Location	Land Side
Category	Earthen Levee
Item	Animal Control
<p>A rodent hole needs to be backfilled and compacted.</p>	
<p>johngw_s_20110321_398.jpg</p>	



<p>* Location LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable</p>	<p>PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated</p>	<p>C : Corrected W : Watch/Monitor</p>
---	---	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	27
Start Levee Mile	2.24
End Levee Mile	2.24
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Firewood stacked up	
johngw_s_20110228_167.jpg	



Levee Mile Report Line	28
Start Levee Mile	2.25
End Levee Mile	2.25
Location	Land Side
Category	Earthen Levee
Item	Animal Control
Rodents	
johngw_s_20110228_169.jpg	



Levee Mile Report Line	29
Start Levee Mile	2.30
End Levee Mile	2.30
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees
Tree across levee	
johngw_s_20110228_171.jpg	



* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	29
Start Levee Mile	2.30
End Levee Mile	2.30
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees
Water side view	
johngw_s_20110228_172.jpg	



Levee Mile Report Line	30
Start Levee Mile	2.62
End Levee Mile	2.62
Location	Land Side
Category	Earthen Levee
Item	Encroachments
Garage at toe	
johngw_s_20110228_148.jpg	



Levee Mile Report Line	33
Start Levee Mile	3.12
End Levee Mile	3.19
Location	Land Side
Category	Earthen Levee
Item	Encroachments
The buildings are encroaching into the levee slope.	
johngw_s_20110321_399.jpg	



<p>* Location</p> <p>LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p>	<p>PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated</p>	<p>C : Corrected W : Watch/Monitor</p>
---	---	---	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	34
Start Levee Mile	3.16
End Levee Mile	3.16
Location	Water Side
Category	Earthen Levee
Item	Encroachments
Multiple piles of wooden debris along shoulder along with fallen tree.	
johngw_s_20110321_400.jpg	



Levee Mile Report Line	35
Start Levee Mile	3.25
End Levee Mile	3.25
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees
Branches from dead trees, water side	
johngw_s_20110228_150.jpg	



Levee Mile Report Line	36
Start Levee Mile	3.33
End Levee Mile	3.33
Location	Water Side
Category	Earthen Levee
Item	Trim / Thin Trees
Winter storm damage	
johngw_s_20110228_151.jpg	



* Location LS : Landside WS : Waterside CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	PO : Partially Obstructing CO : Completely Obstructing N : Not Inspected/Rated	C : Corrected W : Watch/Monitor
--	--	--	------------------------------------

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2011

Yolo County Service Area 6

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Right Bank of Sacramento River at Knights Landing	Right	5.97	03/15/2011 03/17/2011	John Williamson

Levee Mile Report Line	38
Start Levee Mile	4.74
End Levee Mile	4.95
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
2009: 5 ft berm, 1.5:1 slope, slumping, silts, 3.21 ft/s [2009 SiteID:SAC_85-4_R]	
johngw_s_20110228_166.JPG	



<p>* Location</p> <p>LS : Landside WS : Waterside CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable PO : Partially Obstructing C : Corrected M : Minimally Acceptable CO : Completely Obstructing W : Watch/Monitor U : Unacceptable N : Not Inspected/Rated</p>
---	---