

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2019

### Reclamation District No. 0765 Glide

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	11/12/2019 11/12/2019	Luz Dial

LM Start		Rating **	M	Issue No.	<b>18</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2013_18				
Comment Code					
Inspector Comment					
The LMA does not have an adequate supply of flood fight materials.					

No Photos

LM Start		Rating **	A	Issue No.	<b>44</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_44				
Comment Code					
Inspector Comment					
LMA has a copy of O&M manual on file in office.					

No Photos

LM Start		Rating **	A	Issue No.	<b>46</b>
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0765_01_s_2012_46				
Comment Code					
Inspector Comment					
LMA plans to attend flood fight training on November 2019					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2019**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	11/12/2019 11/12/2019	Luz Dial

LM Start	0.05	Rating **	C	Issue No.	3
LM End	0.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.502253 °	38.502253 °
				-121.560192 °	-121.560192 °
DWR ID	DWR_RD0765_01_s_2012_3				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Trim trees that are blocking view of the landside slope.					

No Photos

LM Start	0.43	Rating **	M	Issue No.	10
LM End	0.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.496717 °	38.495810 °
				-121.560023 °	-121.559520 °
DWR ID	DWR_RD0765_01_f_2019_10				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild growth of invasive plants.					

Photo 1 of 1 : FA\_2019\_RD0765\_211\_10\_20191112\_00048.jpg



View of invasive wild growth on the landside slope. Fall 2019

LM Start	0.75	Rating **	M	Issue No.	68
LM End	0.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.492705 °	38.492705 °
				-121.557193 °	-121.557193 °
DWR ID	DWR_RD0765_01_s_2017_68				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair tire rut damage on LS shoulder.					

Photo 1 of 2 : FA\_2019\_RD0765\_211\_68\_20190904\_00034.jpg



Looking south on landside slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

# Reclamation District No. 0765 Glide

Photo 2 of 2 : FA\_2019\_RD0765\_211\_68\_20190904\_00035.jpg



Looking south at levee damage caused by vehicle traffic. (Spring 2017)

Photo 1 of 1 : FA\_2019\_RD0765\_211\_63\_20190904\_00032.jpg



View of brush on levee slope. Fall 2018

Photo 1 of 1 : FA\_2019\_RD0765\_211\_24\_20190904\_00015.jpg



View looking downstream at footpath that cuts into levee slope. Spring 2019

* Location	** Rating	+ Issue Type
LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	A : Acceptable                      N : Not Inspected/Rated M : Minimally Acceptable        C : Corrected U : Unacceptable                   A/W : Acceptable but Monitor & Maintain	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement



**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2019**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	11/12/2019 11/12/2019	Luz Dial

LM Start	0.95	Rating **	M	Issue No.	23
LM End	0.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			38.490067°	38.490067°
				-121.555530°	-121.555530°
DWR ID	DWR_RD0765_01_s_2019_23				
Comment Code					
S2 : Repair the levee slope damaged by foot traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : FA\_2019\_RD0765\_211\_23\_20190904\_00014.jpg



View looking east at footpath that cuts into levee slope. Spring 2019

LM Start	0.96	Rating **	M	Issue No.	11
LM End	0.97	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.489980 °	38.489788 °
				-121.555532 °	-121.555467 °
DWR ID	DWR_RD0765_01_f_2019_11				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild vines on levee slope.					

No Photos

LM Start	1.08	Rating **	M	Issue No.	14
LM End	1.08	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.488442 °	38.488442 °
				-121.554685 °	-121.554685 °
DWR ID	DWR_RD0765_01_f_2019_14				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Trim wild growth on levee slope.					

No Photos

\* Location  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

\*\* Rating  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

+ Issue Type  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

## Reclamation District No. 0765 Glide

View of vines and grown on LS slope.

View looking upstream at fallen tree on levee slope. Spring 2019

View looking downstream at tree log on levee slope. Spring 2019





## Reclamation District No. 0765 Glide

View of tall brush on levee slope. Fall 2018

Page 7 of 10







**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2019**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	11/12/2019 11/12/2019	Luz Dial

LM Start	1.53	Rating **	C	Issue No.	28
LM End	1.53	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.482607 °	38.482607 °
				-121.550885 °	-121.550885 °
DWR ID	DWR_RD0765_01_s_2019_28				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove wild growth down to 20' from levee shoulder.					


No Photos

LM Start	1.58	Rating **	C	Issue No.	17
LM End	1.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.481973 °	38.481973 °
				-121.550547 °	-121.550547 °
DWR ID	DWR_RD0765_01_s_2019_17				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

LM Start	1.58	Rating **	M	Issue No.	1
LM End	1.58	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.481959 °	38.481959 °
				-121.550527 °	-121.550527 °
DWR ID	DWR_RD0765_01_f_2017_1				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove fallen tree on waterside slope.					

Photo 1 of 1 : FA\_2019\_RD0765\_211\_1\_20190904\_00001.jpg

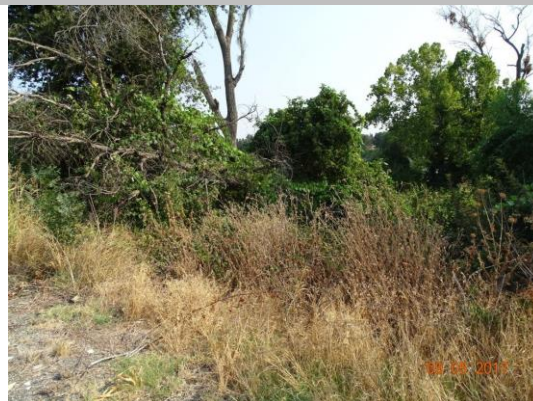

View looking north at the fallen tree. Fall 2017

**\* Location**

LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**

A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**

Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2019**

**Reclamation District No. 0765 Glide**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Sacramento River	Right	1.72	11/12/2019 11/12/2019	Luz Dial

LM Start	1.67	Rating **	M	Issue No.	13
LM End	1.68	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.480763 °	38.480632 °
				-121.549581 °	-121.549543 °
DWR ID	DWR_RD0765_01_s_2012_13				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove large tree branch on waterside slope.					

Photo 1 of 2 : FA\_2019\_RD0765\_211\_13\_20190904\_00009.jpg



Looking northwest at tree limb in vegetation on waterside slope. Fall 2017

LM Start	<b>1.67</b>	Rating **	M	Issue No.	<b>13 (cont)</b>
LM End	<b>1.68</b>	Issue Type +	Ma	Location *	WS

Photo 2 of 2 : FA\_2019\_RD0765\_211\_13\_20190904\_00010.jpg



Looking northwest at large tree limb on waterward slope.

**\* Location**  
LS : Land Side    N/A : Not Applicable  
WS : Water Side  
CR : Crown

**\*\* Rating**  
A : Acceptable                      N : Not Inspected/Rated  
M : Minimally Acceptable        C : Corrected  
U : Unacceptable                  A/W : Acceptable but Monitor & Maintain

**+ Issue Type**  
Ma : Maintenance Deficiency  
Ob : Design & System Obsolescence  
En : Enforcement