

**Flood Control Project Maintenance
Levee Inspections**
LMA District Cover Sheet
Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

	Spring (March - May)	Summer ** (June - August)	Fall (September - November)	Winter ** (December - February)
* Overall LMA Rating (Fall Only)				

** Non-receipt of Summer or Winter Inspection Reports may effect overall annual rating.

* **SPRING INSPECTIONS:** Overall maintenance ratings are not determined for the spring inspection results. Individual maintenance deficiencies are rated using the same criteria in the spring and in the fall.

FALL INSPECTIONS: The overall maintenance rating shown above is based on operation and maintenance deficiencies identified within the attached unit inspection reports. This rating is not intended to be an indication of risk.

Comments

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway		Bank	Unit Miles
Unit No. 01 Yuba River		Left	2.22

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By	Steve Fordice RD 784			
	Patrick Meagher RD 784			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.22	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1				Operations & Maintenance Manuals	WS	A Ma		°	°	4
DWR ID: DWR_RD0784_01_s_2013_4										
2				Emergency Supplies & Equipment	WS	A Ma		°	°	5
DWR ID: DWR_RD0784_01_s_2013_5										
3				Flood Preparedness & Training	WS	A Ma		°	°	6
DWR ID: DWR_RD0784_01_s_2013_6										
4	0.06	2.21		Vegetation	LS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	39.134253 ° -121.553002 °	39.125914 ° -121.588625 °	1 Y
DWR ID: DWR_RD0784_01_s_2013_1										
5	0.06	2.21		Vegetation	WS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	39.134252 ° -121.553002 °	39.125915 ° -121.588625 °	3 Y
DWR ID: DWR_RD0784_01_s_2013_3										
6	0.52	1.00		Encroachments	LS	U En	UR : Urban	39.131558 ° -121.560668 °	39.129475 ° -121.569209 °	12 Y
DWR ID: DWR_RD0784_01_f_2012_12										
7	1.00	1.12		Encroachments	LS	U En	FE : Fence	39.129475 ° -121.569210 °	39.129615 ° -121.571371 °	13 Y
DWR ID: DWR_RD0784_01_f_2012_13										
8	1.28	1.28		Vegetation	WS	M Ma	V4 : Elderberries are blocking visibility and flood fight capability.	39.129783 ° -121.574384 °	39.129783 ° -121.574384 °	2 Y
DWR ID: DWR_RD0784_01_s_2012_2										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.22	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	4
Start Levee Mile	0.06
End Levee Mile	2.21
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130424_263.JPG	



Levee Mile Report Line	5
Start Levee Mile	0.06
End Levee Mile	2.21
Location	Water Side
Category	
Item	Vegetation
Typical W/S vegetation.	
rburnett_s_20130424_262.JPG	



Levee Mile Report Line	6
Start Levee Mile	0.52
End Levee Mile	1.00
Location	Land Side
Category	
Item	Encroachments
Levee mile 0.53-1.00, this photo shows the fences and other obstruction near the toe of the levee on the landside.	
jhirabay_s_20130314_040.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Yuba River	Left	2.22	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	7
Start Levee Mile	1.00
End Levee Mile	1.12
Location	Land Side
Category	
Item	Encroachments
Levee mile 1.00-1.12, this photo shows a fence near the levee toe on the landside.	
jhirabay_s_20130314_041.JPG	



Levee Mile Report Line	8
Start Levee Mile	1.28
End Levee Mile	1.28
Location	Water Side
Category	
Item	Vegetation
W/S slope vegetation, Elderberry.	
jhirabay_s_20130314_039.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 02A Feather River	Left	2.70

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02A Feather River	Left	2.70	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.00	2.31		Vegetation	LS	M	V1 : Control annual grass and weeds on the levee slopes and easements.	39.125452 °	°	1
					Ma			-121.588633 °	°	Y
DWR ID: DWR_RD0784_02A_s_2013_1										
2	0.01	2.31		Vegetation	WS	M	V1 : Control annual grass and weeds on the levee slopes and easements.	39.125583 °	39.096904 °	2
					Ma			-121.588665 °	-121.585486 °	Y
DWR ID: DWR_RD0784_02A_s_2013_2										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02A Feather River	Left	2.70	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	0.00
End Levee Mile	2.31
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130424_264.JPG	



Levee Mile Report Line	2
Start Levee Mile	0.01
End Levee Mile	2.31
Location	Water Side
Category	
Item	Vegetation
Typical W/S vegetation.	
rburnett_s_20130424_265.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 02B Feather River	Left	3.96

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02B Feather River	Left	3.96	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	8.72	9.14	Supplemental	USACE Erosion Survey	WS	M Ma	Inspector Comments: 2003 - Bank is near vertical. Identified as a Potentially Critical site. 2004 - Eddy flow off downstream end of Modesto formation eroding the fluvial sediments. 2005 - Some new slumping. Actively eroding but berm width is greater than 50 ft. 2006 - Downgraded to regular erosion site. Still actively eroding. Large old rotational failures in high bank on the downstream end. 2008 - Removed from inventory due to wide berm width does not meet criteria for an erosion site. 2010 - Added back to the inventory after 10 ft of bank erosion in the winter 2009 storm. Steep vertical face. 2011 - Bank has retreated an additional 2.5 ft from last year. New tree popouts and erosion throughout the site. 2012: Site continues to worsen with new tree popouts and many areas of new erosion. [2012 Site ID: FHR_17-8_L]	39.009366 ° -121.579766 °	39.004549 ° -121.579143 °	2 Y
DWR ID: DWR_RD0784_02_s_2013_2										
2	9.01	12.85		Vegetation	WS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	39.009276 ° -121.578688 °	38.954650 ° -121.574705 °	5
DWR ID: DWR_RD0784_02A_s_2013_4										
3	9.01	12.85		Vegetation	LS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	39.009276 ° -121.578687 °	38.954650 ° -121.574706 °	3
DWR ID: DWR_RD0784_02A_s_2013_3										
4	9.21	9.29		Encroachments	LS	U En	MA : Material Inspector Comments: Paving at toe.	39.006523 ° -121.577843 °	39.005235 ° -121.578286 °	6 Y
DWR ID: DWR_RD0784_02_f_2012_6										
5	9.29	9.29		Encroachments	LS	U En	MA : Material Inspector Comments: Truck trailers and other material near the landside levee toe.	39.002313 ° -121.579344 °	39.002313 ° -121.579344 °	7 Y
DWR ID: DWR_RD0784_02_f_2012_7										
6	9.40	9.40		Encroachments	LS	U En	BU : Building	39.003905 ° -121.578774 °	39.003905 ° -121.578774 °	1 Y
DWR ID: DWR_RD0784_02_s_2012_1										
7	9.43	9.43		Encroachments	LS	U En	EQ : Equipment	39.003438 ° -121.578920 °	39.003438 ° -121.578920 °	9
DWR ID: DWR_RD0784_02A_s_2013_6										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02B Feather River	Left	3.96	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	8.72
End Levee Mile	9.14
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #1	
jhirabay_s_20130314_043.jpg	



Levee Mile Report Line	1
Start Levee Mile	8.72
End Levee Mile	9.14
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #2	
jhirabay_s_20130314_044.jpg	



Levee Mile Report Line	1
Start Levee Mile	8.72
End Levee Mile	9.14
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #3	
jhirabay_s_20130314_045.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013


Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02B Feather River	Left	3.96	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	8.72
End Levee Mile	9.14
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #4	
jhirabay_s_20130314_046.jpg	



Levee Mile Report Line	1
Start Levee Mile	8.72
End Levee Mile	9.14
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #5	
jhirabay_s_20130314_047.jpg	

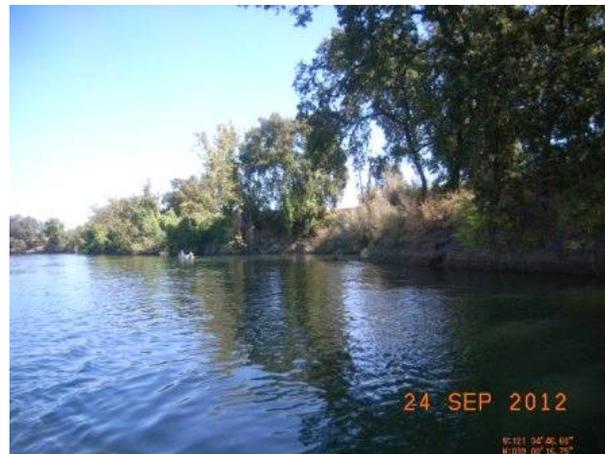

Levee Mile Report Line	4
Start Levee Mile	9.21
End Levee Mile	9.29
Location	Land Side
Category	
Item	Encroachments
Levee mile 9.21, new paving near the levee toe, no permit found for this work.	
jhirabay_s_20130314_048.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02B Feather River	Left	3.96	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	5
Start Levee Mile	9.29
End Levee Mile	9.29
Location	Land Side
Category	
Item	Encroachments
Levee mile 9.29, truck trailers and other material near the landside levee toe.	
jhirabay_s_20130314_049.JPG	



Levee Mile Report Line	5
Start Levee Mile	9.29
End Levee Mile	9.29
Location	Land Side
Category	
Item	Encroachments
Levee mile 9.29, other material at or near the landside levee toe.	
jhirabay_s_20130314_050.JPG	



Levee Mile Report Line	6
Start Levee Mile	9.40
End Levee Mile	9.40
Location	Land Side
Category	
Item	Encroachments
Levee mile 9.40, looking at a building that is encroaching on the levee toe.	
jhirabay_s_20130314_042.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway		Bank	Unit Miles
Unit No. 03A Bear River		Right	0.84

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03A Bear River	Right	0.84	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	2.88	2.88		Vegetation	WS	A	V1 : Control annual grass and weeds on the levee slopes and easements.	38.973800 °	38.973800 °	1
					Ma			-121.541400 °	-121.541400 °	Y

DWR ID: DWR_RD0784_03A_s_2013_1

<p>* Location</p> <p>LS : Land Side WS : Water Side CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p> <p>N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain</p>	<p>+ Issue Type</p> <p>Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement</p>
---	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03A Bear River	Right	0.84	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	2.88
End Levee Mile	2.88
Location	Water Side
Category	
Item	Vegetation
Levee has been recently grazed.	
rburnett_s_20130425_285.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 03B Bear River	Right	1.50

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By	Steve Fordice RD 784			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03B Bear River	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

LMR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	3.23	4.71		Vegetation	WS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	38.974295 ° -121.531817 °	38.985442 ° -121.510721 °	4 Y
DWR ID: DWR_RD0784_03B_s_2013_4										
2	3.51	4.71		Vegetation	LS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	38.974138 ° -121.527600 °	38.985441 ° -121.510721 °	2 Y
DWR ID: DWR_RD0784_03B_s_2013_2										
3	4.30	4.31	Supplemental	USACE Erosion Survey	WS	M Ma	Inspector Comments: 2009 - Small site which could be repaired with maintenance. Erosion into the levee toe, rock has started to fail. 2012: No observed change. [2012 Site ID: BER_4-9_R]	38.981400 ° -121.515848 °	38.981271 ° -121.515999 °	1 Y
DWR ID: DWR_RD0784_03_s_2013_1										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03B Bear River	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	3.23
End Levee Mile	4.71
Location	Water Side
Category	
Item	Vegetation
Typical W/S vegetation.	
rburnett_s_20130425_279.JPG	



Levee Mile Report Line	2
Start Levee Mile	3.51
End Levee Mile	4.71
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130425_278.JPG	



Levee Mile Report Line	3
Start Levee Mile	4.30
End Levee Mile	4.31
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #1	
jhirabay_s_20130314_051.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 03B Bear River	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	3
Start Levee Mile	4.30
End Levee Mile	4.31
Location	Water Side
Category	Supplemental
Item	USACE Erosion Survey
USACE 2012 Photo #2	
jhirabay_s_20130314_052.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway		Bank	Unit Miles
Unit No. 04 Interceptor Canal		Right	6.35

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By	Steve Fordice RD 784			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Interceptor Canal	Right	6.35	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	4.31	4.43		Erosion / Bank Caving	CR	A Ma	E1 : Note and monitor erosion site.	39.036594 ° -121.542377 °	39.038493 ° -121.542380 °	4 Y
DWR ID: DWR_RD0784_04_s_2012_4										
2	4.87	5.83		Vegetation	LS	M Ma	V1 : Control annual grass and weeds on the levee slopes and easements.	39.044676 ° -121.542433 °	39.058542 ° -121.542603 °	1
DWR ID: DWR_RD0784_04_s_2013_1										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 04 Interceptor Canal	Right	6.35	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	4.31
End Levee Mile	4.43
Location	Crown
Category	
Item	Erosion / Bank Caving
Levee mile 4.31, looking at a crack near the landside shoulder with a temporary repair.	
jhirabay_s_20130314_053.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway		Bank	Unit Miles
Unit No. 05 Interceptor Canal		Left	4.20

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By	Steve Fordice RD 784			

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.20	04/24/2013 04/24/2013	Rick Burnett

LMR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.00	4.19		Vegetation	WS Ma	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.974762 ° -121.532703 °	39.020562 ° -121.509155 °	2 Y
DWR ID: DWR_RD0784_05_s_2013_2										
2	0.00	4.19		Vegetation	LS Ma	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.974761 ° -121.532703 °	39.020562 ° -121.509154 °	1 Y
DWR ID: DWR_RD0784_05_s_2013_1										
3	1.08	1.72		Encroachments	LS En	M	DT : Ditch	38.989955 ° -121.535672 °	38.999068 ° -121.537462 °	10 Y
DWR ID: DWR_RD0784_05_s_2012_10										
4	2.10	3.06		Encroachments	LS En	M	DT : Ditch	39.004562 ° -121.538482 °	39.015593 ° -121.528533 °	9 Y
DWR ID: DWR_RD0784_05_s_2012_9										
5	2.19	2.19		Vegetation	LS Ma	M	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: berries	39.005824 ° -121.538705 °	39.005824 ° -121.538705 °	7 Y
DWR ID: DWR_RD0784_05_f_2012_7										
6	2.51	3.36		Encroachments	LS En	U	FE : Fence	39.009439 ° -121.535210 °	39.017779 ° -121.524150 °	5 Y
DWR ID: DWR_RD0784_05_s_2013_5										
7	2.98	2.98		Erosion / Bank Caving	WS Ma	M	E2 : Schedule repair of erosion site prior to the next inspection.	39.014631 ° -121.529577 °	39.014631 ° -121.529577 °	3 Y
DWR ID: DWR_RD0784_05_s_2013_3										
8	3.88	4.19		Vegetation	CR Ma	M	V9 : Keep the crown roadway free of vegetation.	39.019540 ° -121.514710 °	39.020552 ° -121.509206 °	4 Y
DWR ID: DWR_RD0784_05_s_2013_4										
9	3.89	4.20		Vegetation	WS Ma	M	V2 : Remove the wild growth other than native grasses from the levee slopes.	39.019567 ° -121.514560 °	39.020545 ° -121.509080 °	86 Y
DWR ID: DWR_RD0784_05_s_2012_86										
10	3.89	4.20		Vegetation	LS Ma	M	V2 : Remove the wild growth other than native grasses from the levee slopes.	39.019566 ° -121.514560 °	39.020545 ° -121.509078 °	83 Y
DWR ID: DWR_RD0784_05_s_2012_83										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.20	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	0.00
End Levee Mile	4.19
Location	Water Side
Category	
Item	Vegetation
W/S vegetation.	
rburnett_s_20130424_274.JPG	



Levee Mile Report Line	3
Start Levee Mile	1.08
End Levee Mile	1.72
Location	Land Side
Category	
Item	Encroachments
Ditch at L/S toe.	
rburnett_s_20130424_277.JPG	



Levee Mile Report Line	6
Start Levee Mile	2.51
End Levee Mile	3.36
Location	Land Side
Category	
Item	Encroachments
Fence at L/S levee toe.	
rburnett_s_20130424_276.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 05 Interceptor Canal	Left	4.20	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	7
Start Levee Mile	2.98
End Levee Mile	2.98
Location	Water Side
Category	
Item	Erosion / Bank Caving
Levee mile 2.98, erosion near the waterside levee toe.	
jhirabay_s_20130314_054.JPG	



Levee Mile Report Line	9
Start Levee Mile	3.89
End Levee Mile	4.20
Location	Water Side
Category	
Item	Vegetation
This photo shows the waterside vegetation at levee mile 4.20.	
jhirabay_s_20130314_056.jpg	



Levee Mile Report Line	10
Start Levee Mile	3.89
End Levee Mile	4.20
Location	Land Side
Category	
Item	Vegetation
This photo shows the landside vegetation at levee mile 4.20.	
jhirabay_s_20130314_055.jpg	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 06 South Dry Creek	Right	1.50

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.00	1.26		Vegetation	WS Ma	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.985588 ° -121.510432 °	38.996886 ° -121.491954 °	6 Y
DWR ID: DWR_RD0784_06_s_2013_6										
2	0.00	1.26		Vegetation	LS Ma	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.985589 ° -121.510431 °	38.996886 ° -121.491955 °	1 Y
DWR ID: DWR_RD0784_06_s_2013_1										
3	0.25	1.27		Vegetation	WS Ma	A	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.987560 ° -121.506611 °	38.996953 ° -121.491973 °	4 Y
DWR ID: DWR_RD0784_06_s_2012_4										
4	0.25	1.27		Vegetation	LS Ma	A	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.987560 ° -121.506611 °	38.996955 ° -121.491830 °	2 Y
DWR ID: DWR_RD0784_06_s_2012_2										
5	0.32	0.39		Vegetation	LS Ma	A	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berry bushes along lower slope.	38.988314 ° -121.505273 °	38.988710 ° -121.504499 °	3 Y
DWR ID: DWR_RD0784_06_f_2012_3										
6	0.54	0.79		Vegetation	LS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berry bushes along lower slope.	38.989961 ° -121.502009 °	38.992220 ° -121.498198 °	8 Y
DWR ID: DWR_RD0784_06_f_2012_8										
7	0.58	0.58		Vegetation	WS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Berries and saplings on the slope.	38.990201 ° -121.501522 °	38.990201 ° -121.501522 °	7 Y
DWR ID: DWR_RD0784_06_f_2012_7										
8	0.68	0.68	Interior Drainage & Piping Systems	Culverts: Breaks / Holes / Cracks	WS Ma	U		38.991084 ° -121.499871 °	38.991084 ° -121.499871 °	11 Y
DWR ID: DWR_RD0784_06_f_2012_11										
9	0.85	1.26		Encroachments	LS En	M	FE : Fence	38.992669 ° -121.497525 °	38.996885 ° -121.491956 °	15 Y
DWR ID: DWR_RD0784_06_s_2013_15										
10	0.85	0.85		Vegetation	LS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes. Inspector Comments: Dense berry bushes along lower slope.	38.992657 ° -121.497542 °	38.992657 ° -121.497542 °	9 Y
DWR ID: DWR_RD0784_06_f_2012_9										
11	1.17	1.17	Interior Drainage & Piping Systems	Culverts: Breaks / Holes / Cracks	WS Ma	U		38.995856 ° -121.493110 °	38.995856 ° -121.493110 °	10 Y
DWR ID: DWR_RD0784_06_f_2012_10										
12	1.26	1.33	Interior Drainage & Piping Systems	Culverts: Inlets / Outlets	WS Ma	M		° °	° °	16 Y
DWR ID: DWR_RD0784_06_f_2012_16										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

LMR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
13	1.27	1.50		Vegetation	LS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.997019 ° -121.491802 °	38.999719 ° -121.490147 °	12
DWR ID: DWR_RD0784_06_f_2012_12										
14	1.27	1.50		Vegetation	WS Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.997019 ° -121.491802 °	38.999719 ° -121.490148 °	13
DWR ID: DWR_RD0784_06_f_2012_13										
15	1.27	1.50		Vegetation	CR Ma	U	V2 : Remove the wild growth other than native grasses from the levee slopes.	38.997019 ° -121.491802 °	38.999719 ° -121.490147 °	14 Y
DWR ID: DWR_RD0784_06_f_2012_14										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	0.00
End Levee Mile	1.26
Location	Water Side
Category	
Item	Vegetation
Typical W/S vegetation.	
rburnett_s_20130425_280.JPG	



Levee Mile Report Line	2
Start Levee Mile	0.00
End Levee Mile	1.26
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130425_281.JPG	



Levee Mile Report Line	5
Start Levee Mile	0.32
End Levee Mile	0.39
Location	Land Side
Category	
Item	Vegetation
Levee mile 0.39 looking downstream at the vegetation on the slope. The slope is maintained by RD 817 in unit 3.	
jhirabay_s_20130314_057.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	6
Start Levee Mile	0.54
End Levee Mile	0.79
Location	Land Side
Category	
Item	Vegetation
Levee mile 0.54, the landside slope.	
jhirabay_s_20130314_058.JPG	



Levee Mile Report Line	8
Start Levee Mile	0.68
End Levee Mile	0.68
Location	Water Side
Category	Interior Drainage & Piping Systems
Item	Culverts: Breaks / Holes / Cracks
Levee mile 0.68, this is located near the low flow channel, the flap gate is lying on the ground, the end of the pipe was not located.	
jhirabay_s_20130314_060.JPG	



Levee Mile Report Line	8
Start Levee Mile	0.68
End Levee Mile	0.68
Location	Water Side
Category	Interior Drainage & Piping Systems
Item	Culverts: Breaks / Holes / Cracks
CMP is rusting and has numerous holes but flap gate is in place. 4/25/13 - Burnett	
rburnett_s_20130425_282.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	8
Start Levee Mile	0.68
End Levee Mile	0.68
Location	Water Side
Category	Interior Drainage & Piping Systems
Item	Culverts: Breaks / Holes / Cracks
L/S Intake at LM 0.68	
rburnett_s_20130425_283.JPG	



Levee Mile Report Line	9
Start Levee Mile	0.85
End Levee Mile	1.26
Location	Land Side
Category	
Item	Encroachments
Wire fence along L/S toe.	
rburnett_s_20130425_284.JPG	



Levee Mile Report Line	11
Start Levee Mile	1.17
End Levee Mile	1.17
Location	Water Side
Category	Interior Drainage & Piping Systems
Item	Culverts: Breaks / Holes / Cracks
Levee mile 1.17 near the low flow channel, it appears a smaller pipe has been sleeved into the larger pipe, the flap gate does not make contact with the smaller pipe.	
jhirabay_s_20130314_059.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 06 South Dry Creek	Right	1.50	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	12
Start Levee Mile	1.26
End Levee Mile	1.33
Location	Water Side
Category	Interior Drainage & Piping Systems
Item	Culverts: Inlets / Outlets

Levee mile 1.33 waterside of the levee, this pipe appears to be sleeved into a larger pipe, access to both ends is limited.

jhirabay_s_20130314_062.jpg



Levee Mile Report Line	15
Start Levee Mile	1.27
End Levee Mile	1.50
Location	Crown
Category	
Item	Vegetation

Levee mile 1.27 looking upstream, typical of the levee from 1.27 to 1.50.

jhirabay_s_20130314_061.JPG



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 07 Yuba River	Left	3.91

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 07 Yuba River	Left	3.91	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	2.18	2.18	Encroachments	WS	U	EQ : Equipment		39.149330 ° -121.518550 °	39.149330 ° -121.518550 °	4 Y
DWR ID: DWR_RD0784_07_s_2012_4										
2	3.88	3.88	Vegetation	WS	M	V1 : Control annual grass and weeds on the levee slopes and easements.		39.165373 ° -121.495929 °	39.165373 ° -121.495929 °	1 Y
DWR ID: DWR_RD0784_07_s_2013_1										
3	3.88	3.88	Vegetation	LS	M	V1 : Control annual grass and weeds on the levee slopes and easements.		39.165376 ° -121.495931 °	39.165376 ° -121.495930 °	2 Y
DWR ID: DWR_RD0784_07_s_2013_2										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 07 Yuba River	Left	3.91	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	2.18
End Levee Mile	2.18
Location	Water Side
Category	
Item	Encroachments
Water side buildings and equipment levee mile 2.18.	
jhirabay_s_20130314_063.jpg	



Levee Mile Report Line	1
Start Levee Mile	2.18
End Levee Mile	2.18
Location	Water Side
Category	
Item	Encroachments
Water side buildings and equipment levee mile 2.18.	
jhirabay_s_20130314_064.jpg	



Levee Mile Report Line	2
Start Levee Mile	3.88
End Levee Mile	3.88
Location	Water Side
Category	
Item	Vegetation
Typical W/S seasonal vegetation.	
rburnett_s_20130424_261.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 07 Yuba River	Left	3.91	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	3
Start Levee Mile	3.88
End Levee Mile	3.88
Location	Land Side
Category	
Item	Vegetation
Typical L/S seasonal vegetation.	
rburnett_s_20130424_260.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway		Bank	Unit Miles
Unit No. 08 Three Rivers		Right	1.88

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 08 Three Rivers	Right	1.88	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	* Location	+ Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.01	1.87		Vegetation	LS	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.955580 ° -121.574734 °	38.969798 ° -121.548089 °	1 Y
DWR ID: DWR_RD0784_08_s_2013_1										
2	0.01	1.87		Vegetation	WS	M	V1 : Control annual grass and weeds on the levee slopes and easements.	38.955577 ° -121.574734 °	38.969798 ° -121.548089 °	2 Y
DWR ID: DWR_RD0784_08_s_2013_2										

* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 08 Three Rivers	Right	1.88	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	0.01
End Levee Mile	1.87
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130424_270.JPG	



Levee Mile Report Line	2
Start Levee Mile	0.01
End Levee Mile	1.87
Location	Water Side
Category	
Item	Vegetation
Typical W/S vegetation.	
rburnett_s_20130424_271.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Unit Cover Sheet

Spring 2013 Levee Inspection Results

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles
Unit No. 09 Feather River, TRLIA Setback Levee	Left	5.73

	Spring (March - May)	Summer (June - August)	(September - November) Fall	Winter (December - February)
Unit Maintenance Rating (Fall Only)				
Date of Inspection	04/24/2013 - 04/24/2013			
DWR Inspector	Rick Burnett			
Accompanied By				

Summer & Winter Inspections

The Local Maintaining Agency (LMA) is responsible for summer and winter inspections. The LMA is required to submit a report regarding summer and winter inspections to the California Department of Water Resources (DWR).

DWR must be informed on the:

- a) completion of the inspection
- b) any changes other than the results of normal maintenance
- c) corrections to deficiencies noted in this report

If additional items are noted, further documentation of those items must also be submitted.

The LMA should submit this information to DWR using the LMA web application tool available at:

<http://cdec.water.ca.gov/lma.html>

If the LMA is unable to submit information on this webpage, please contact DWR for assistance.

The LMA should submit the information and any associated documentation by September 30 for summer inspections and March 31 for winter inspections.

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 09 Feather River, TRLIA Setback Levee	Left	5.73	04/24/2013 04/24/2013	Rick Burnett

LMIR No.	Levee Mile		Category	Item	Location	Rating	Action/Comment	GPS Latitude/Longitude		Issue No. Photo
	Start	End						Start	End	
1	0.03	0.03		Vegetation	LS	A	V1 : Control annual grass and weeds on the levee slopes and easements.	39.089641 °	39.089641 °	1
					Ma			-121.584912 °	-121.584912 °	Y

DWR ID: DWR_RD0784_09_s_2013_1

<p>* Location</p> <p>LS : Land Side WS : Water Side CR : Crown</p>	<p>** Rating</p> <p>A : Acceptable M : Minimally Acceptable U : Unacceptable</p> <p>N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain</p>	<p>+ Issue Type</p> <p>Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement</p>
---	--	--

**Flood Control Project Maintenance
Levee Inspections**

Levee Inspection Report By Mile - Spring 2013

Reclamation District No. 0784 Plumas Lake

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 09 Feather River, TRLIA Setback Levee	Left	5.73	04/24/2013 04/24/2013	Rick Burnett

Levee Mile Report Line	1
Start Levee Mile	0.03
End Levee Mile	0.03
Location	Land Side
Category	
Item	Vegetation
Typical L/S vegetation.	
rburnett_s_20130424_267.JPG	



* Location LS : Land Side WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---